

Measure:

Positive Lead	Measurement / Action	Negative Lead
C930-5	Ω	Ground

Is the resistance greater than 10, 000 ohms?

Yes	For vehicles not equipped with vista roof, INSTALL a new rear interior lamp. If the condition is still present, INSTALL a new overhead console. REFER to: Overhead Console . For vehicles equipped with vista roof, if both rear interior lamps are inoperative, INSTALL a new overhead console. REFER to: Overhead Console . For vehicles equipped with vista roof, if only one rear interior lamp is inoperative, INSTALL a new rear interior lamp.
------------	---

No	REPAIR the circuit.
-----------	---------------------

B12 CHECK FOR CORRECT BCM (BODY CONTROL MODULE) OPERATION

Disconnect and inspect all BCM connectors and related in-line connectors.

Repair:

corrosion (install new connector or terminals - clean module pins)

damaged or bent pins - install new terminals/pins

pushed-out pins - install new pins as necessary

Reconnect the BCM connectors and related in-line connectors. Make sure they seat and latch correctly.

Operate the system and determine if the concern is still present.

Is the concern still present?

Yes	CHECK OASIS for any applicable Technical Service Bulletins (TSBs). If a TSB exists for this concern, DISCONTINUE this test and FOLLOW TSB instructions. If no Technical Service Bulletins (TSBs) address this concern,
------------	--

No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues. CLEAR the Diagnostic Trouble Codes (DTCs).
-----------	---

DIAGNOSIS AND TESTING > INTERIOR LIGHTING > PINPOINT TESTS > PINPOINT TEST C : ALL THE COURTESY LAMPS STAY ON CONTINUOUSLY

Refer to Remote Keyless Entry and Alarm for schematic and connector information.

Normal Operation and Fault Conditions