

Is DTC U0212:00 set in other modules?

Yes	INSTALL a new SCCM. REFER to: Steering Column Control Module (SCCM) .
No	INSTALL a new CCM.REFER to: Cruise Control Module (CCM) .

DIAGNOSIS AND TESTING > CRUISE CONTROL > PINPOINT TESTS > PINPOINT TEST N : U0265:00

Refer to Power Mirrors for schematic and connector information.

Normal Operation and Fault Conditions

REFER to: Cruise Control - System Operation and Component Description .

DTC Fault Trigger Conditions

DTC	Description	Fault Trigger Conditions
U0265:00	Lost Communication With Image Processing Module Sensor A: No Sub Type Information	Sets in the CCM if data messages received from the IPMA over the HS-CAN2 are missing.

Possible Sources

- CCM
- IPMA

DIAGNOSIS AND TESTING > CRUISE CONTROL > PINPOINT TESTS > PINPOINT TEST N : U0265:00 > PINPOINT TEST N : U0265:00**N1 VERIFY THE CUSTOMER CONCERN**

Ignition ON.

Verify there is an observable symptom present.

Is an observable symptom present?

Yes	GO to N2
No	The system is operating normally at this time. The DTC may have been set due to high network traffic or an intermittent fault condition.

N2 CHECK THE COMMUNICATION NETWORK