

### Is the concern still present?

|            |                                                                                                                                                                                                                                                                                       |
|------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Yes</b> | CHECK OASIS for any applicable Technical Service Bulletins (TSBs). If a TSB exists for this concern, DISCONTINUE this test and FOLLOW the TSB instructions. If no Technical Service Bulletins (TSBs) address this concern, INSTALL a new EPB module. REFER to: Parking Brake Module . |
| <b>No</b>  | The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.                                                                                                                        |

## DIAGNOSIS AND TESTING > PARKING BRAKE > PINPOINT TESTS > PINPOINT TEST J : U0151:87

Refer to Module Communications Network for schematic and connector information.

### Normal Operation and Fault Conditions

With the ignition ON, the RCM sends messages to the EPB module over the HS-CAN2. If the EPB module does not receive these messages within the specified time frame, the EPB module sets Diagnostic Trouble Codes (DTCs). This can be due to a RCM failure, a circuit failure on the network or an excessive load on the network. For information on the messages sent to the EPB module by the RCM, REFER to: Parking Brake - System Operation and Component Description .

### DTC Fault Trigger Conditions

| DTC      | Description                                                        | Fault Trigger Conditions                                                                         |
|----------|--------------------------------------------------------------------|--------------------------------------------------------------------------------------------------|
| U0151:87 | Lost Communication With Restraints Control Module: Missing Message | This DTC sets in continuous memory if the EPB module does not receive any messages from the RCM. |

### Possible Causes

- Wiring, terminals or connectors
- Network communication concern
- RCM
- EPB module

## DIAGNOSIS AND TESTING > PARKING BRAKE > PINPOINT TESTS > PINPOINT TEST J : U0151:87 > PINPOINT TEST J : U0151:87

J1 CHECK THE COMMUNICATION NETWORK

Ignition ON.