

corrosion (install new connector or terminals - clean module pins)

damaged or bent pins - install new terminals/pins

pushed-out pins - install new pins as necessary

Reconnect the IPC connector and related in-line connectors. Make sure it seats and latches correctly.

Operate the system and determine if the concern is still present.

Is the concern still present?

Yes	CHECK OASIS for any applicable Technical Service Bulletins (TSBs). If a TSB exists for this concern, DISCONTINUE this test and FOLLOW TSB instructions. If no Technical Service Bulletins (TSBs) address this concern,
No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.

DIAGNOSIS AND TESTING > INSTRUMENTATION, MESSAGE CENTER AND WARNING CHIMES > PINPOINT TESTS > PINPOINT TEST CD : U3003:17

Normal Operation and Fault Conditions

IPC DTC Fault Trigger Conditions

DTC	Description	Fault Trigger Conditions
U3003:17	Battery Voltage: Circuit Voltage Above Threshold	Sets in the IPC in continuous memory if the IPC detects battery voltage above 16 volts on the voltage supply circuit for 5 seconds or longer.

Possible Sources

- Charging system concern
- IPC

DIAGNOSIS AND TESTING > INSTRUMENTATION, MESSAGE CENTER AND WARNING CHIMES > PINPOINT TESTS > PINPOINT TEST CD : U3003:17 > PINPOINT TEST CD : U3003:17

CD1 CHECK FOR OVERCHARGING DIAGNOSTIC TROUBLE CODES (DTCS) SET IN OTHER MODULES