

		module PMI procedure as directed by the diagnostic scan tool. REFER to: Module Configuration - System Operation and Component Description . See PMI. If there have been no recent service actions, the audio DSP module has failed to retain configuration data. INSTALL a new audio DSP module. REFER to: Audio Digital Signal Processing (DSP) Module .
U3000:41	Control Module: General Checksum Failure	CLEAR the DTC. WAIT at least 10 seconds. REPEAT the self-test. If DTC U3000:41 is retrieved again, INSTALL a new audio DSP module. REFER to: Audio Digital Signal Processing (DSP) Module .
U3003:16	Battery Voltage: Circuit Voltage Below Threshold	GO to Pinpoint Test AT
U3003:17	Battery Voltage: Circuit Voltage Above Threshold	GO to Pinpoint Test AU

DIAGNOSIS AND TESTING > INFORMATION AND ENTERTAINMENT SYSTEM > DTC CHART: DACMC

DTC	Description	Action
U0100:00	Lost Communication With ECM/PCM "A": No Sub Type Information	GO to Pinpoint Test AF
U0140:00	Lost Communication With Body Control Module: No Sub Type Information	GO to Pinpoint Test AG
U2024:00	Control Module Cal-Config Data: No Sub Type Information	This DTC sets due to an incomplete or incorrect DACMC PMI. CHECK the vehicle service history for recent service actions related to the DACMC or ACM. If there have been recent service actions with the DACMC or ACM, REPEAT/PERFORM the DACMC PMI procedure as directed by the diagnostic scan tool. REFER to: Module Configuration - System Operation and Component Description . See PMI.

		If there have been no recent service actions, the DACMC has failed to retain configuration data. INSTALL a new ACM. REFER to: Audio Front Control Module (ACM) .
U2100:00	Initial Configuration Not Complete: No Sub Type Information	This DTC sets due to an incomplete or incorrect DACMC PMI. CHECK the vehicle service history for recent service actions related to the DACMC or ACM. If there have been recent service actions with the DACMC or ACM, REPEAT/PERFORM the DACMC PMI procedure as directed by the diagnostic scan tool. REFER to: Module Configuration - System Operation and Component Description . See PMI. If there have been no recent service actions, the DACMC has failed to retain configuration data. INSTALL a new ACM. REFER to: Audio Front Control Module (ACM) .
U2101:00	Control Module Configuration Incompatible: No Sub Type Information	This DTC sets due to an incomplete or incorrect DACMC PMI. CHECK the vehicle service history for recent service actions related to the DACMC or ACM. If there have been recent service actions with the DACMC or ACM, REPEAT/PERFORM the DACMC PMI procedure as directed by the diagnostic scan tool. REFER to: Module Configuration - System Operation and Component Description . See PMI. If there have been no recent service actions, the DACMC has failed to retain configuration data. INSTALL a new ACM. REFER to: Audio Front Control Module (ACM) .
U3000:41	Control Module: General Checksum Failure	CLEAR the Diagnostic Trouble Codes (DTCs). WAIT at least 10 seconds. REPEAT the self-test. If DTC U3000:41 is retrieved again, INSTALL a new ACM. REFER to: Audio Front Control Module (ACM) .