

No	REPAIR the circuit.
-----------	---------------------

U8 CHECK THE MEDIA HUB GROUND CIRCUIT FOR A SHORT TO VOLTAGE

Ignition ON.

Measure:

Positive Lead	Measurement / Action	Negative Lead
C3618-12		Ground

Is any voltage present?

Yes	REPAIR the circuit.
------------	---------------------

No	GO to U9
-----------	----------

U9 CHECK FOR CORRECT APIM (SYNC MODULE) OPERATION

Ignition OFF.

Disconnect and inspect the APIM connector.

Repair:

Corrosion (clean module pins or install new connectors or terminals)

Damaged or bent pins (install new terminals or pins)

Pushed-out pins (install new pins as necessary)

Reconnect the APIM connector. Make sure it seats and latches correctly.

Operate the system and determine if the concern is still present.

Is the concern still present?

Yes	CHECK OASIS for any applicable Technical Service Bulletins (TSBs). If a TSB exists for this concern, DISCONTINUE this test and FOLLOW the TSB instructions. If no Technical Service Bulletins (TSBs) address this concern, PERFORM the APIM Hardware Test. Refer to APIM HARDWARE TESTING .
------------	---

No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.
-----------	--