

Pinpoint Test - DTC: AL

U0253:00

Normal Operation and Fault Conditions

The RCM uses information contained in messages from the APIM sent on the HS-CAN2.

DTC Fault Trigger Conditions

DTC	Description	Fault Trigger Conditions
U0253:00	Lost Communication with Accessory Protocol Interface Module: No Sub Type Information	This DTC sets if the RCM does not receive an expected message from the APIM.

Possible Sources

- Network traffic
- APIM
- RCM

PINPOINT TEST A : U0253:00



WARNING: Do not handle, move or change the original horizontal mounting position of the Restraints Control Module (RCM) while the Restraints Control Module (RCM) is connected and the ignition switch is ON. Failure to follow this instruction may result in the accidental deployment of the Safety Canopy® and cause serious personal injury or death.

NOTE: Most faults are due to connector and/or wiring concerns. Carry out a thorough inspection and verification before proceeding with the pinpoint test.