

	and FOLLOW TSB instructions. If no Technical Service Bulletins (TSBs) address this concern, INSTALL a new PCM. Refer to the appropriate article for the procedure.
No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.

DIAGNOSIS AND TESTING > INSTRUMENTATION, MESSAGE CENTER AND WARNING CHIMES > PINPOINT TESTS > PINPOINT TEST AP : THE OVERSPEED WARNING RTT (RECONFIGURABLE TELLTALE) (GULF COOPERATIVE COUNTRIES [GCC]) IS NEVER OR ALWAYS ON

Normal Operation and Fault Conditions

See Overspeed Warning RTT. REFER to: Message Center - System Operation and Component Description .

If the vehicle speed message is missing or invalid for less than 5 seconds, the IPC defaults the overspeed warning RTT to the last indication state (on or off), based upon on the last message received.

If the vehicle speed message is missing or invalid for 5 seconds or longer, the IPC defaults the overspeed warning RTT off.

Possible Sources

- Speedometer indication concern
- IPC configuration concern
- IPC

DIAGNOSIS AND TESTING > INSTRUMENTATION, MESSAGE CENTER AND WARNING CHIMES > PINPOINT TESTS > PINPOINT TEST AP : THE OVERSPEED WARNING RTT (RECONFIGURABLE TELLTALE) (GULF COOPERATIVE COUNTRIES [GCC]) IS NEVER OR ALWAYS ON > PINPOINT TEST AP : THE OVERSPEED WARNING RTT (RECONFIGURABLE TELLTALE) (GULF COOPERATIVE COUNTRIES [GCC]) IS NEVER OR ALWAYS ON

AP1 CHECK THE MESSAGE CENTER OPERATION

Ignition ON.

Close all doors, the hood and luggage compartment lid.

Clear all message center warnings by pressing the OK button for each warning present.

Monitor the door ajar RTT.