

Operate the system and determine if the concern is still present.

Is the concern still present?

Yes	CHECK OASIS for any applicable Technical Service Bulletins (TSBs). If a TSB exists for this concern, DISCONTINUE this test and FOLLOW TSB instructions. If no Technical Service Bulletins (TSBs) address this concern, INSTALL a new IPC. REFER to: Instrument Panel Cluster (IPC) .
No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.

DIAGNOSIS AND TESTING > INSTRUMENTATION, MESSAGE CENTER AND WARNING CHIMES > PINPOINT TESTS > PINPOINT TEST BT : U0151:00

Normal Operation and Fault Conditions

IPC DTC Fault Trigger Conditions

DTC	Description	Fault Trigger Conditions
U0151:00	Lost Communication With Restraints Control Module: No Sub Type Information	Sets in continuous memory in the IPC if data messages received from the RCM through the GWM are missing for 5 seconds or longer.

Possible Sources

- Communication concern
- Battery voltage concern
- GWM concern
- RCM
- IPC

DIAGNOSIS AND TESTING > INSTRUMENTATION, MESSAGE CENTER AND WARNING CHIMES > PINPOINT TESTS > PINPOINT TEST BT : U0151:00 > PINPOINT TEST BT : U0151:00

BT1 VERIFY THE CUSTOMER CONCERN

Ignition ON.

Verify there is an observable symptom present.