

Possible Causes:

- Module programming error
- Aftermarket performance products
- Damaged PCM

Diagnostic Aids: Reprogram or update the calibration. Check for other DTCs and diagnose those first. Check for aftermarket performance products before installing a new PCM. Clear the DTCs, repeat the self-test. If the DTC is retrieved again, install a new PCM. Refer to FLASH ELECTRICALLY ERASABLE PROGRAMMABLE READ ONLY MEMORY (EEPROM) , Programming the VID Block for a Replacement PCM.

Application	Key On Engine Off	Key On Engine Running	Continuous Memory
All	Refer to the Description, Possible Causes and Diagnostic Aids for the DTC.		

DIAGNOSTIC TROUBLE CODE (DTC) CHARTS AND DESCRIPTIONS > P060A - INTERNAL CONTROL MODULE MONITORING PROCESSOR PERFORMANCE - DTC CHART

P060A - INTERNAL CONTROL MODULE MONITORING PROCESSOR PERFORMANCE - DTC CHART

Description: This DTC sets when an error occurs in the PCM. This DTC may set alone or with P2105.

Possible Causes:

- Software incompatibility issue
- Damaged PCM

Diagnostic Aids: Verify the PCM is at the latest calibration level.

Application	Key On Engine Off	Key On Engine Running	Continuous Memory
All	GO to Pinpoint Test QE .		

DIAGNOSTIC TROUBLE CODE (DTC) CHARTS AND DESCRIPTIONS > P060B - INTERNAL CONTROL MODULE A/D PROCESSING PERFORMANCE - DTC CHART

P060B - INTERNAL CONTROL MODULE A/D PROCESSING PERFORMANCE - DTC CHART

Description: This DTC sets when an error occurs in the PCM.

Possible Causes:

- Damaged PCM