

No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.
-----------	--

I15 CHECK FOR CORRECT BCM (BODY CONTROL MODULE) OPERATION

Ignition OFF.

Disconnect and inspect all BCM connectors.

Repair:

corrosion (install new connector or terminals - clean module pins)

damaged or bent pins - install new terminals/pins

pushed-out pins - install new pins as necessary

Reconnect the BCM connectors. Make sure they seat and latch correctly.

Operate the system and determine if the concern is still present.

Is the concern still present?

Yes	CHECK OASIS for any applicable Technical Service Bulletins (TSBs). If a TSB exists for this concern, DISCONTINUE this test and FOLLOW the TSB instructions. If no Technical Service Bulletins (TSBs) address this concern,
------------	--

No	The system is operating correctly at this time. The concern may have been caused by module connections. ADDRESS the root cause of any connector or pin issues.
-----------	--

DIAGNOSIS AND TESTING > CHARGING SYSTEM - 3.7L DURATEC (227KW 301PS) > COMPONENT TEST - GENERATOR CLUTCH

1.

Remove the generator. REFER to: Generator - 3.7L Duratec (227kW/301PS) .



2.

Using a small screwdriver or similar tool, insert the tool through the rubber button on the center of the pulley cap and pry off the cap. Discard the cap. A new cap must be installed if the clutch is OK.