

PUBLISHED: 02-OCT-2019
2020.0 DEFENDER (LE), 501-30

REAR END SHEET METAL REPAIRS

REAR SIDE MEMBER CLOSING PANEL - 110 (G2416533)

mcx30.com


REMOVAL

 NOTE:

In this procedure the rear side member closing panel is installed in conjunction with:

- Rear wheelhouse lower rear extension
- Tailgate reinforcement
- Back panel inner
- Back panel inner extensions
- Rear floor panel

1.

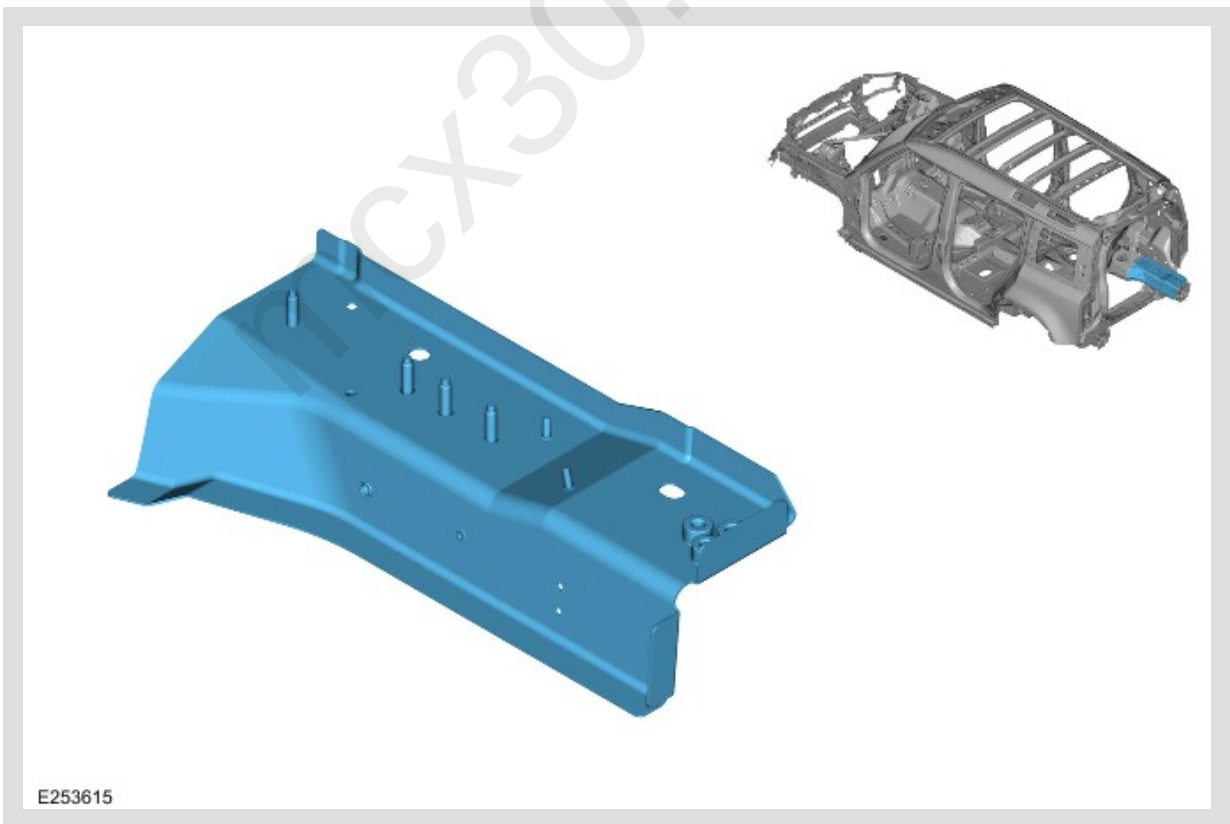

The rear side member closing panel is serviced as indicated.

2.

Before commencing this procedure make sure that you are aware of all Health and Safety requirements. Refer to: [Health and Safety Precautions](#) (100-00 General Information, Description and Operation).

**NOTES:**

- Where Breakstem Fastener (BSF) removal is instructed remove the fastener shaft with a 4 mm punch and remove the head with a 6.5 mm drill bit. Clean all the drilled holes to make sure they are free from debris.
- Where Self Piercing Rivet (SPR) removal is instructed use either the Jaguar Land Rover (JLR) approved SPR tool or a 5.3 mm drill bit. Clean all the drilled holes to make sure they are free from debris.
- Any joints sealed as part of vehicle manufacture must be sealed as part of the repair.
- To make sure that the vehicle is correctly aligned it must be placed on a Jaguar Land Rover (JLR) approved alignment jig.

When installing the rear side member closing panel make sure that you are aware of the methods, tools and fixings used in this procedure.

Refer to: [Body Repairs](#) (501-25A Body Repairs - General Information, Description and Operation).

Refer to: [Adhesives, Fixings and Consumables](#) (501-25A Body Repairs - General Information, Description and Operation).

4. For additional information on the fixings required to complete this procedure

Refer to: [Specifications - 110](#) (501-30 Rear End Sheet Metal Repairs, Specifications).

5. For additional removal information

Refer to: [Rear Wheelhouse Lower Rear Extension - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

6. For additional removal information

Refer to: [Tailgate Reinforcement Right Side - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

Refer to: [Tailgate Reinforcement Left Side - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

7. For additional removal information

Refer to: [Back Panel Inner - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).


8. For additional removal information

Refer to: [Back Panel Inner Extensions - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

9. For additional removal information

Refer to: [Rear Floor Panel - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

10.

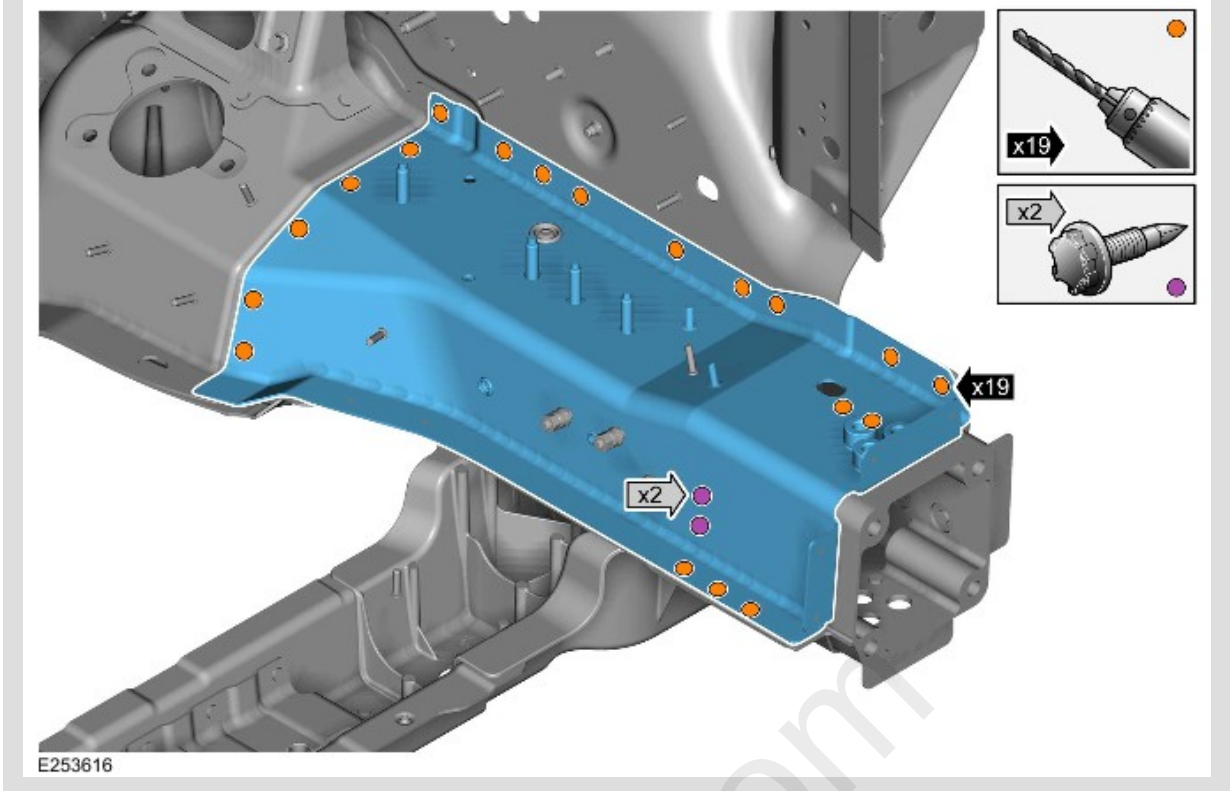

Remove the self piercing rivets and friction drilling screws as indicated.

11. Carefully separate the joints and remove the rear side member closing panel.

INSTALLATION


⚠ CAUTION:

Where structural adhesive is to be applied between surfaces it is essential compression is applied to the joints during the curing period.

△ NOTE:

Breakstem Fastener (BSF) installation involves using the Jaguar Land Rover (JLR) approved BSF installation tool and requires a hole diameter of 6.5 mm.

1. Remove the rivet remnants.
2. Dress the flanges where necessary.
3. Offer up the new rear side member closing panel and clamp into position. Check alignment, if correct proceed to next step, if not rectify and check the alignment again before proceeding.

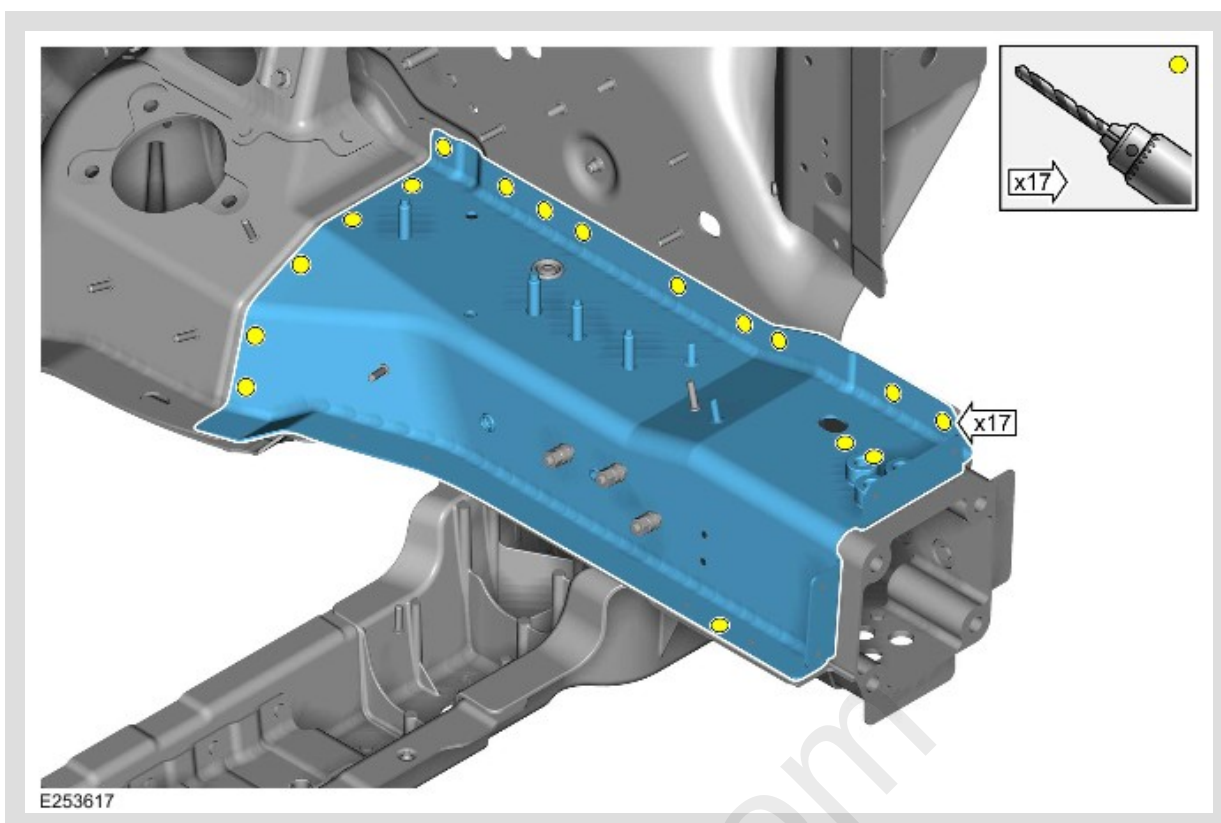


Drill holes where the Breakstem Fasteners (BSFs) are to be installed as indicated.


5.

 NOTE:

Make sure that the Jaguar Land Rover (JLR) recommended countersink tool is used for this step.

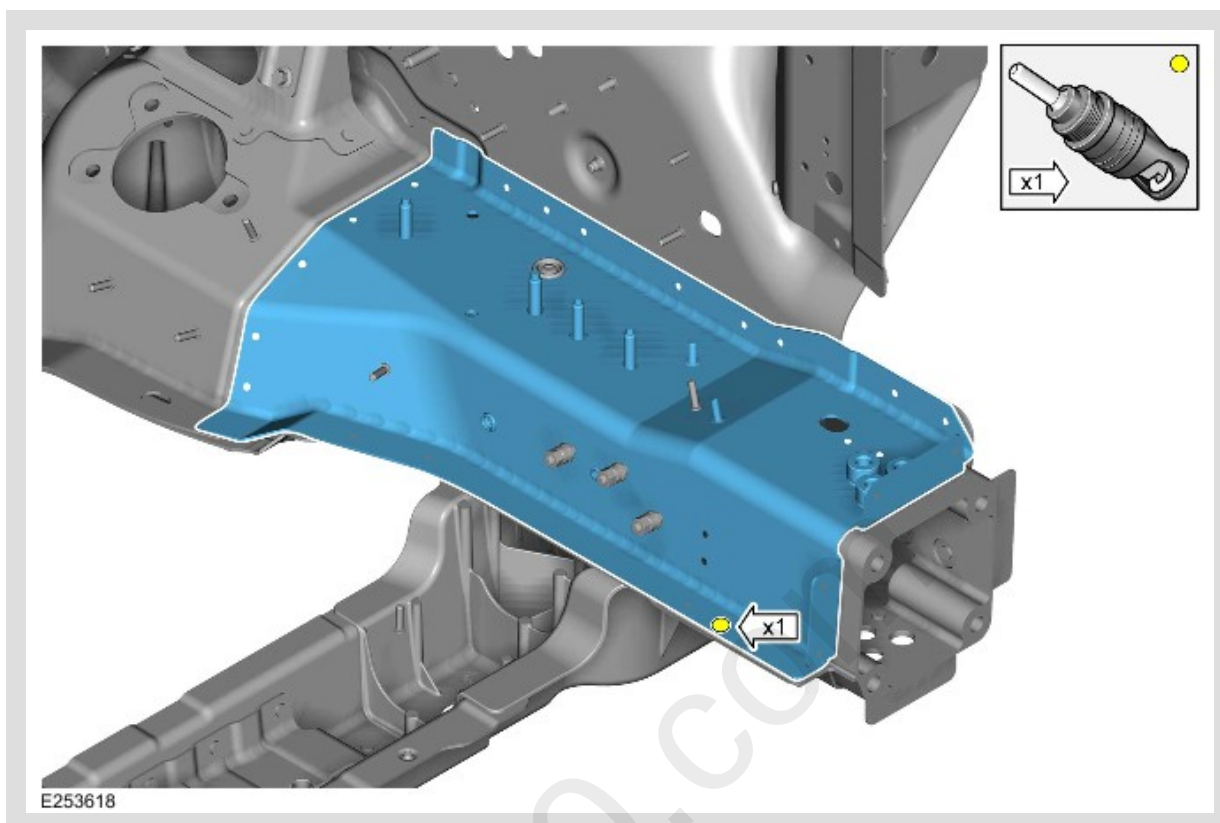

Countersink the hole to a depth of 2 mm as indicated.

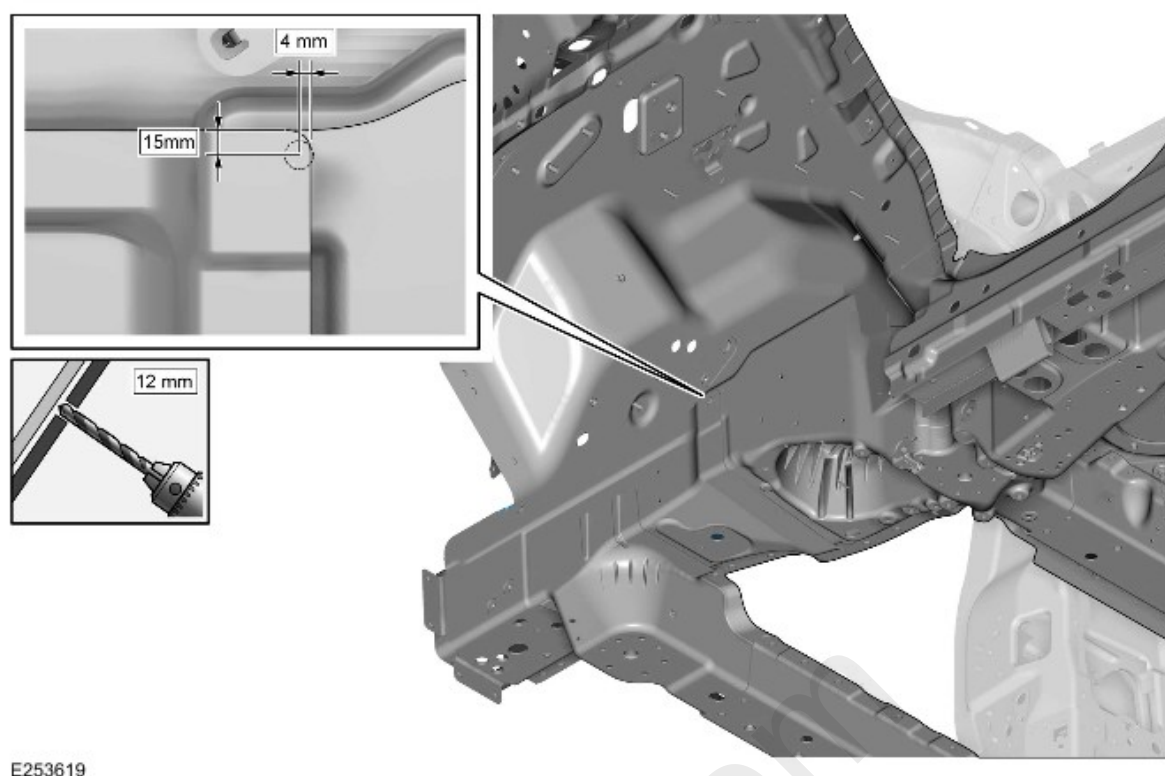


Drill a 12 mm hole for BSF access as indicated.

7.

NOTE:

When installing the rear side member closing panel in conjunction with the rear floor panel.

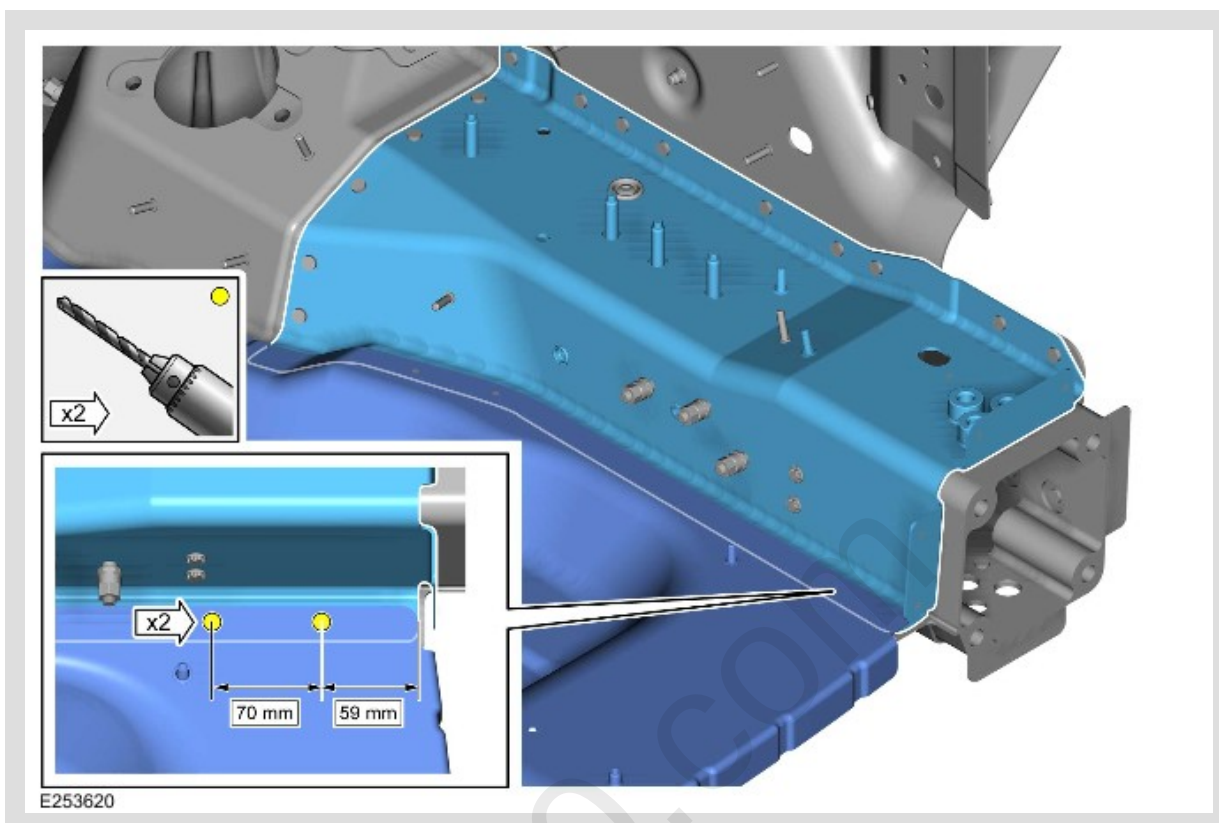

Drill holes where the BSFs are to be installed as indicated.

8. Remove the new rear side member closing panel and rear floor panel.


9. Deburr the drilled holes.

10. Clean and prepare the panel surfaces.

11.

 NOTE:

Make sure a continuous bead of adhesive surrounds the fixing holes.

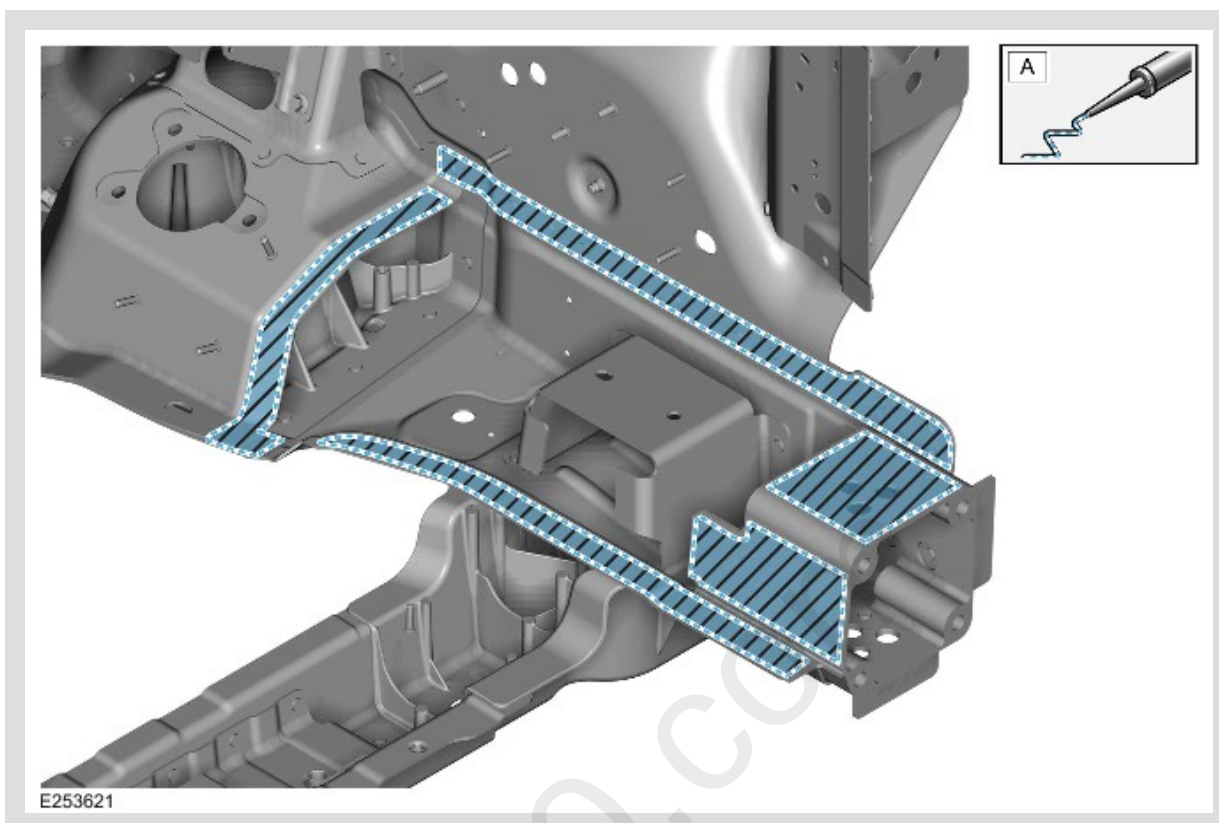


Apply a 5 mm zig zag bead of the Jaguar Land Rover (JLR) recommended bonding material as indicated.

12.

Offer up the new rear side member closing panel and clamp into position. Check alignment, if correct proceed to next step, if not rectify and check the alignment again before proceeding.


13.

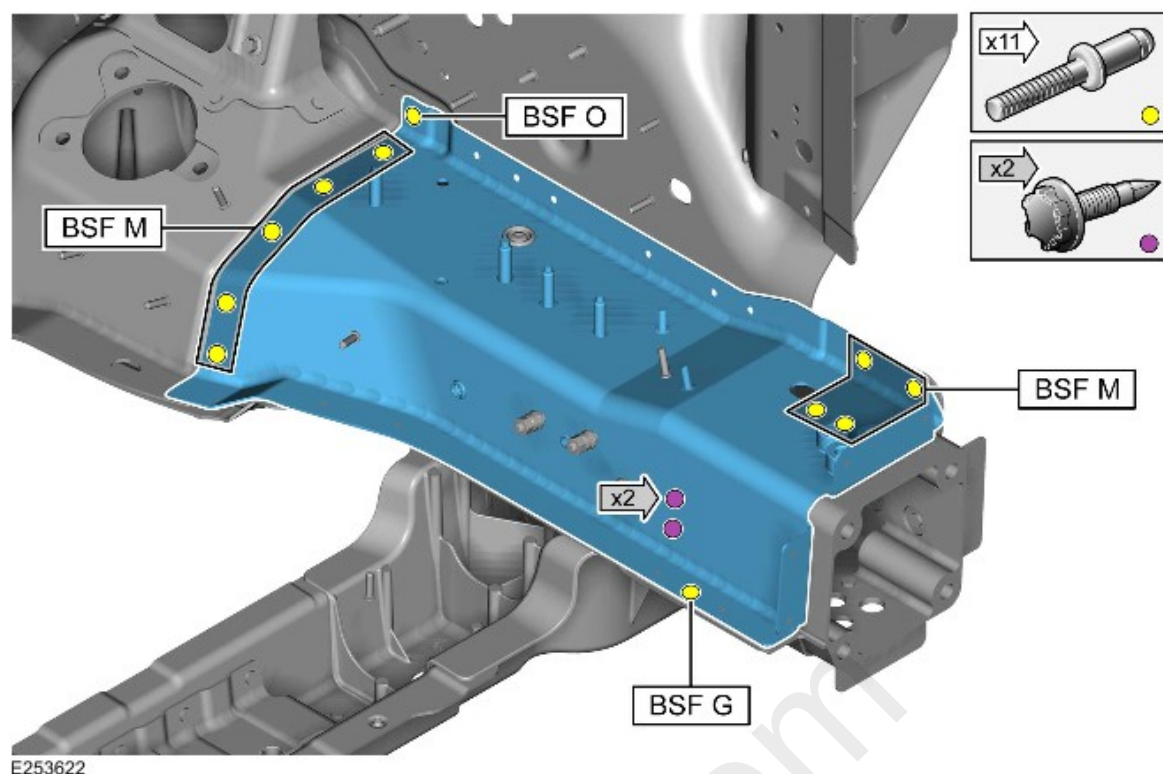

Install the BSFs as indicated. Install the new M6 Friction Drilling Screws (FDS) and tighten.

Torque: 10Nm

14.

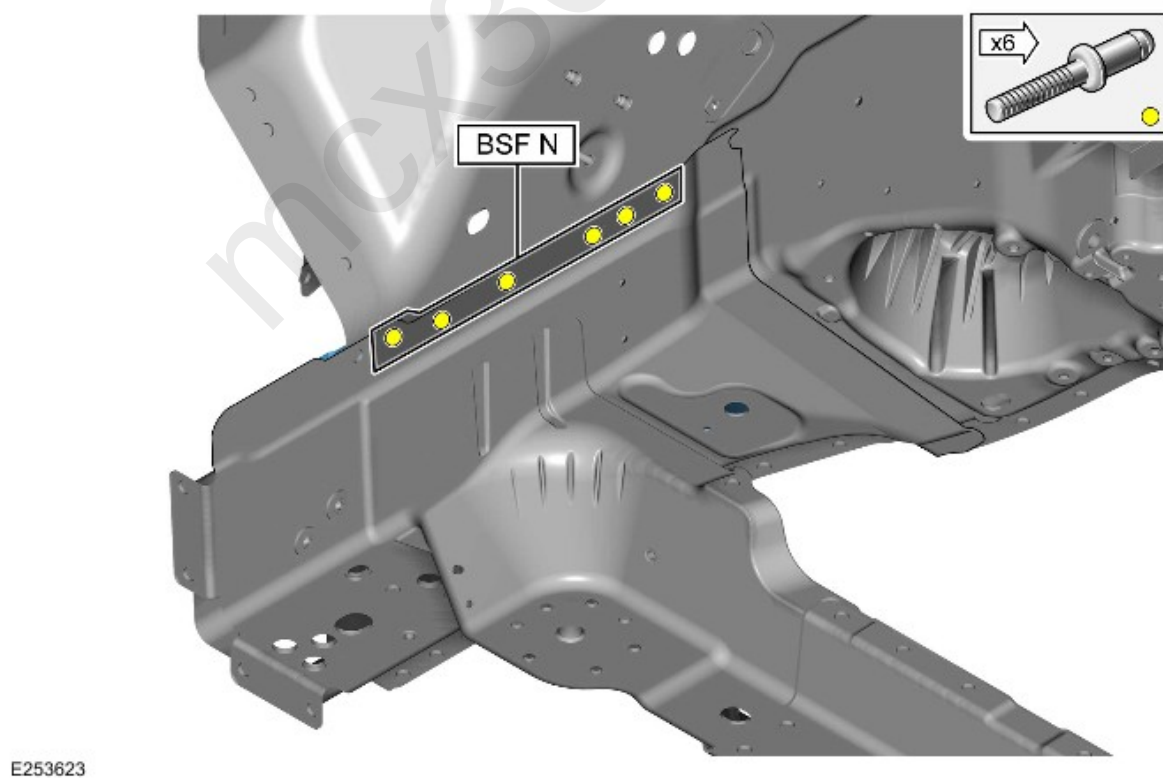


Install the BSFs as indicated.

15.

 NOTE:

When installing the rear side member closing panel in conjunction with the rear floor panel.

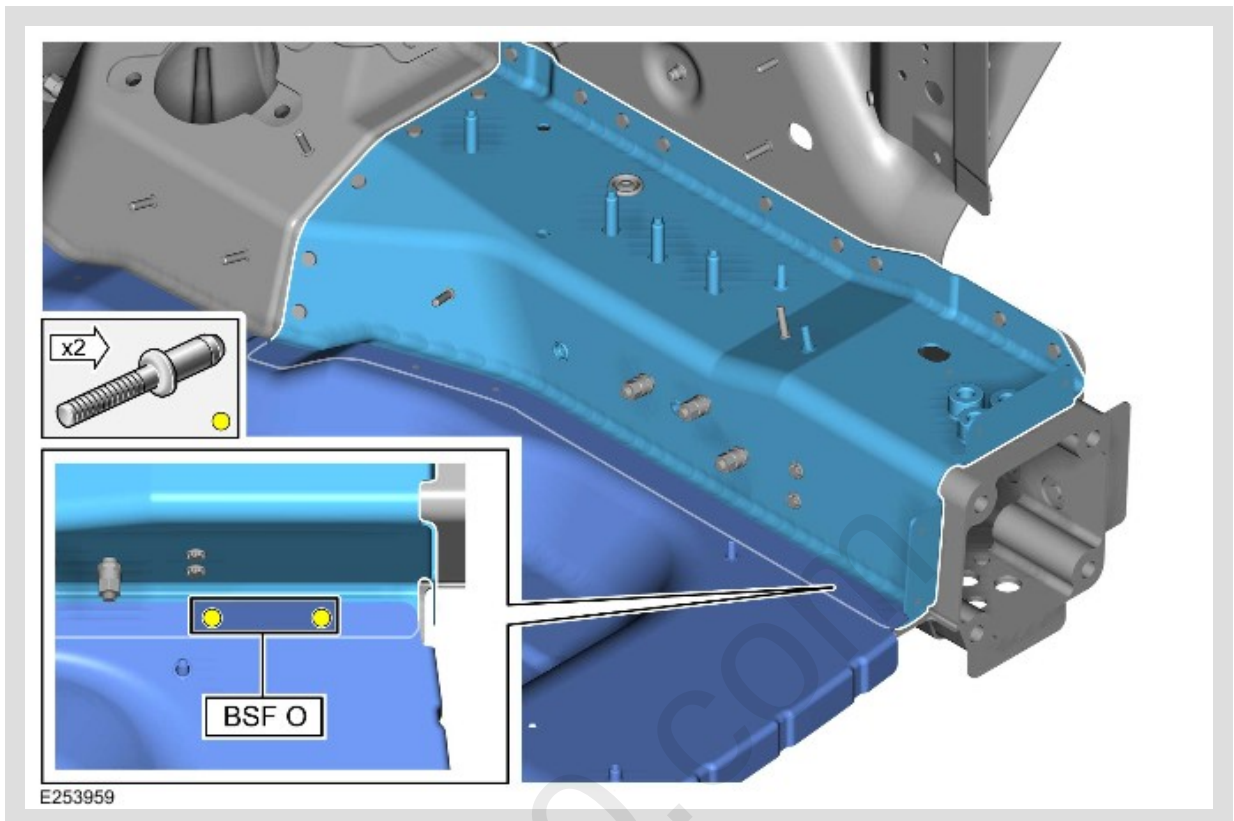

Install the BSFs as indicated.

16. Remove any excess adhesive.

17. Make sure that any open or exposed panel joints are correctly sealed.

18. Make sure corrosion protection is applied to all areas affected by the repair.

19. Make sure that all BSFs and FDS are sealed using a JLR recommended sealer.

 NOTE:

The installation of associated panels and components is the reversal of the removal procedure.

20. For additional installation information

Refer to: [Rear Floor Panel - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

21. For additional installation information

Refer to: [Back Panel Inner Extensions - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

22. For additional installation information

Refer to: [Back Panel Inner - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

23. For additional installation information

Refer to: [Tailgate Reinforcement Right Side - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

Refer to: [Tailgate Reinforcement Left Side - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).

24. For additional installation information

Refer to: [Rear Wheelhouse Lower Rear Extension - 110](#) (501-30 Rear End Sheet Metal Repairs, Removal and Installation).