


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. [Body Hardware and Trim](#)
- 2. [Interior Trim and Paneling](#)
- 3. [Repair Instructions](#)
- 4.

Windshield Garnish Molding Replacement

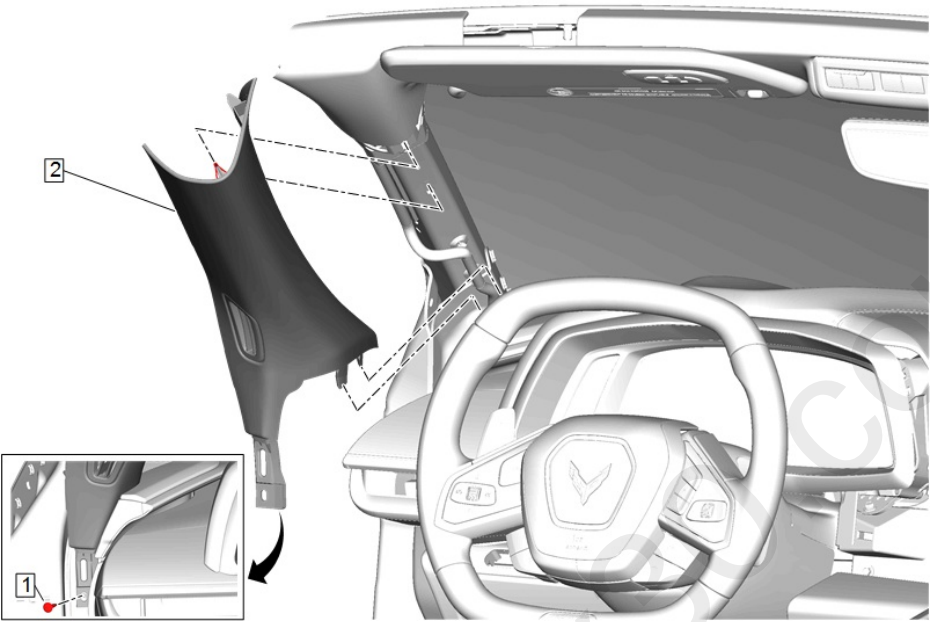

[Click here for full size
SIR Disabling and Enabling](#)

•

Body Hinge Pillar Garnish Molding Replacement

Fastener Caution

Tighten

2.5N-m (22 lb in)

[SIR Disabling and Enabling](#)

Callout	Component Name

Callout	Component Name
Caution: If a vehicle is equipped with a head curtain inflator module ensure that the inflator module and tether are undamaged. If tether or curtain airbag are damaged in any way, they must be replaced. Caution: Use care when working around the head curtain inflator module. Sharp tools may puncture the curtain airbag. If the head curtain inflator module is damaged in any way, it must be replaced. Preliminary Procedures 1. Disable the SIR system	
1>	Windshield Garnish Molding Bolt Caution :
2>	Windshield Garnish Molding Procedure 1. Disconnect the electrical connector. 2. Transfer components as necessary. 3. Enable the SIR System