


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Safety and Security
- 2. Remote Functions
- 3. Repair Instructions
- 4.

Low Frequency Body Side Antenna Replacement - Right Side

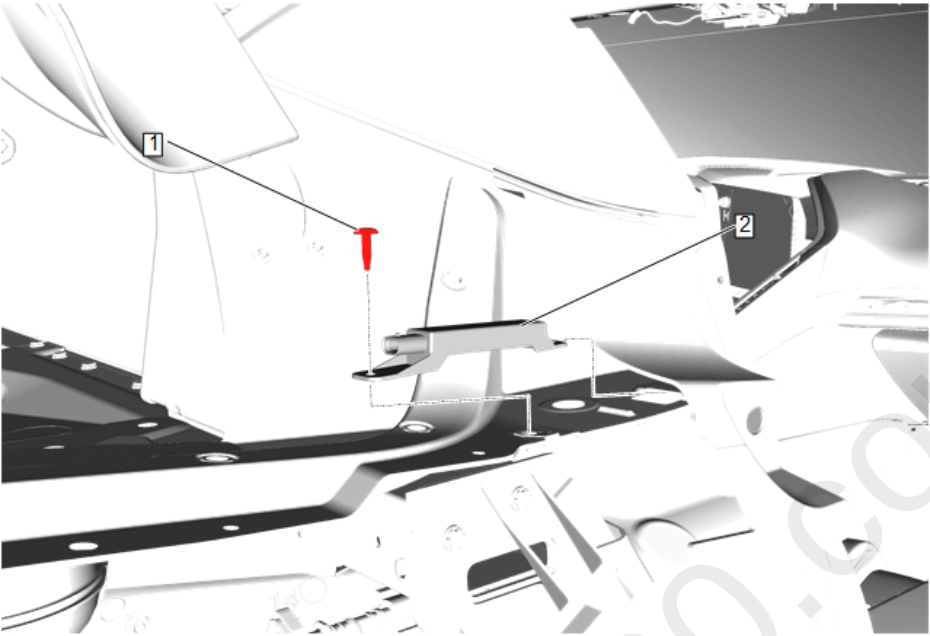

[Click here for full size](#)
Quarter Outer Panel Replacement - Right Side

Fastener Caution.

Tighten

2.5N-m (22 lb in)

Callout	Component Name
Preliminary Procedure	
1	Low Frequency Body Side Antenna Bolt Caution: Refer to
2	Low Frequency Body Side Antenna Procedure Disconnect the electrical connector.