


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Body Repair
- 2. Bolted Exterior Body Panels and Closures
- 3. Repair Instructions
- 4.

Front Side Door Adjustment

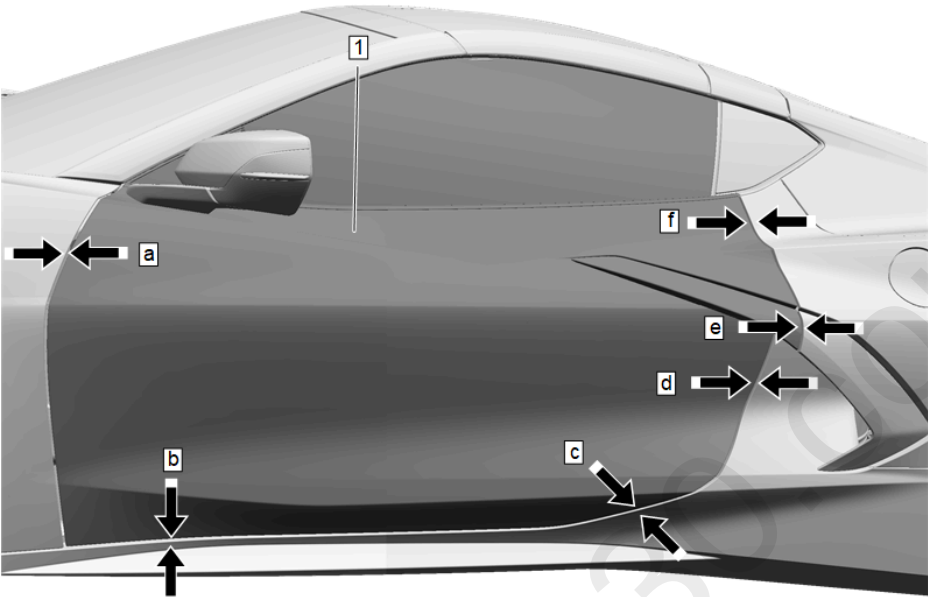

[Click here for full size](#)
Front Wheelhouse Liner Replacement - Left Side

•

Front Wheelhouse Liner Replacement - Right Side

Front Side Door Upper Hinge and Lower Hinge Replacement

- Front Side Door Latch Striker >> Adjust if necessary.

Front Side Door Latch Striker Adjustment

Adjustment:

- Front side door to front fender (a) 4.0 mm $\tilde{\Delta}$ 1.0 mm (0.16 in $\tilde{\Delta}$ 0.04 in)
- Front side door to rocker panel (b) 5.0 mm $\tilde{\Delta}$ 1.25 mm (0.20 in $\tilde{\Delta}$ 0.05 in)
- Front side door to lower door ring (c) 5.0 mm to 4.0 mm $\tilde{\Delta}$ 1.0 mm (0.20 in to 0.16 in $\tilde{\Delta}$ 0.04 in)
- Front side door to upper door ring (d) 4.0 mm $\tilde{\Delta}$ 1.0 mm (0.16 in $\tilde{\Delta}$ 0.04 in)
- Door handle applique to quarter panel applique (e) 4.0 mm $\tilde{\Delta}$ 1.0 mm (0.16 in $\tilde{\Delta}$ 0.04 in)
- Front side door to upper quarter panel (f) 4.0 mm $\tilde{\Delta}$ 1.0 mm (0.16 in $\tilde{\Delta}$ 0.04 in)

Callout	Component Name
---------	----------------

Callout	Component Name
Preliminary Procedure Remove the appropriate front wheelhouse liner: •	
1	Front Side Door Procedure 1. Loosen the 4 front side door hinge bolts to adjust the front side door. 2. Adjust the front side door in order to obtain the specified gap between the front side door to front fender, front side door to rocker panel, front side door to lower door ring, front side door to upper door ring, door handle applique to quarter panel applique, front side door to upper quarter panel. 3. Tighten the 4 front side door hinge bolts.