


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

1. Safety and Security
2. Supplemental Restraints
3. Repair Instructions
- 4.

Airbag Front End Discriminating Sensor Replacement

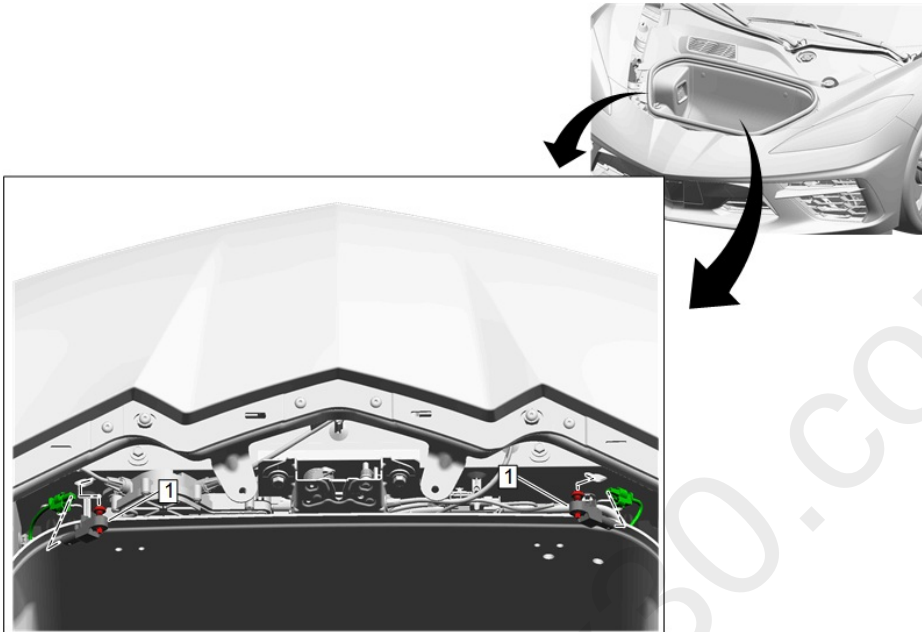

[Click here for full size
SIR Warning](#)

Warning:

Refer to

SIR Inflator Module Handling and Storage Warning.

Warning:

Following the deployment of a side impact air bag, inspect the following parts for damage. Replace these parts if necessary:

- The seat cushion frame
- The seat recliner, if equipped
- The seat adjuster
- The seat back frame

Failure to do so may cause future personal injury.

Preliminary Procedures

1. Disable the SIR system

SIR Disabling and Enabling

•

Front Compartment Side Sight Shield Replacement

•

Front Compartment Front Sight Shield Replacement

Fastener Caution.

Note:

Integral sensor assembly bolt uses Left Hand threads. Use counterclockwise rotation to loosen fastener at TORX[®] tip end. If accessing at pan head end of the fastener, use clockwise rotation to loosen bolt.

Procedure

- 1. Disconnect the electrical connector.
- 2. Loosen the fastener and slide the sensor out of the keyhole slot.
- 3. Enable the SIR System.

SIR Disabling and Enabling

Tighten

7.5 N-m (66 lb in)

Callout	Component Name
Warning:	
Refer to	
1	Airbag Front End Discriminating Sensor [2x] Caution: Refer to