


2022 CHEVROLET CORVETTE SERVICE MANUAL

- **SEARCH**

1. **Safety and Security**
2. **Supplemental Restraints**
3. **Repair Instructions**
- 4.

Airbag Side Impact Sensor Replacement

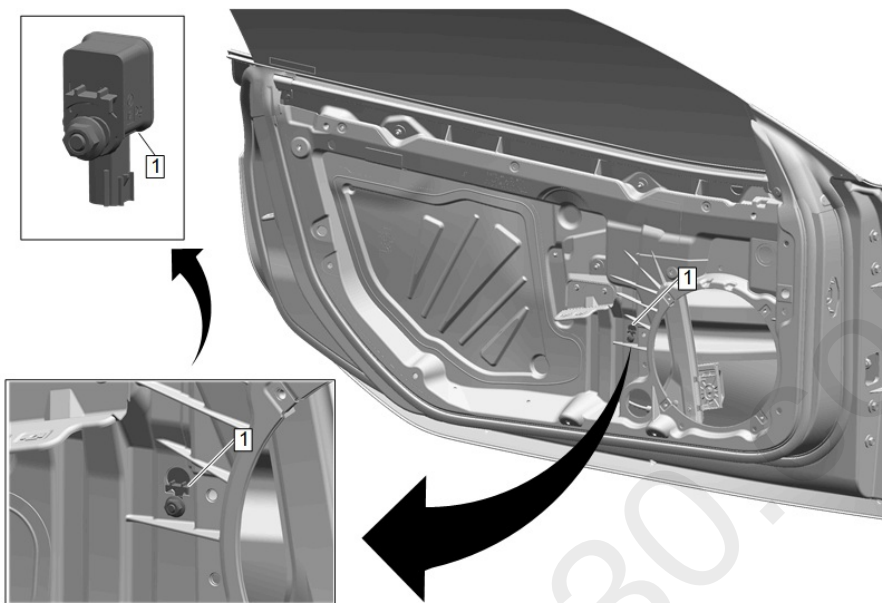

[Click here for full size SIR Warning](#)

Warning:

Refer to

[SIR Inflator Module Handling and Storage Warning](#)

Warning:

Following the deployment of a side impact air bag, inspect the following parts for damage. Replace these parts if necessary:

- The seat cushion frame
- The seat recliner, if equipped
- The seat adjuster
- The seat back frame

Failure to do so may cause future personal injury.

Preliminary Procedures

1. Disable the SIR system

[SIR Disabling and Enabling](#)

•

Radio Front Side Door Speaker Replacement

Fastener Caution.

Note:

For access to sensor detach the front side door inner panel tape partly from the front side door inner panel.

Procedure

- 1. Loosen the fastener and slide the sensor out of the keyhole slot.
- 2. Disconnect the electrical connector.
- 3. The nut is integral to the sensor, Do NOT remove separately.
- 4. Enable the SIR System.

SIR Disabling and Enabling

Tighten

7.5 N-m (66 lb in)

Callout	Component Name
Warning:	
Refer to	
1	Airbag Side Impact Sensor
	Caution:
	Refer to