


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Body Repair
- 2. Bolted Exterior Body Panels and Closures
- 3. Repair Instructions
- 4.

Front Side Door Wiring Harness Replacement

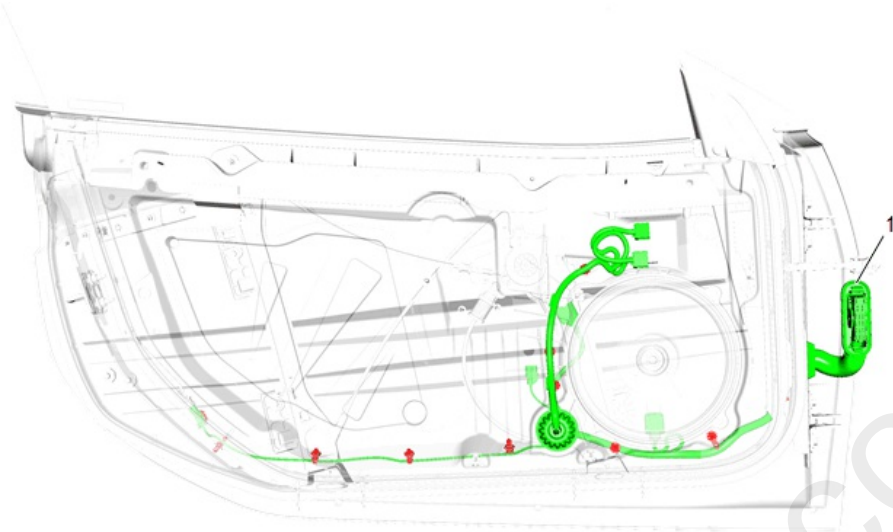

Click here for full size
SIR Warning

Preliminary Procedures

- 1. Disable the SIR system.

SIR Disabling and Enabling

-

Radio Front Side Door Speaker Replacement

-

Front Side Door Water Deflector Replacement

-

Front Side Door Replacement

SIR Disabling and Enabling

- Perform the necessary programming and setup procedure:

Window Motor Programming - Express Function

Callout	Component Name
Warning:	
Refer to	

Callout	Component Name
1	Front Side Door Wiring Harness Note: Typical wiring harness shown, individual harness may be different due to option content. Procedure 1. Disconnect all electrical connectors. 2. Remove the front side door wiring harness from the door. 3. Enable the SIR System.

mcx30.com