


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. [Body Repair](#)
- 2. [Bumpers and Fascias](#)
- 3. [Repair Instructions](#)
- 4.

Front Bumper Fascia Lower Stiffener Replacement

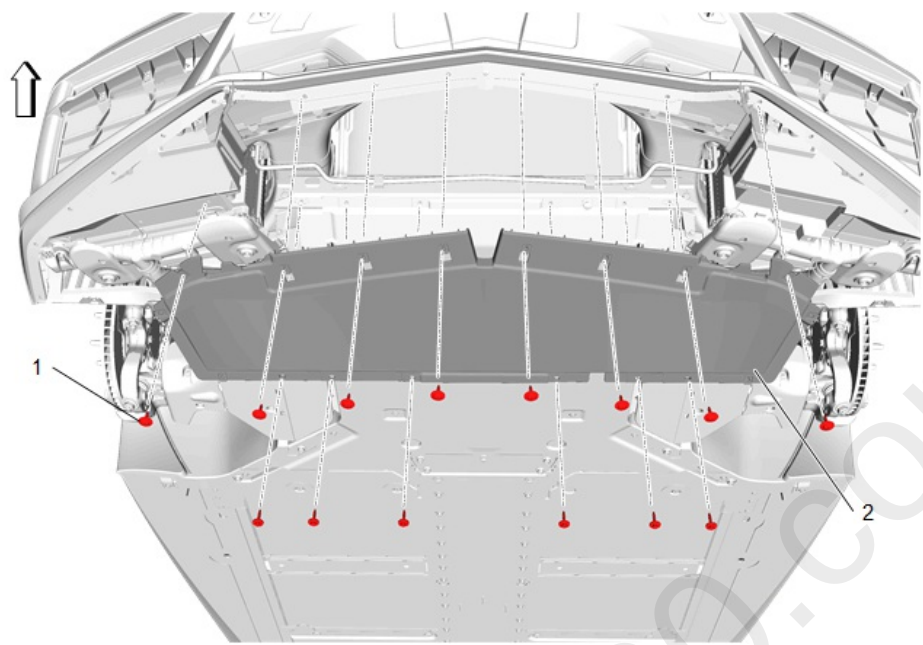

[Click here for full size](#)
Front Tire Front Air Deflector Replacement

Fastener Caution.

Tighten

2.5N-m (22 lb in)

Callout	Component Name
Preliminary Procedure	
1	Front Bumper Fascia Lower Reinforcement Bolt [12x]
	Caution:
	Refer to
2	Front Bumper Fascia Lower Stiffener