


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Engine/Propulsion
- 2. Engine Controls and Fuel - 6.2L (LT2)
- 3. Repair Instructions
- 4.

Engine Coolant Temperature Sensor Replacement

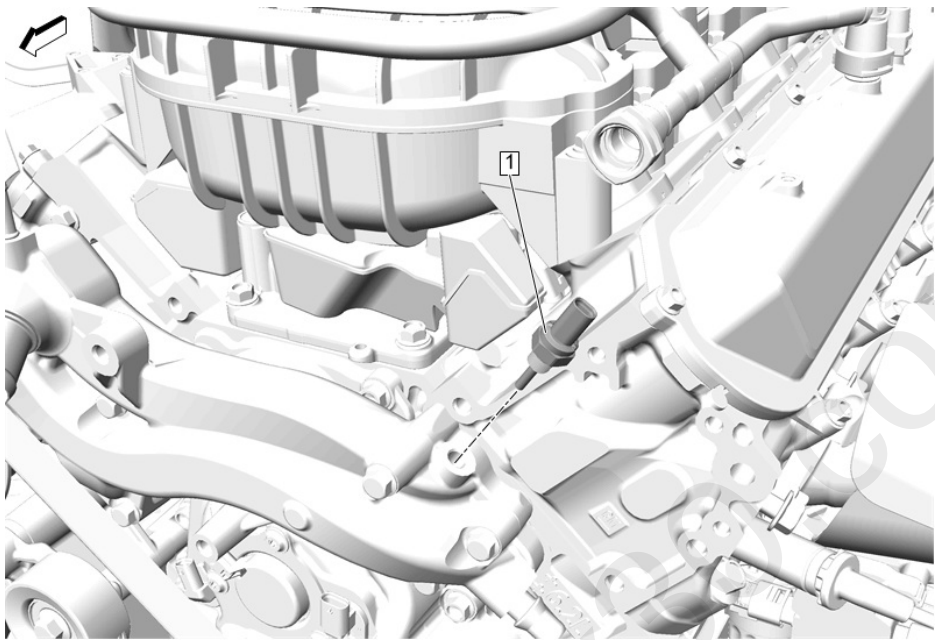

Click here for full size
Engine Oil Tank Replacement

Component Fastener Tightening Caution.

Procedure

Disconnect the electrical connector.

Tighten

28N-m (21 lb ft)

Callout	Component Name
Preliminary Procedure	
1	Engine Coolant Temperature Sensor
	Caution:
	Refer to