


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Engine/Propulsion
- 2. Engine Controls and Fuel - 6.2L (LT2)
- 3. Repair Instructions
- 4.

Ignition Coil Wire Replacement - Right Side

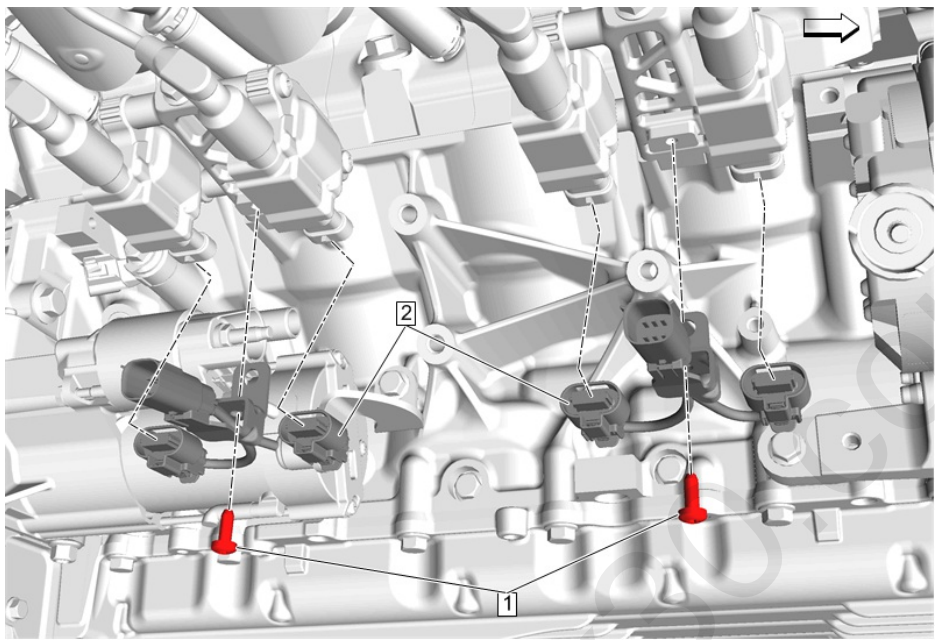

[Click here for full size](#)
Rear Cradle Shear Plate Replacement

- Disconnect the electrical connectors.
- Remove the 2 ignition coil bracket bolts at ignition coil bracket.

Ignition Coil Bracket Replacement - Right Side

Fastener Caution.

Tighten

5>N-m (44 lb in)

Callout	Component Name
Preliminary Procedures	
1.	
1	Ignition Coil Bracket Bolt [2>x]
	Caution:
	Refer to

Callout	Component Name
2	Ignition Coil Wire [2>x]
	Procedure
	Disconnect the electrical connectors from the ignition coils.

mcx30.com