


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Engine/Propulsion
- 2. Engine Controls and Fuel - 6.2L (LT2)
- 3. Repair Instructions
- 4.

Knock Sensor 1 Replacement

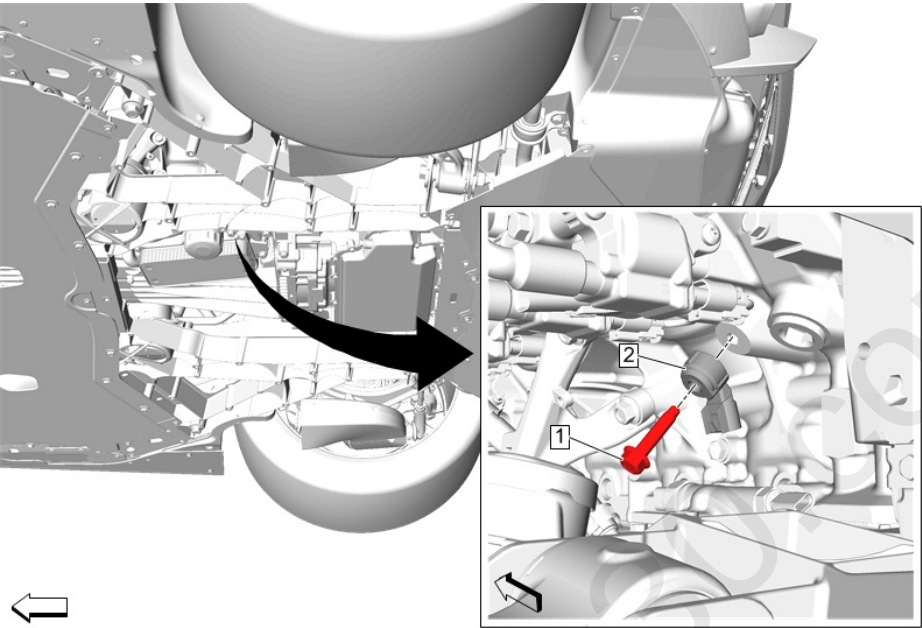

Click here for full size
Rear Cradle Shear Plate Replacement

Fastener Caution.

Tighten

25N-m (18 lb ft)

Callout	Component Name
Preliminary Procedure	
1	Knock Sensor Bolt Caution: Refer to
2	Knock Sensor Procedure Disconnect the electrical connector.