


# 2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Engine/Propulsion
- 2. Engine Controls and Fuel - 6.2L (LT2)
- 3. Repair Instructions
- 4.

## Manifold Absolute Pressure Sensor Replacement (Coupe)

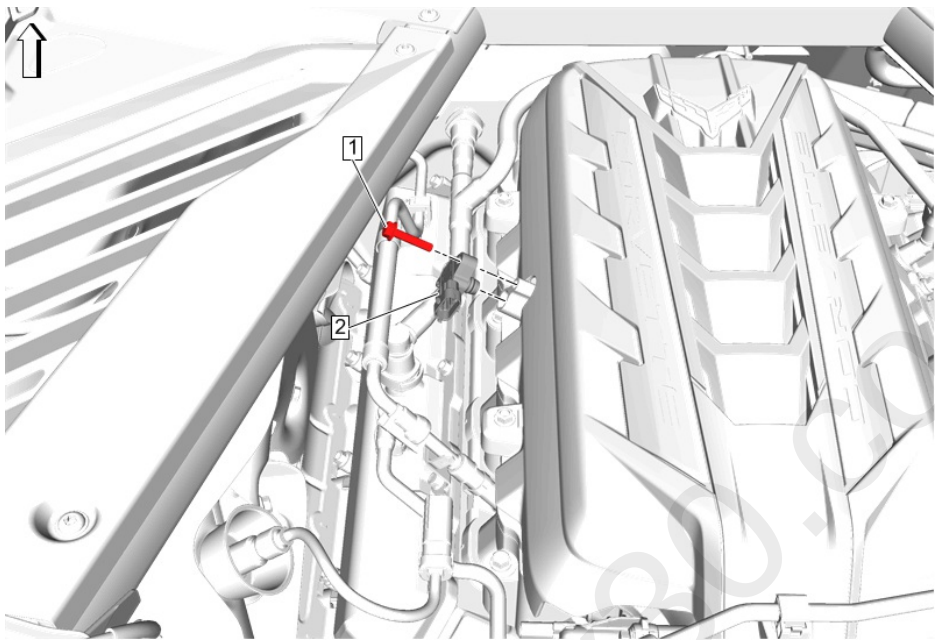

Click here for full size  
Fastener Caution.

Tighten

4.5N-m (40 lb in)

| Callout                              | Component Name                                                 |
|--------------------------------------|----------------------------------------------------------------|
| Preliminary Procedure                |                                                                |
| Disconnect the electrical connector. |                                                                |
| 1                                    | Manifold Absolute Pressure Sensor Bolt<br>Caution:<br>Refer to |
| 2                                    | Manifold Absolute Pressure Sensor                              |