


Power Steering Assist Motor Replacement

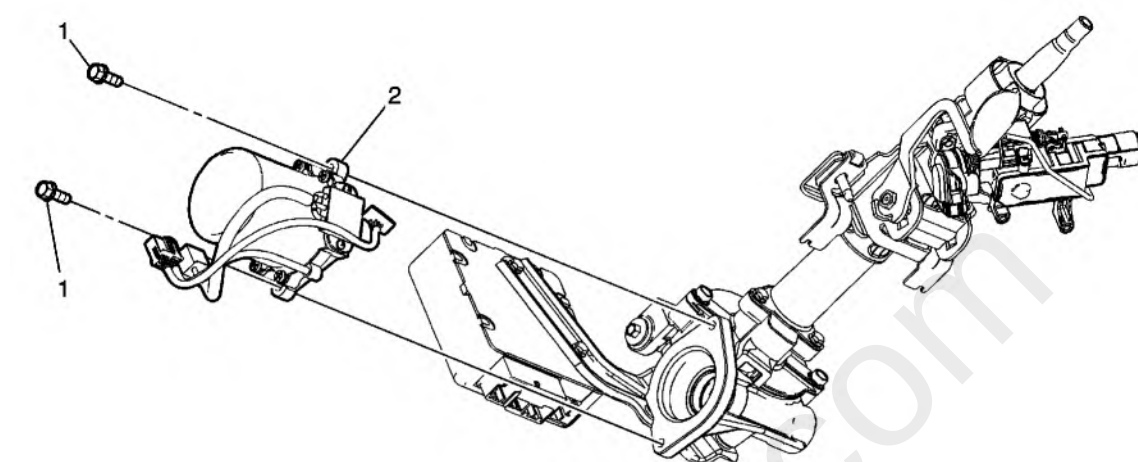

Callout	Component Name
Preliminary Procedures 1. Remove the left side instrument panel outer trim cover. Refer to Instrument Panel Outer Trim Cover Replacement - Left Side. 2. Remove the left side instrument panel insulator panel. Refer to Instrument Panel Insulator Panel Replacement - Left Side. 3. Remove the driver knee bolster reinforcement. Refer to Driver Knee Bolster Reinforcement Replacement.	
1	Power Steering Assist Motor Bolt (Qty: 2) Caution: Refer to Fastener Caution in the Preface section. Tighten 18 N·m (13 lb ft)
2	Power Steering Assist Motor Procedure Disconnect any electrical connectors as needed.

© 2020 General Motors Corporation. All rights reserved.