


K9K, and 732 or 764


K9K, and 764

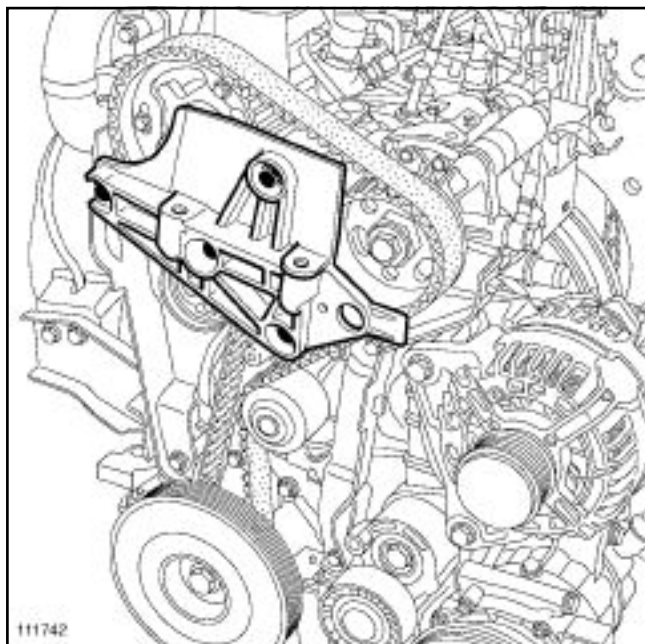


111742

Refit the cylinder head suspended mounting.

Tighten to torque the **cylinder head suspended mounting bolts** (21 ± 2.1 Nm).

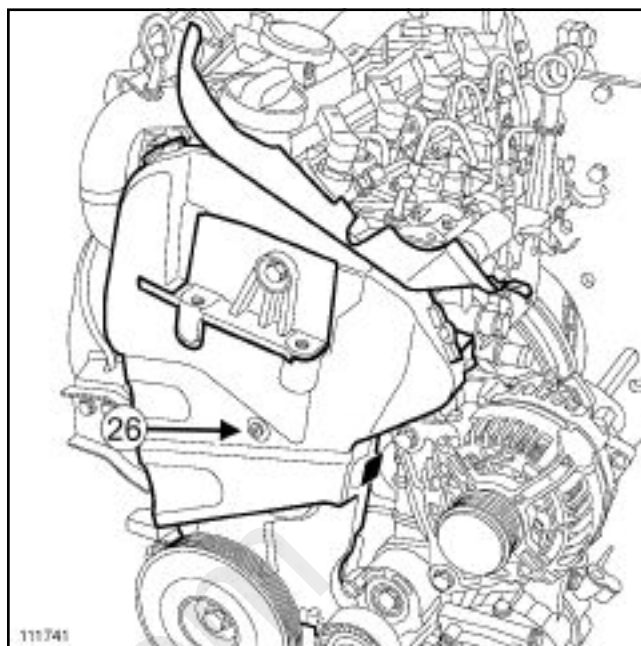

111741

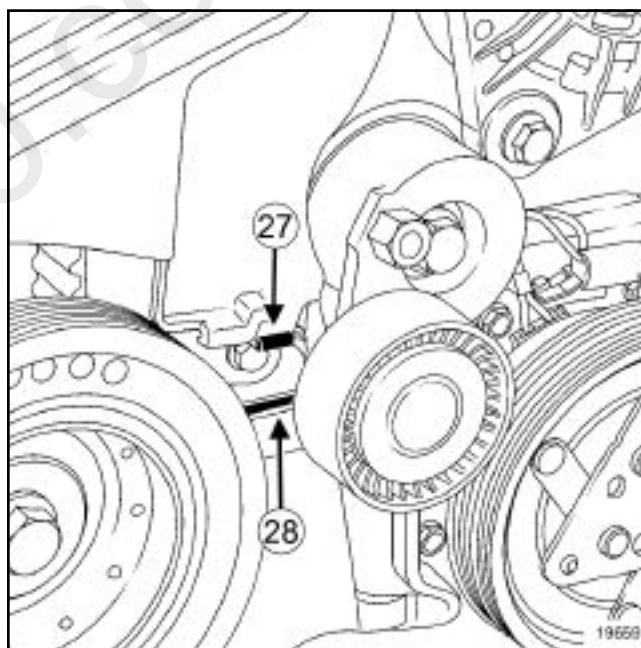

19659

Refit:

- the timing cover, positioning the tab (27) in the inner timing cover hole (28) ,
- the timing cover plastic bolt (26) .