



Repair-10x08-02x60-1-23-1.xml



XSL version : 3.02 du 22/07/11

mcx30.com

EXTERIOR BODY FRONT TRIM ASSEMBLY: EXPLODED VIEW

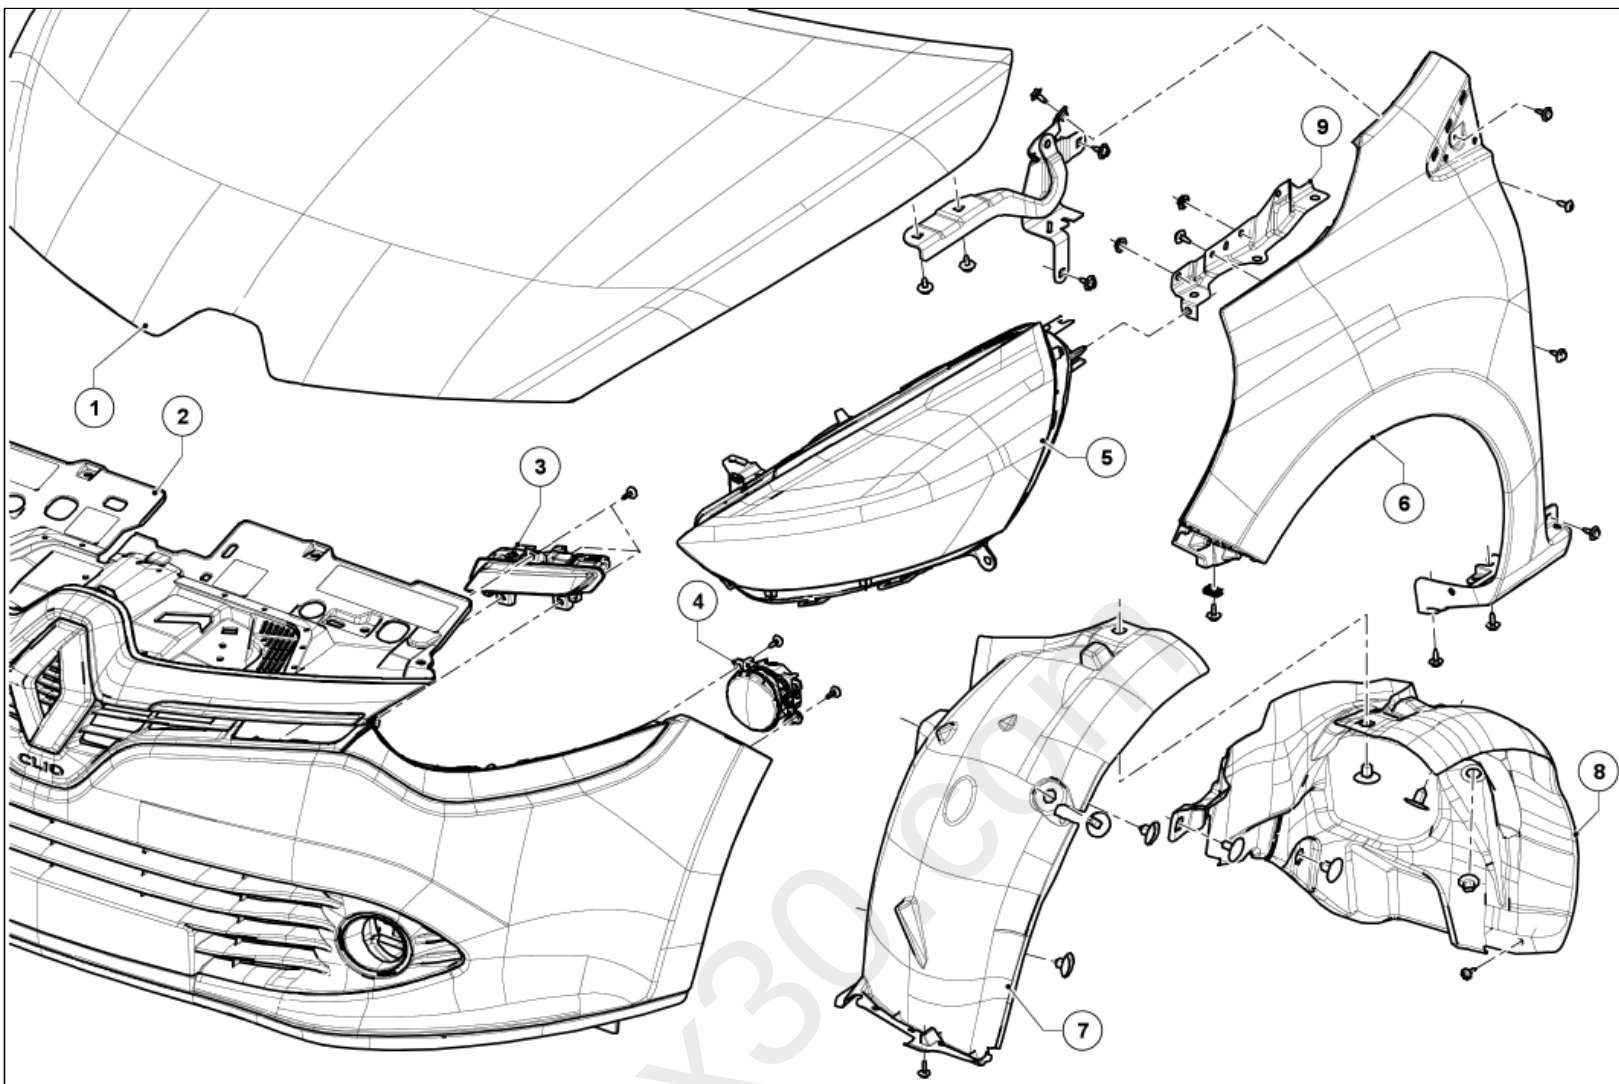


Illustration key: [Description](#) .

For fastenings with no specified tightening torque values, refer to the Table of Standard Torques: [Tightening torques: General information](#) .

Marks	Designations	Informations
1	Bonnet	Front opening element: Removal - Refitting
2	Front bumper assembly	(see 55A, Exterior protection, Front bumper assembly: Exploded view)
3	Daytime running light	Front signals - lighting assembly: Exploded view
4	Fog light	Front signals - lighting assembly: Exploded view
5	Headlight	Front signals - lighting assembly: Exploded view
6	Front wing	Front wing: Removal - Refitting
7	Front wheel arch liner, front section	
8	Front wheel arch liner, rear section	
9	Front wing upper mounting support	Front wing upper mounting support: Replacement