

WARRANTY (information to be submitted)		
☐ Describe the cause of the fault	☐ Associated symptom code	☐ Approval granted
☐ Approval of fault search time		

This image shows a full page of graph paper. The grid consists of small squares formed by thin black lines. A diagonal watermark reading "mck30.com" is centered across the page. There are no margins or other markings present.

FLOOR CARPET: REMOVAL - REFITTING

Locations and specifications (tightening torques, parts to always be replaced, etc.) [Rear bench seat assembly: Exploded view](#) , [Front seat assembly: Exploded view](#) and [\(see 71A, Body internal trim, Interior body side trim assembly: Exploded view\)](#) .


REMOVAL


1. REMOVAL PREPARATION OPERATION

■ Disconnect the battery [Battery: Removal - Refitting](#) .

■ Remove:

- the B-pillar lower trims [\(see 71A, Body internal trim, Interior body side trim assembly: Exploded view\)](#) ,
- the rear door sill linings [\(see 71A, Body internal trim, Interior body side trim assembly: Exploded view\)](#) ,
- the front door sill linings [\(see 71A, Body internal trim, Interior body side trim assembly: Exploded view\)](#) ,
- the front seats completely [Front seat assembly: Exploded view](#) ,
- the bench seat base [Rear bench seat assembly: Exploded view](#) .
- the bench seatback [Rear bench seat assembly: Exploded view](#) .
- the rear seat belt buckles [Rear bench seat assembly: Exploded view](#) .

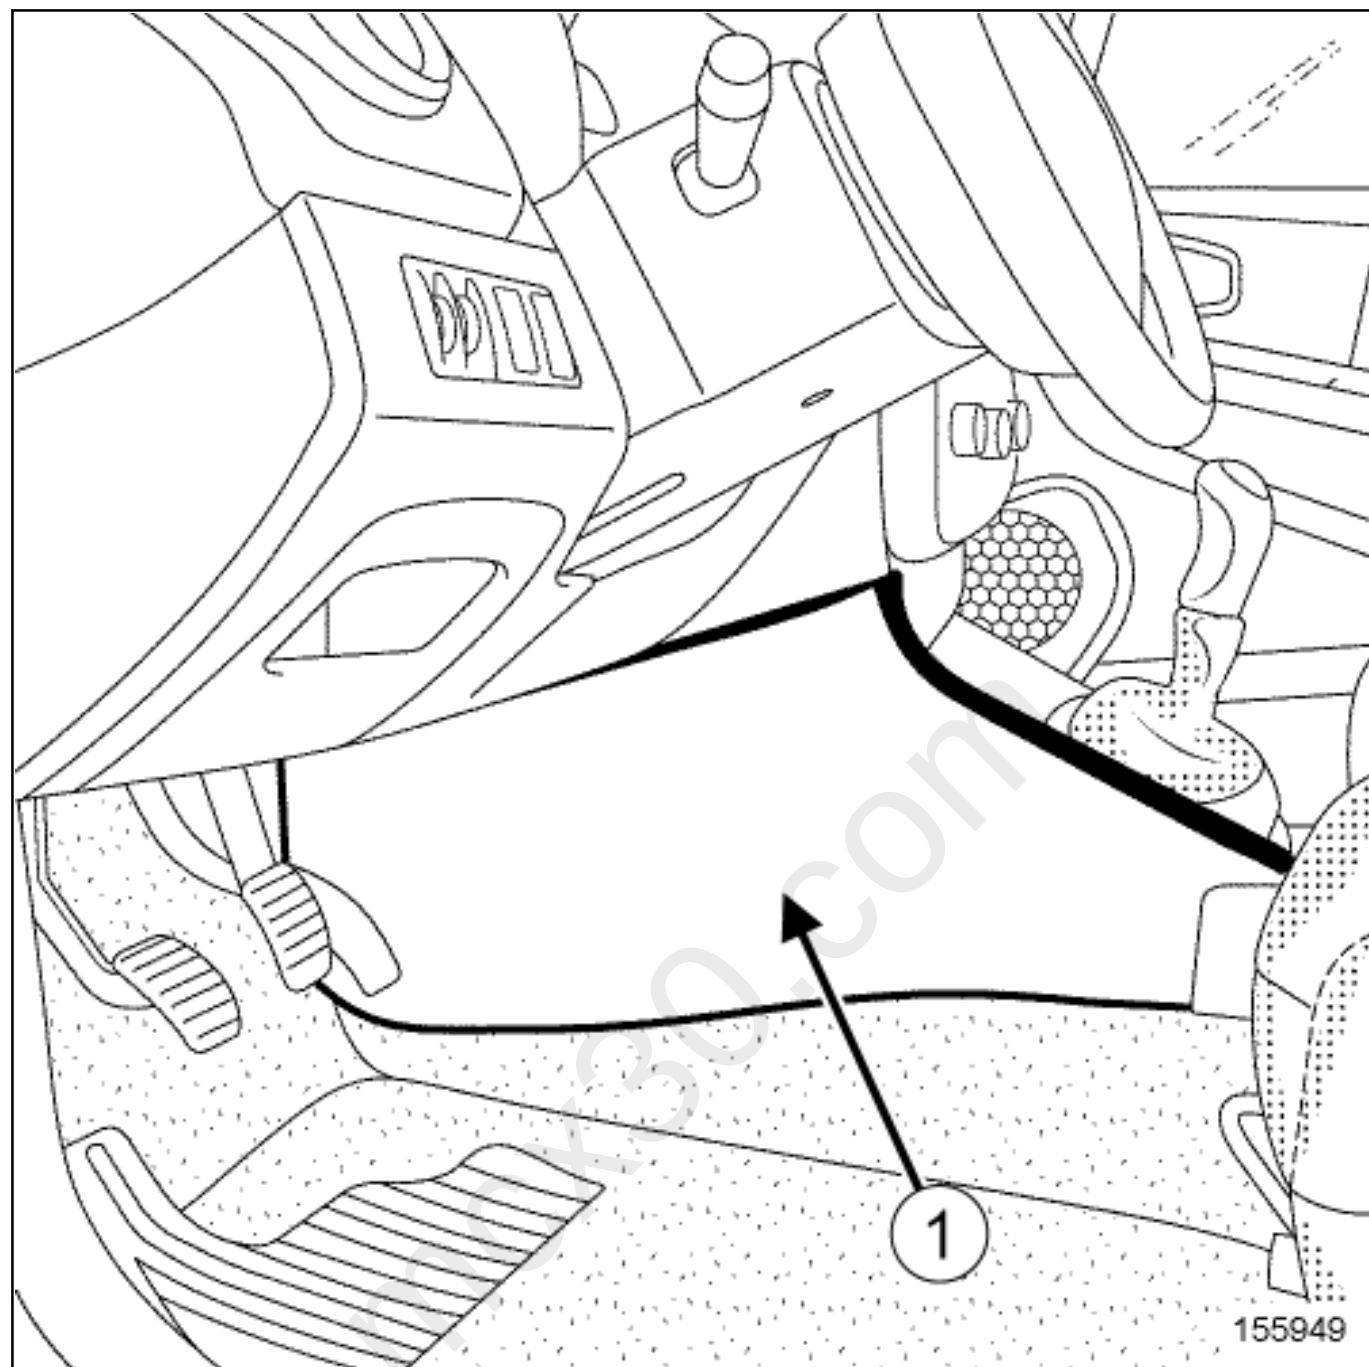

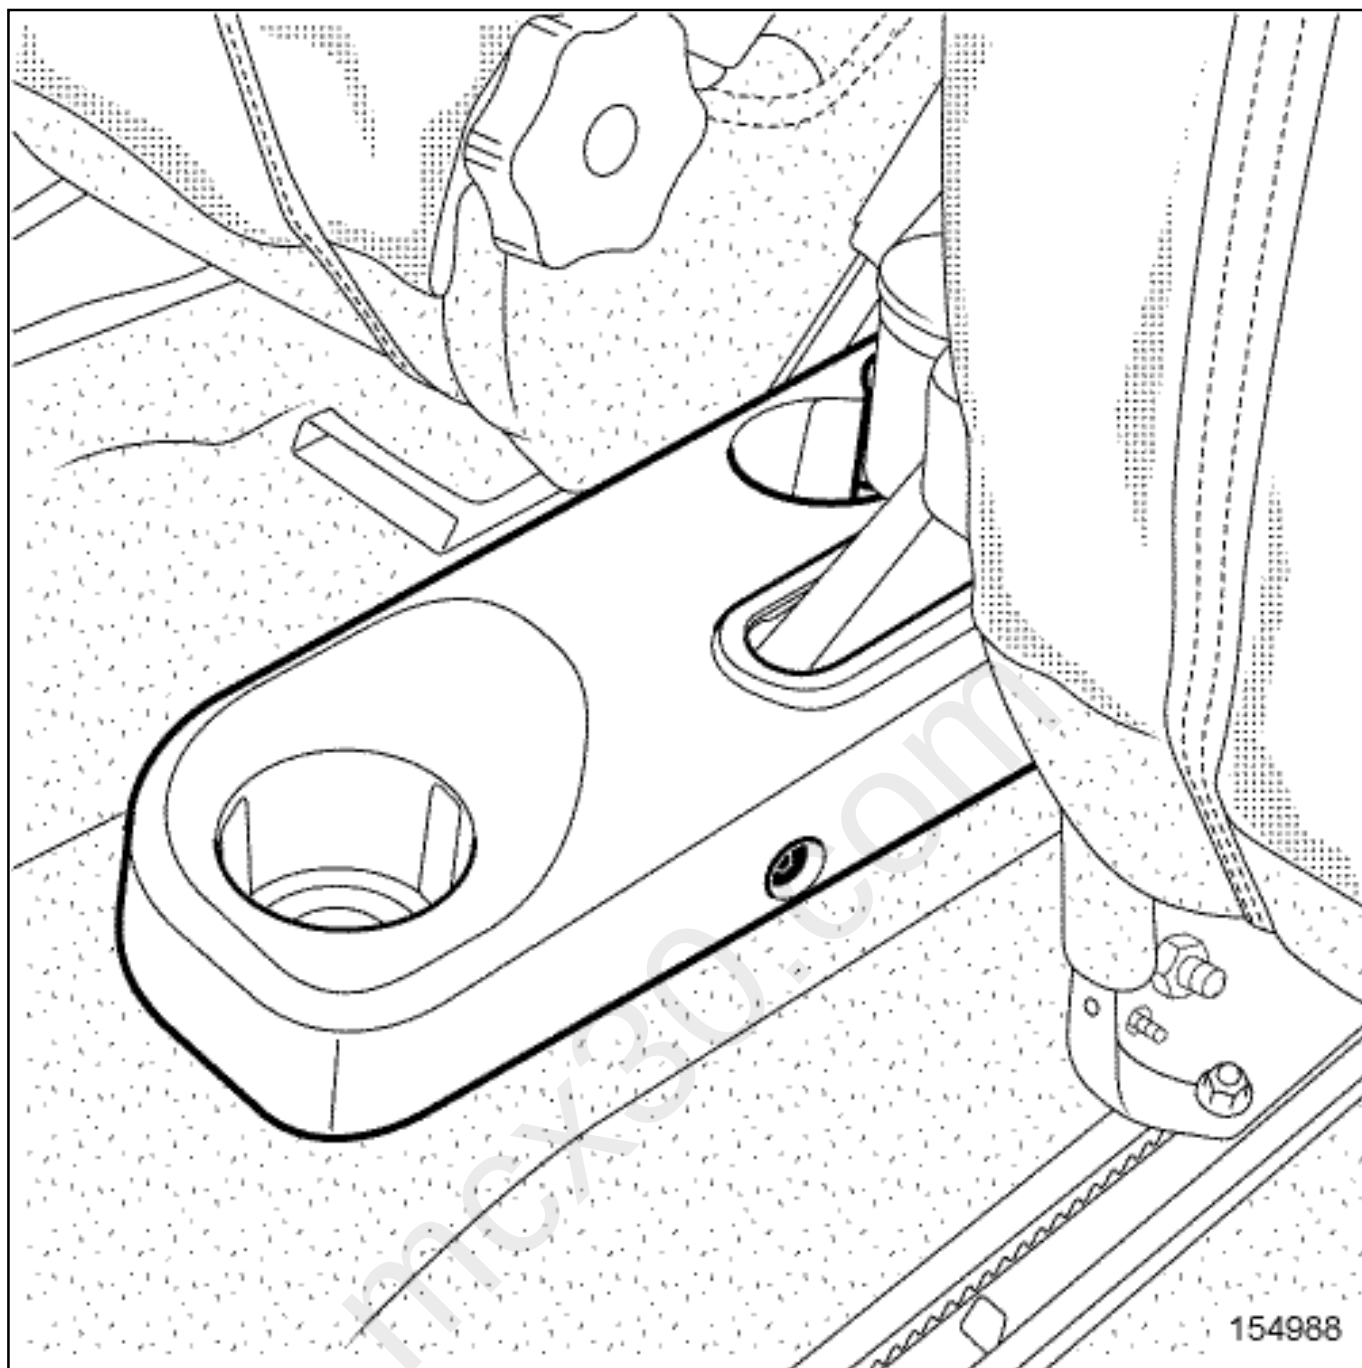

Remove:



the centre console side trims(1) ,



the centre console.

Remove the centre front panel lower trim [Dashboard assembly: Exploded view](#)