



parts always to be replaced:

turbocharger air cooler air inlet pipe seal



parts always to be replaced:

turbocharger air cooler air outlet pipe seal

2. REFITTING OPERATION



Proceed in the reverse order to removal.




Repair-10x09x04-01x37-1-67-1.xml



XSL version : 3.02 du 22/07/11

mcx30.com

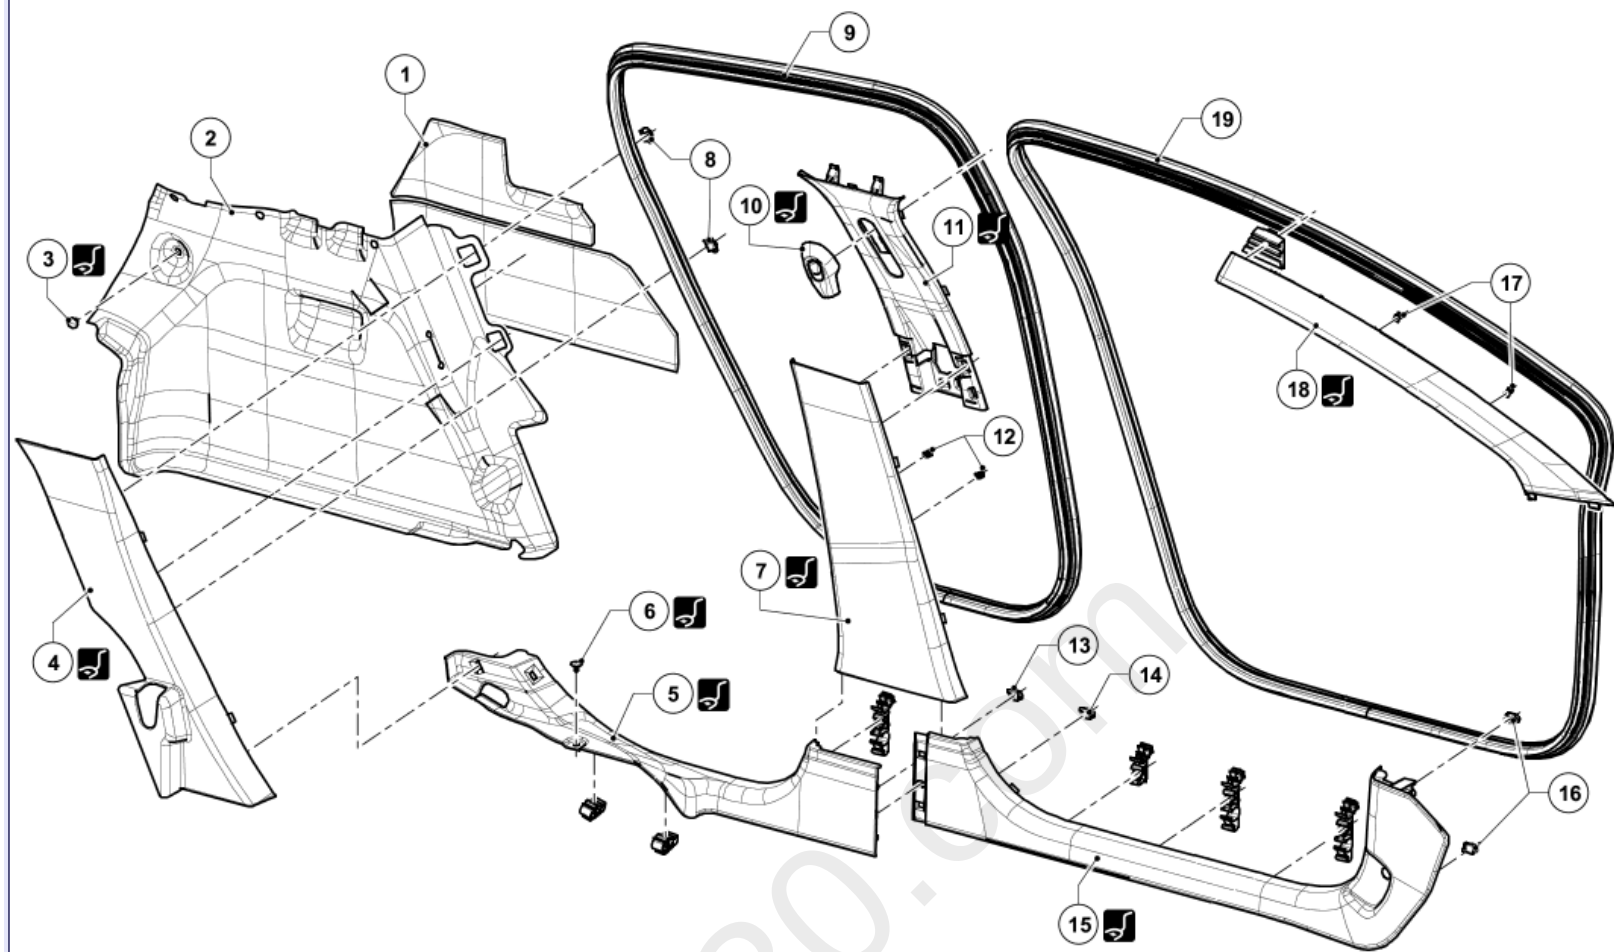

[Illustration key: Description](#) .

Marks	Designations	Informations
1	Soundproofing	
2	Rear wheel arch trim	
3	Clip	(Car. 1363)
4	Rear inner sill upper trim	(Car. 1363)
5	Rear door sill lining	(Car. 1363)
6	Clip	(Car. 1363)
7	B-pillar lower trim	(Car. 1363)
8	Clips	
9	Rear side opening element seal	
10	Front seat belt return mechanism bolt cover	(Car. 1363)

11	B-pillar upper trim	(Car. 1363)
12	Clips	
13	Clips	
14	Clips	
15	Front door sill lining	(Car. 1363)
16	Clips	
17	Clips	
18	Windscreen pillar trim	(Car. 1363)
19	Front side opening element seal	

mcx30.com

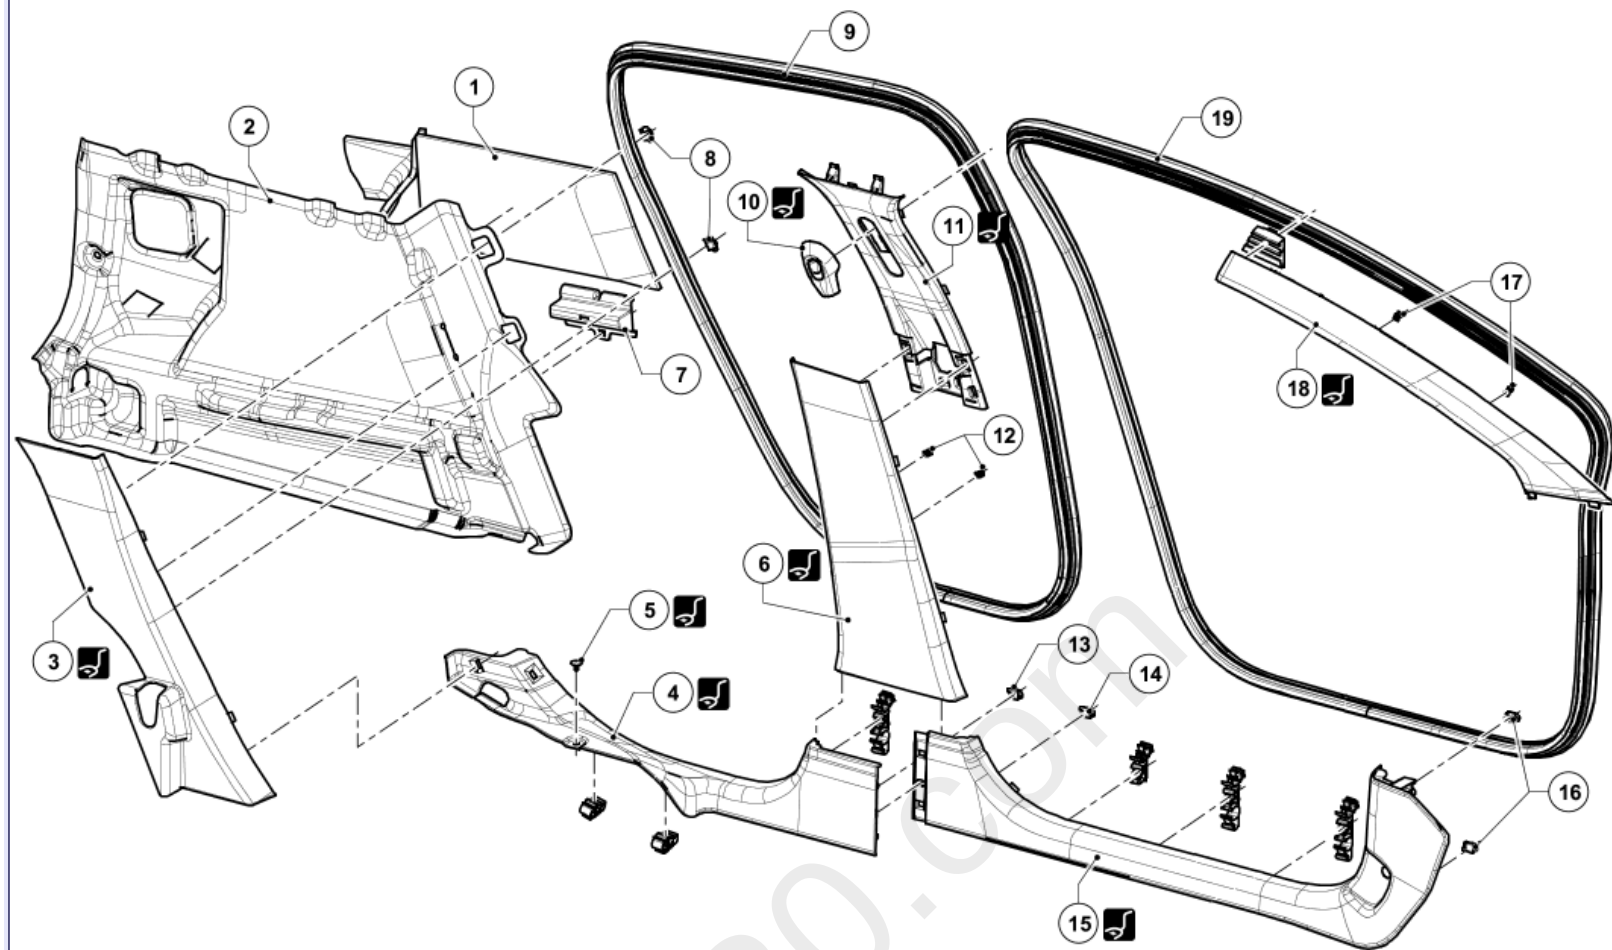


Illustration key: Description .

Marks	Designations	Informations
1	Soundproofing	
2	Rear wheel arch trim	
3	Rear inner sill upper trim	(Car. 1363)
4	Rear door sill lining	(Car. 1363)
5	Clip	(Car. 1363)
6	B-pillar lower trim	(Car. 1363)
7	Rear wheel arch trim support	
8	Clips	
9	Rear side opening element seal	
10	Front seat belt return mechanism bolt cover	(Car. 1363)
11	B-pillar upper trim	(Car. 1363)