



Repair-40x10x01-01x95-1-1-1.xml



XSL version : 3.02 du 22/07/11

mcx30.com


SILL PANEL CLOSURE PANEL: REPLACEMENT



Note, one or more warnings are present in this procedure



1. COMPOSITION OF THE SPARE PART

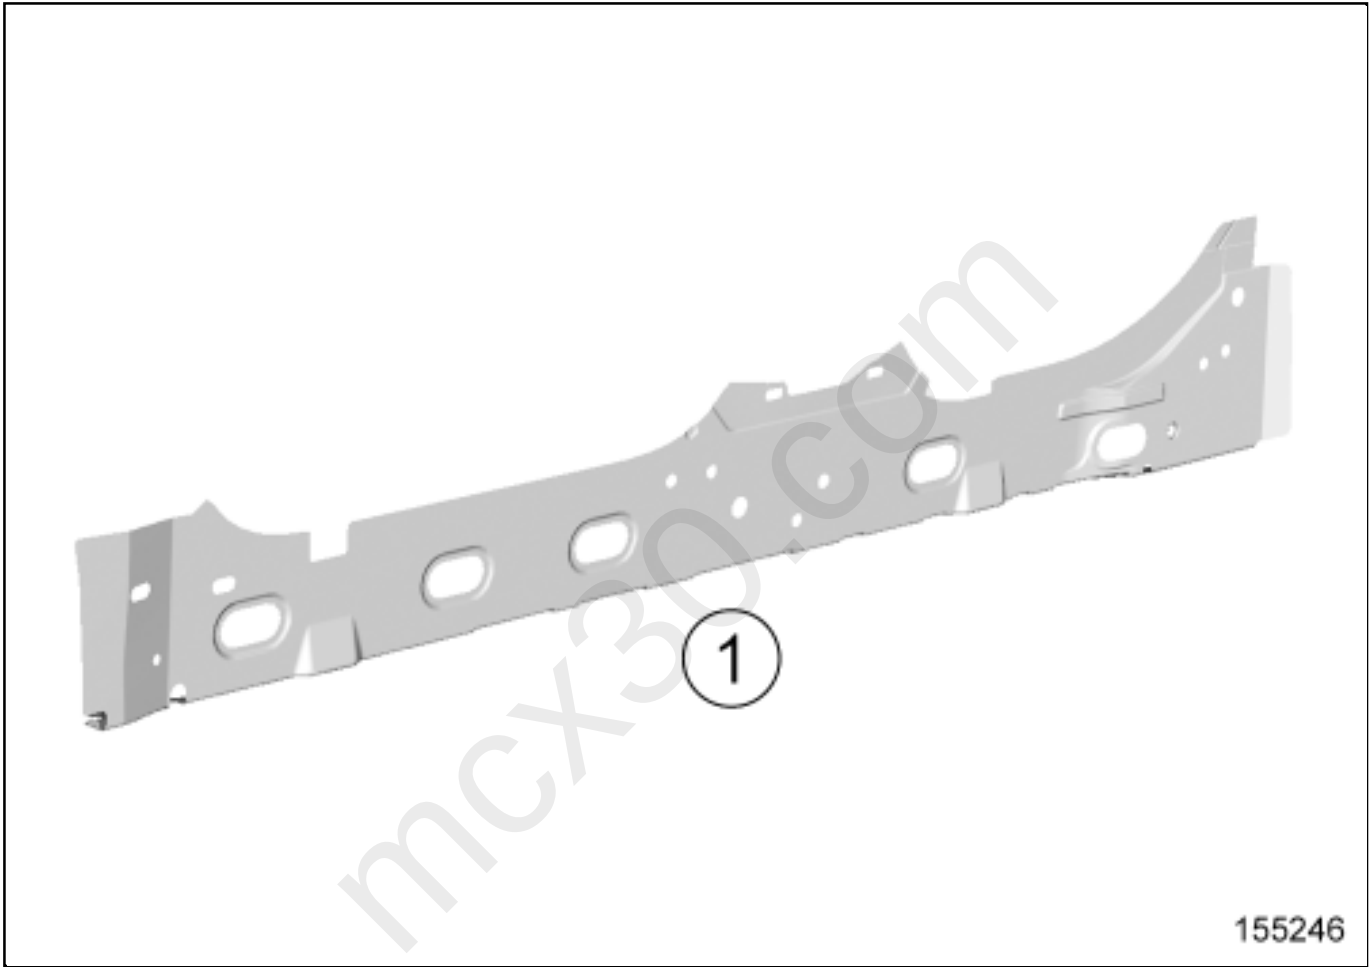


No.	Description	Thickness (mm)
(1)	Sill panel closure panel	0.9

2. IN THE EVENT OF REPLACEMENT

- There is only one way of replacing this part:
- complete replacement.

1- COMPLETE REPLACEMENT

1)PART IN POSITION

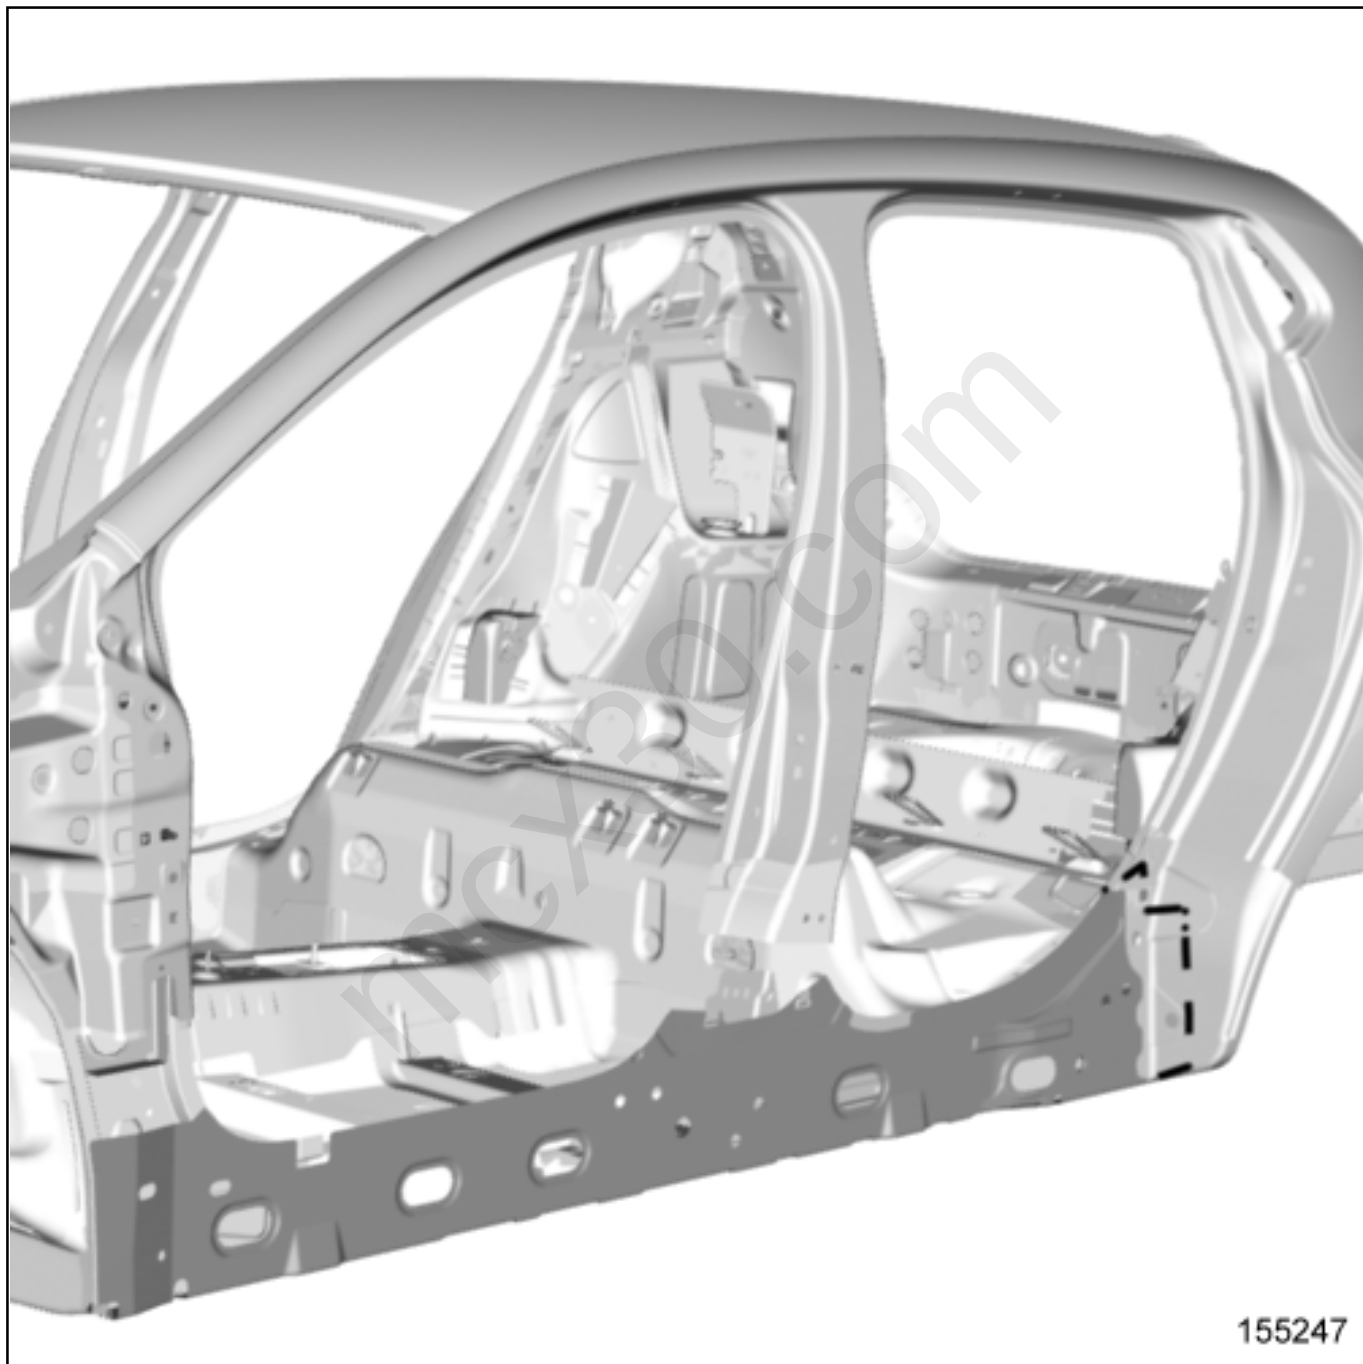

2)POSITION OF ELECTRIC EARTHS