

CARSHARING MODULE : REMOVAL - REFITTING



Note, one or more warnings are present in this procedure



WARNING

■ To avoid all risk of damage to the systems, apply the safety and cleanliness instructions and operation recommendations before carrying out any repair:

- [Vehicle: Precautions for the repair](#) .

REMOVAL

1. REMOVAL PREPARATION OPERATION



WARNING

DANGER : Risk of serious injuries due to the short-circuiting or the untimely triggering of an electrical system (pyrotechnical parts, windscreen wiper motor, electric fan, etc.) following possible loopback of the 12-volt supply circuit by the voltage transformer.

Please adhere to the instructions regarding cut-off of the 12-volt supply circuit.


If the procedure fails, do not continue with your task and ask an employee who is qualified and authorized to work on a high-voltage onboard network to perform a diagnostic [Vehicle: Precautions for the repair](#) .

- Lockout the 12V supply circuit [12 V supply circuit : Lockout - Removal of lockout](#) .

1- LEFT-HAND DRIVE

- Remove [Dashboard assembly: Exploded view](#) :
 - the left hand glovebox cover hinge pins,
 - the left hand glovebox.

2- RIGHT-HAND DRIVE

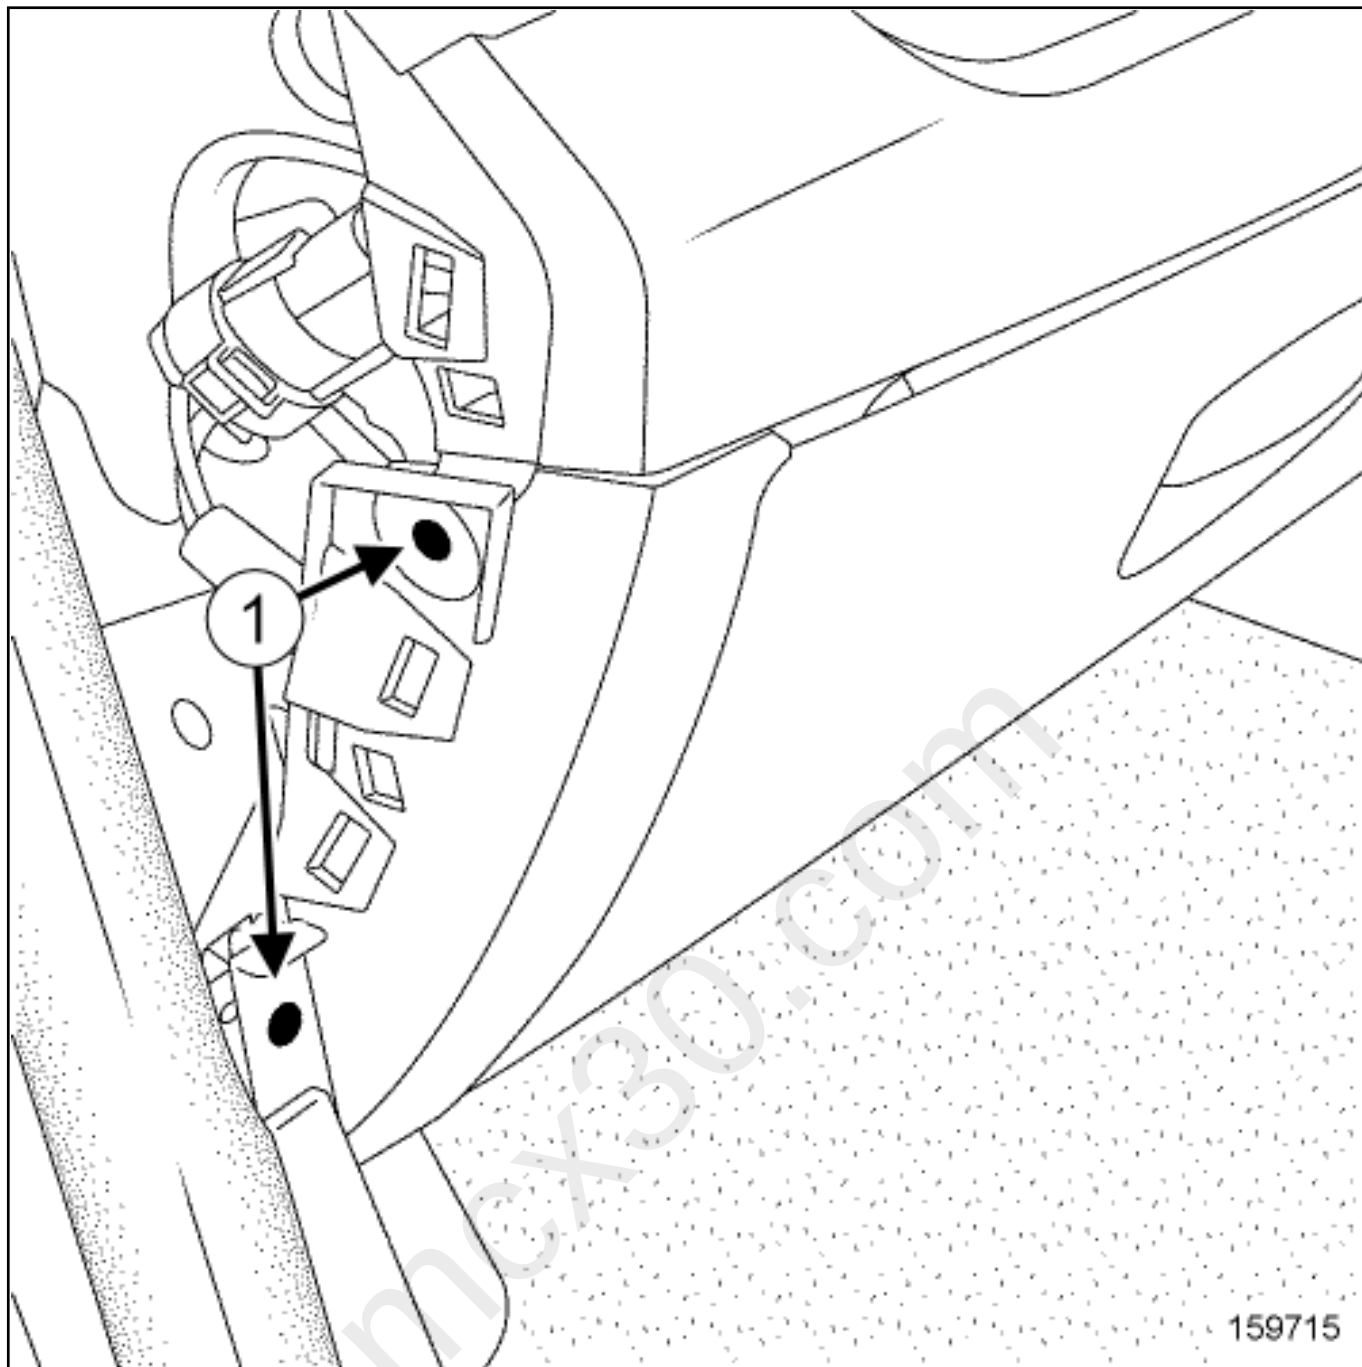



 Remove :

- the blanking cover of dashboard side panel [Dashboard assembly: Exploded view](#) ,
- the right hand glovebox mounting bolts(1) ,
- the glovebox.

2. REMOVAL OPERATION

1- LEFT-HAND DRIVE

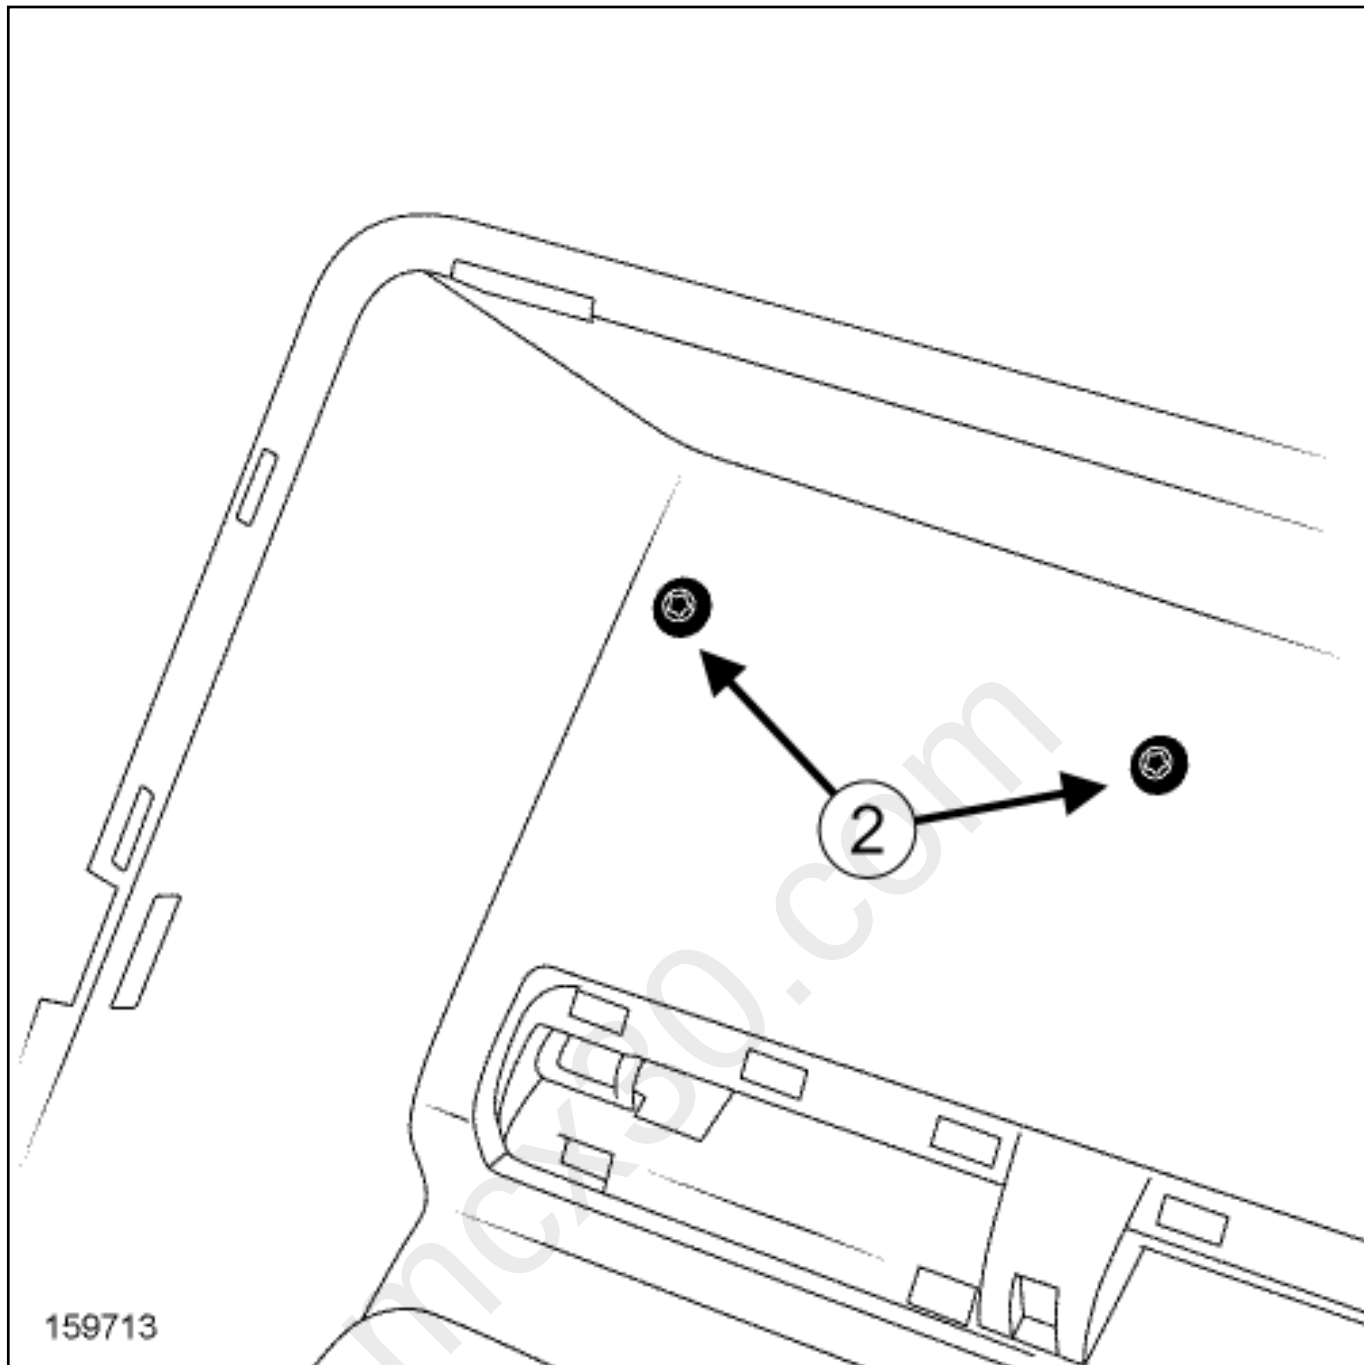


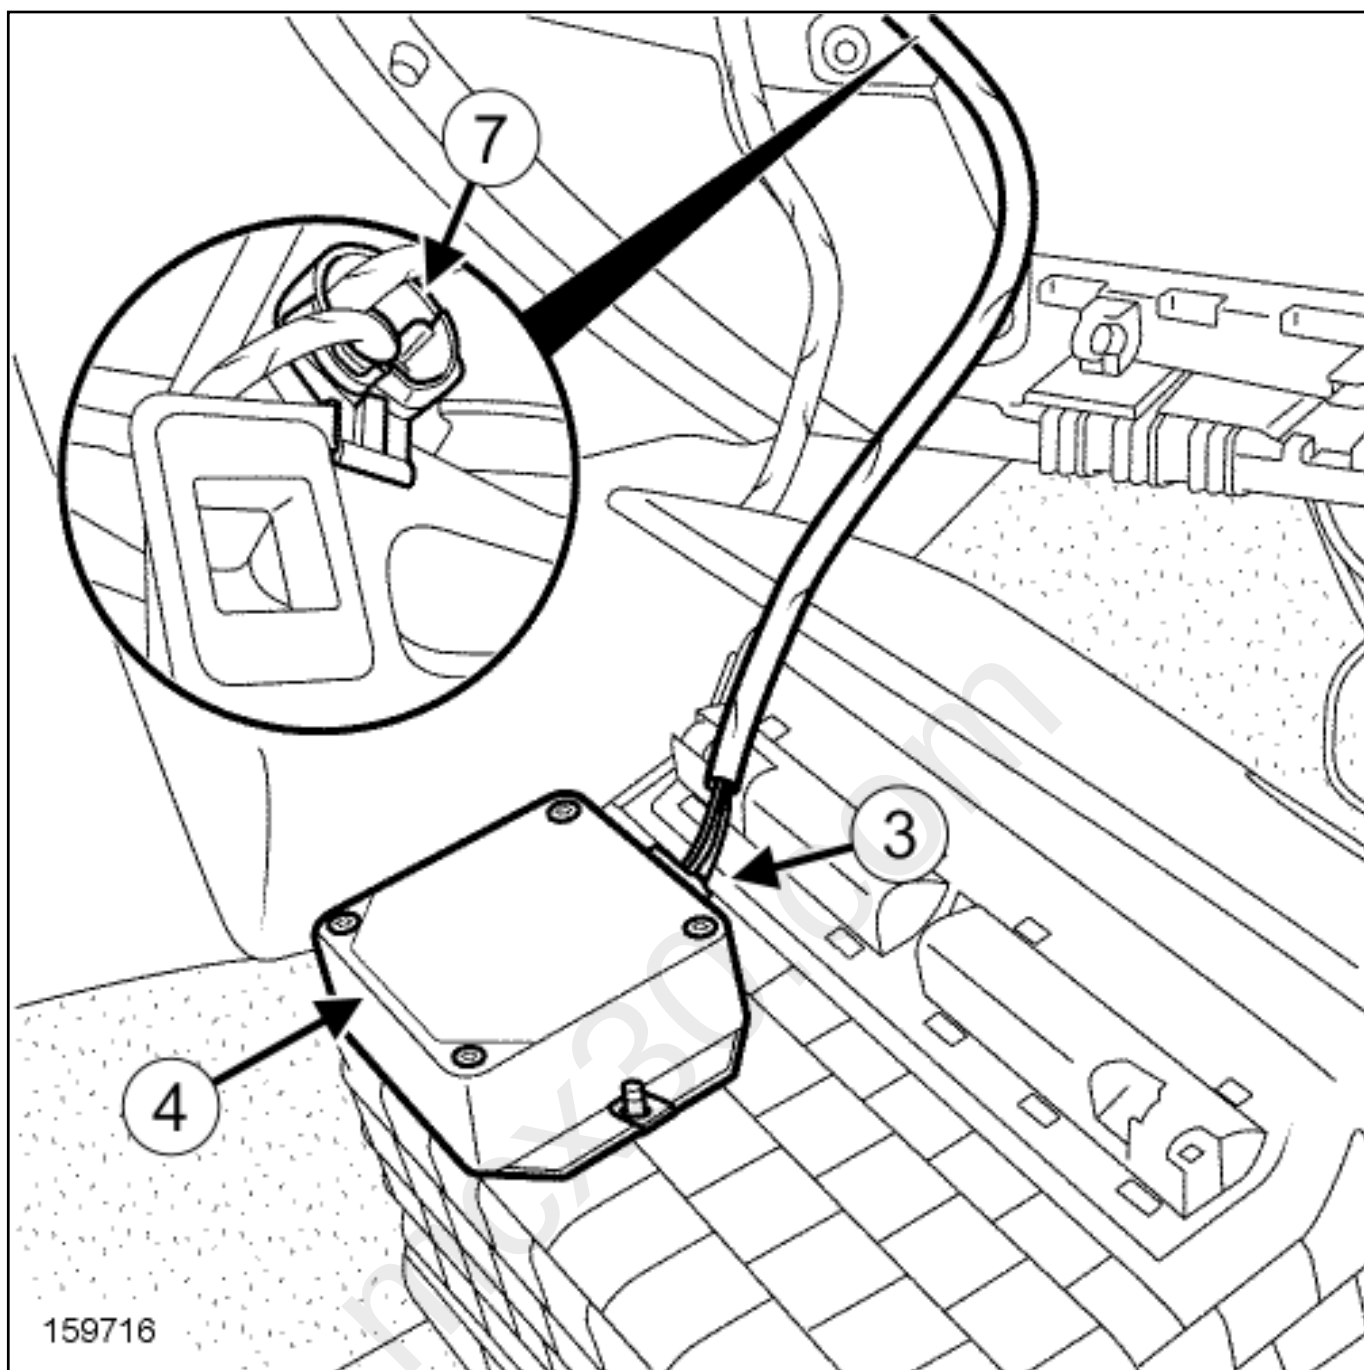


■ Remove:

- the smart clip(7) ,
- the carsharing module connector(3) ,
- the carsharing module screw(2) ,
- the carsharing module(4) .

2- RIGHT-HAND DRIVE

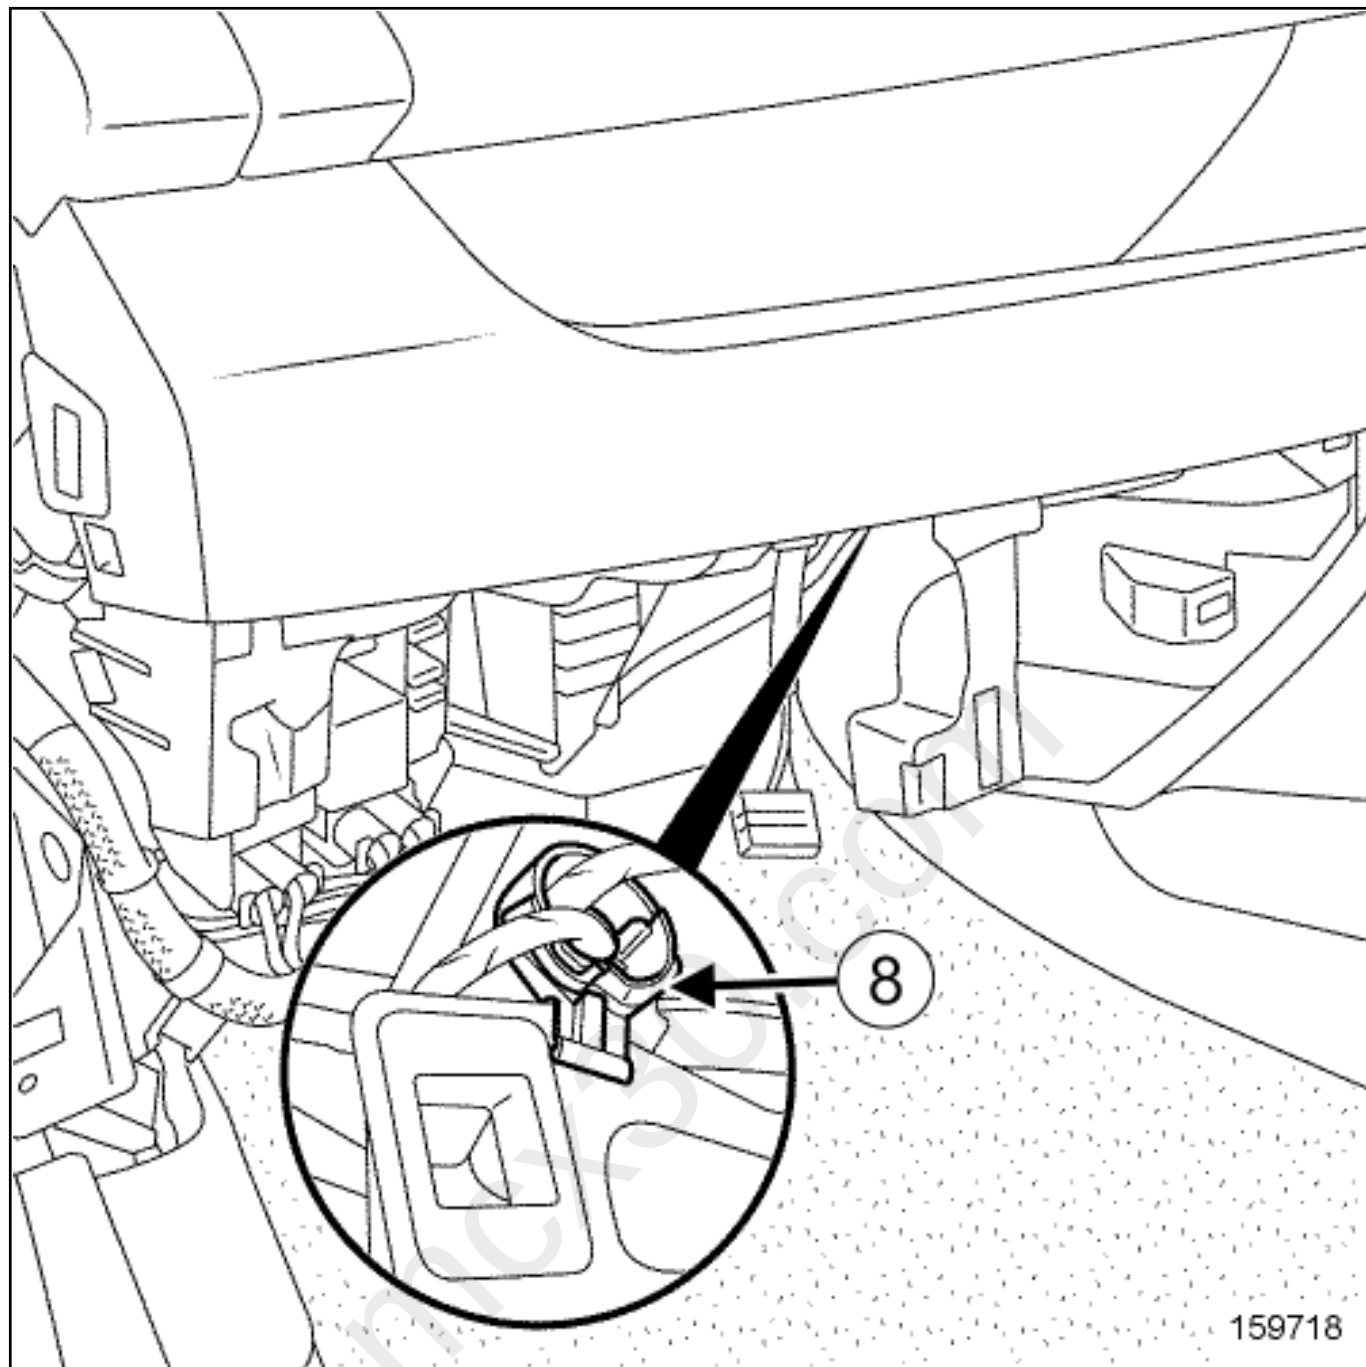

159718

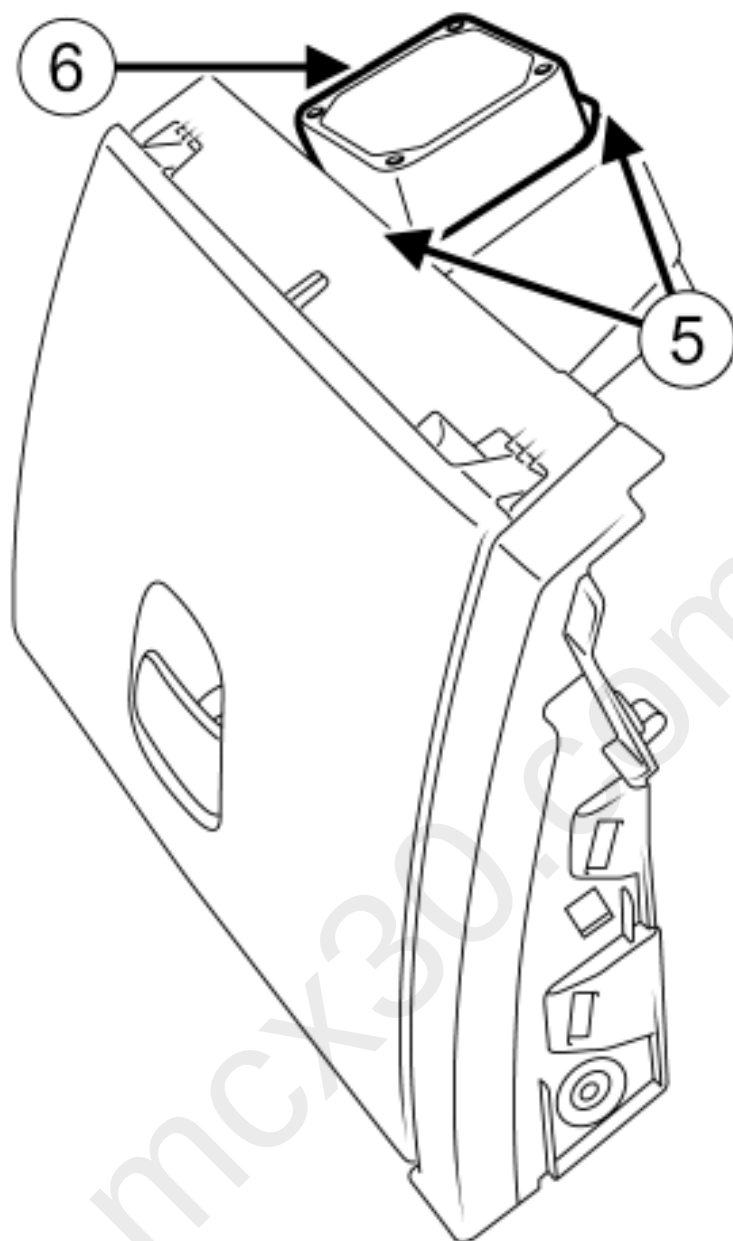

159714

Remove:

-
- the smart clip(8) ,
- the carsharing module connector,
- the carsharing module screw(5) ,
- the carsharing module(6) .

REFITTING

1. REFITTING OPERATION



Proceed in the reverse order to removal.

2. FINAL OPERATION



Remove the lockout of the 12V supply circuit [12 V supply circuit : Lockout - Removal of lockout](#) .



Repair-30x04x15-01x37-1-2-1.xml



XSL version : 3.02 du 22/07/11