

PUBLISHED: 09-JAN-2020
2020.0 DEFENDER (LE), 501-14

HANDLES, LOCKS, LATCHES AND ENTRY SYSTEMS

TAILGATE STRIKER ADJUSTMENT (G2424898)

mcx30.com

mcx30.com

CHECK


⚠ CAUTIONS:

- If the striker bolts are fully removed, new bolts must be installed.
- Make sure to protect the paintwork.

⚠ NOTES:

- This procedure contains some variation in the illustrations depending on the vehicle specification, but the essential information is always correct.
- This procedure contains illustration showing certain components removed to provide extra clarity.


1.

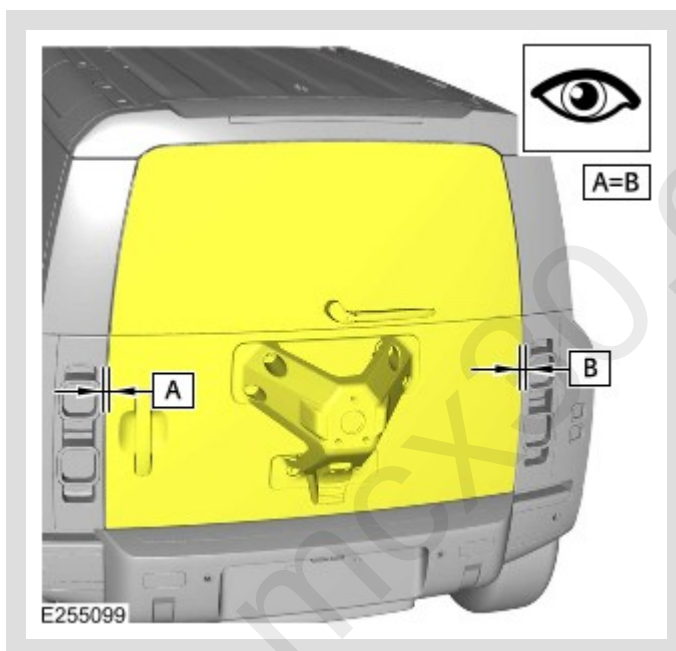

Check the tailgate flush on both side. If incorrect, follow the adjust procedure below.

ADJUSTMENT

1.

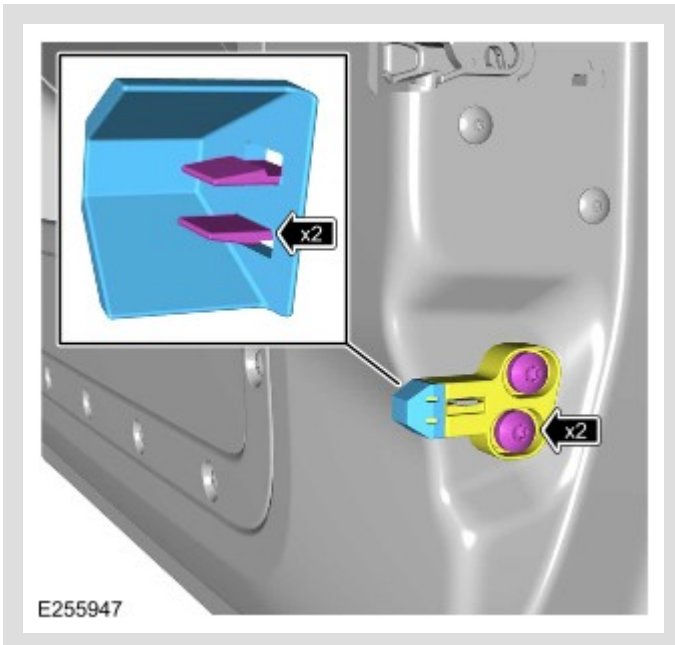

- Remove the plastic cover from the wedge.
- Loose but not fully remove the 2 bolts.

2.



1. Tighten the 2 bolts.
Torque: 2Nm
2. Loose the 2 bolts with quarter of a turn.
3. Push the wedge towards the vehicle to the outermost position.

3.




- Release the 3 clips.
- Remove the access panel.

4.



- Loose but not fully remove tailgate striker 2 bolts.
- Loose but not fully remove the wedging guide 2 bolts.

5.

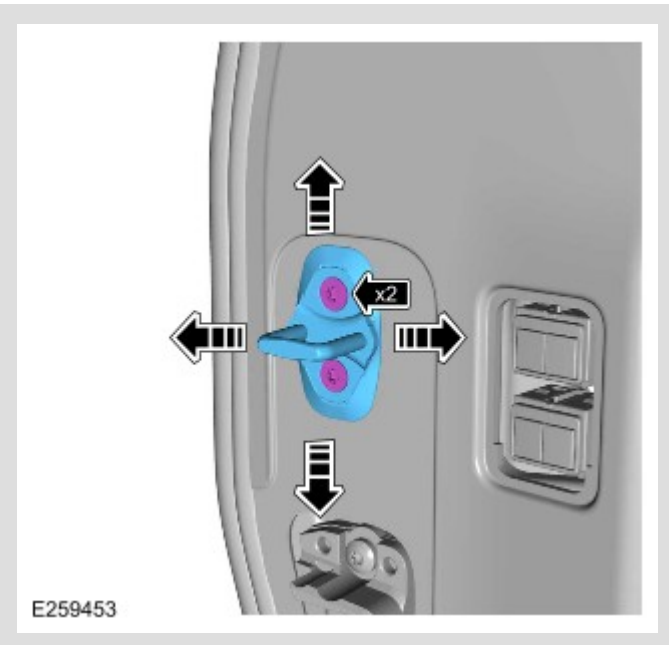


Adjust the tailgate striker as illustrated.

6.

⚠ CAUTION:


Make sure the tailgate striker installed parallel.

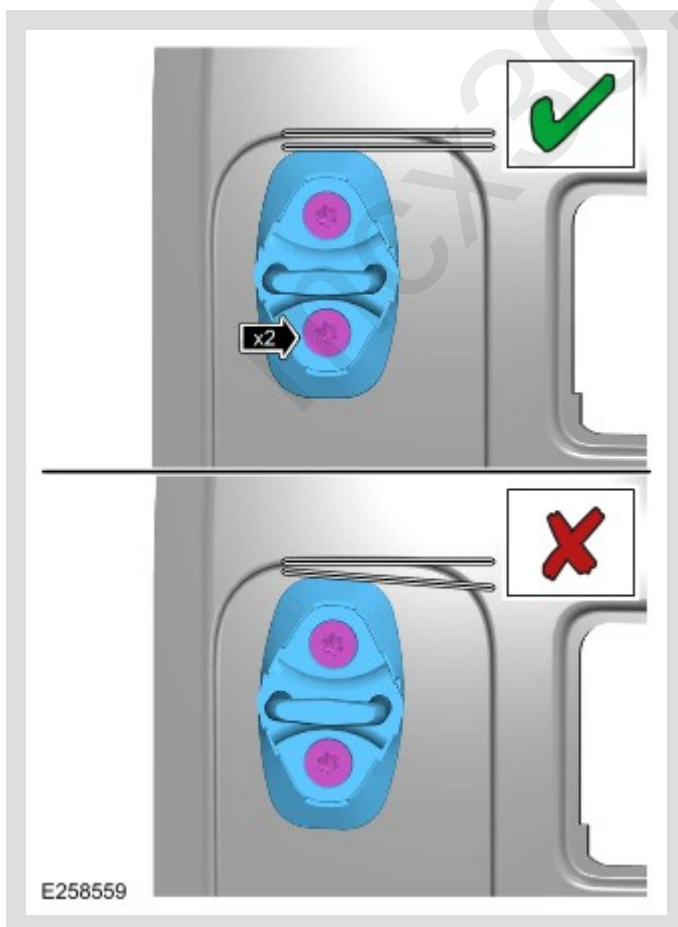

Tighten the 2 bolts.


Torque: 24Nm

7.

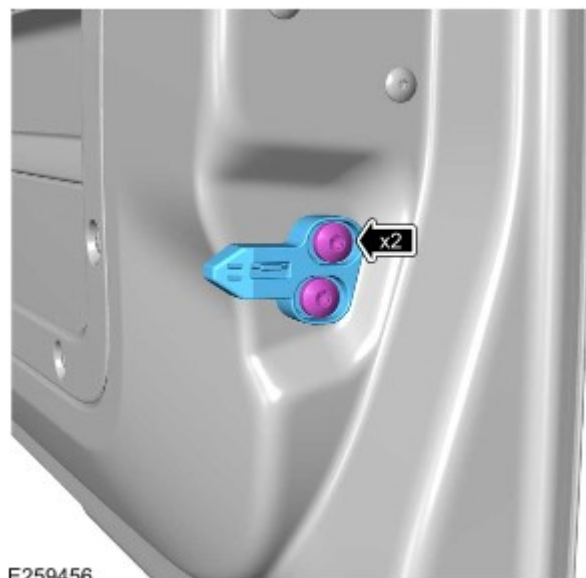

1. Close the tailgate carefully with the closing motor.
2. Open the tailgate.
3. Tighten the 2 bolts.
Torque: 24Nm

8.

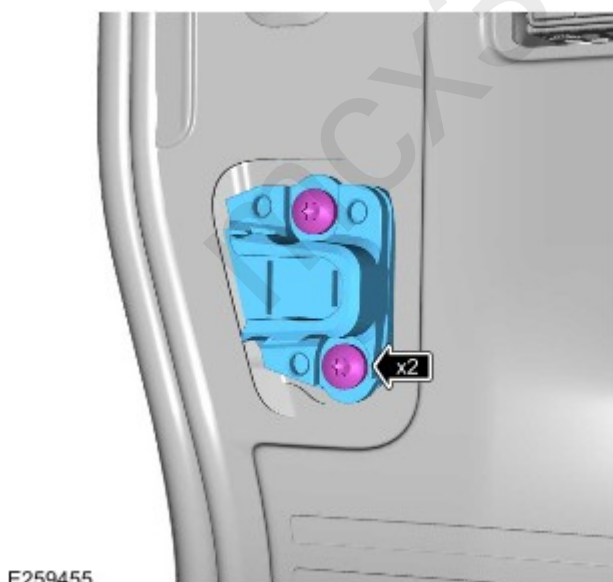


Tighten the 2 bolts.
Torque: 24Nm

9.



Install the access panel.

10.

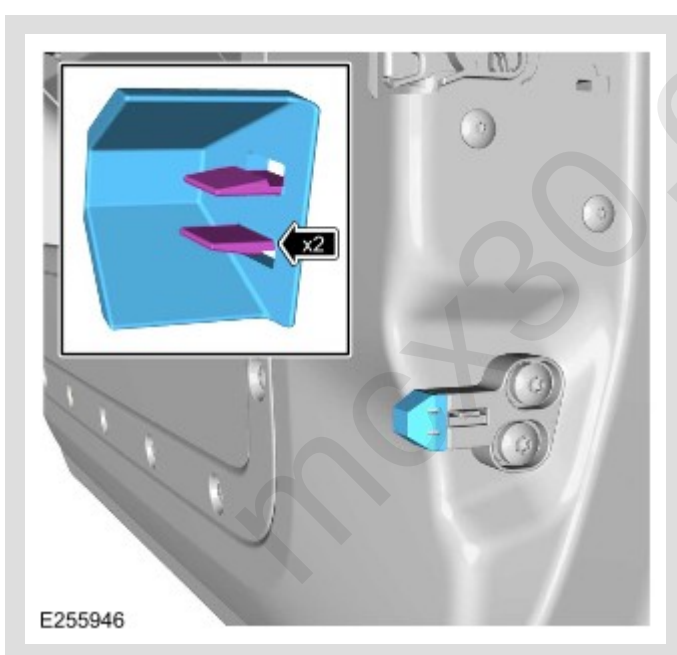

Install the plastic cover to the wedge.