

PUBLISHED: 06-APR-2020
2020.0 DEFENDER (LE), 501-26

BODY REPAIRS - VEHICLE SPECIFIC INFORMATION AND TOLERANCE CHECKS

HOOD LATCH ALIGNMENT (G2394539)

mcx30.com

mcx30.com

CHECK

NOTES:

- This procedure contains some variation in the illustrations depending on the vehicle specification, but the essential information is always correct.
- This procedure contains illustrations showing certain components removed to provide extra clarity.


1. Open the hood.
2. Check the striker-to-latch alignment, adjust if required.

ADJUSTMENT

1.

CAUTION:

Only do the following steps if a hood latch out of alignment.

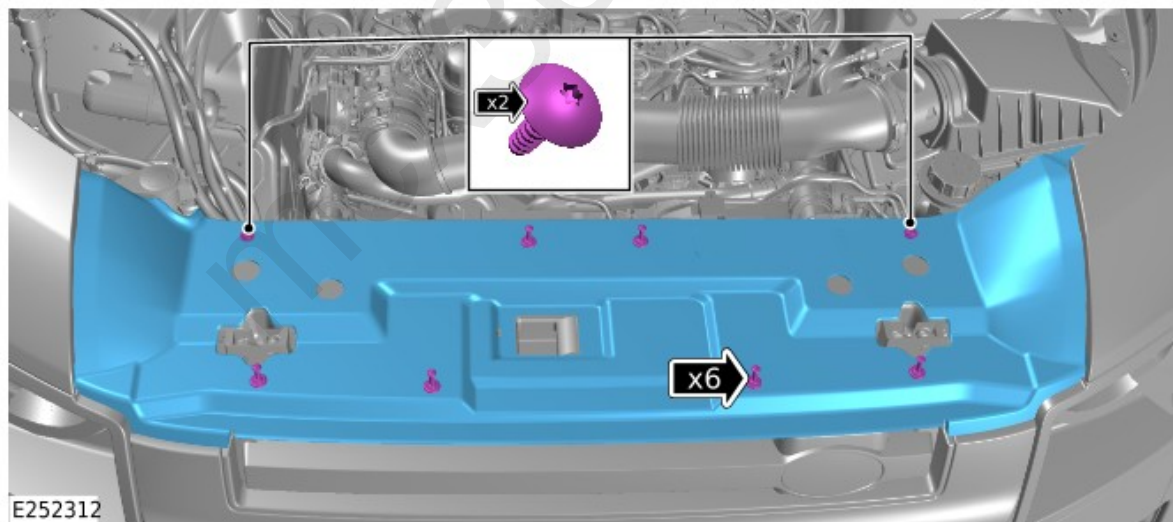


- Release the 6 clips.
- Remove the 2 bolts.
- Remove the upper radiator grille panel for access.

2.

⚠ CAUTION:

Make sure that the clearance on either side of the hood is equal and no strain is placed on the hood latch.

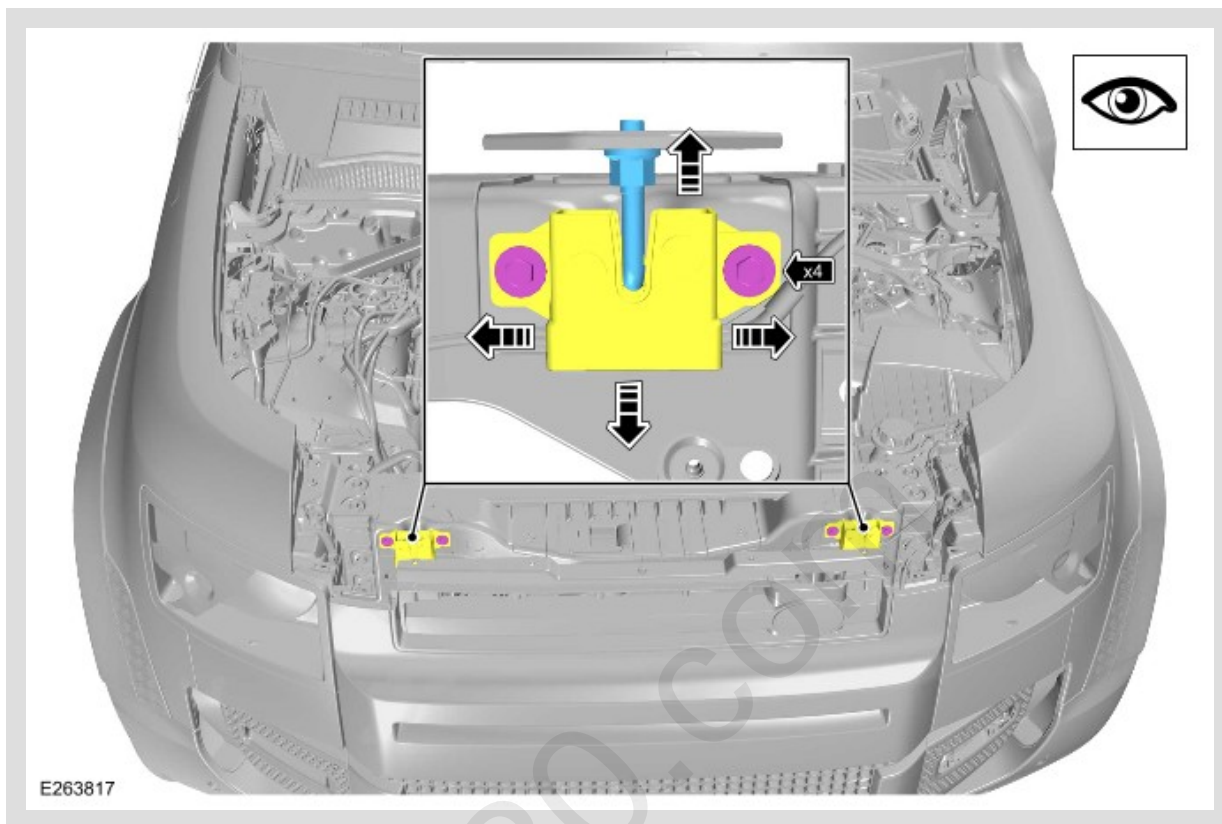


- Loosen but do not fully remove the hood latch 4 retaining bolts.
- Adjust the hood latches as illustrated.
- Tighten the hood latch 4 retaining bolts.

Torque: 10Nm

3.

Check the hood closes and releases correctly. Adjust hood latches if required.

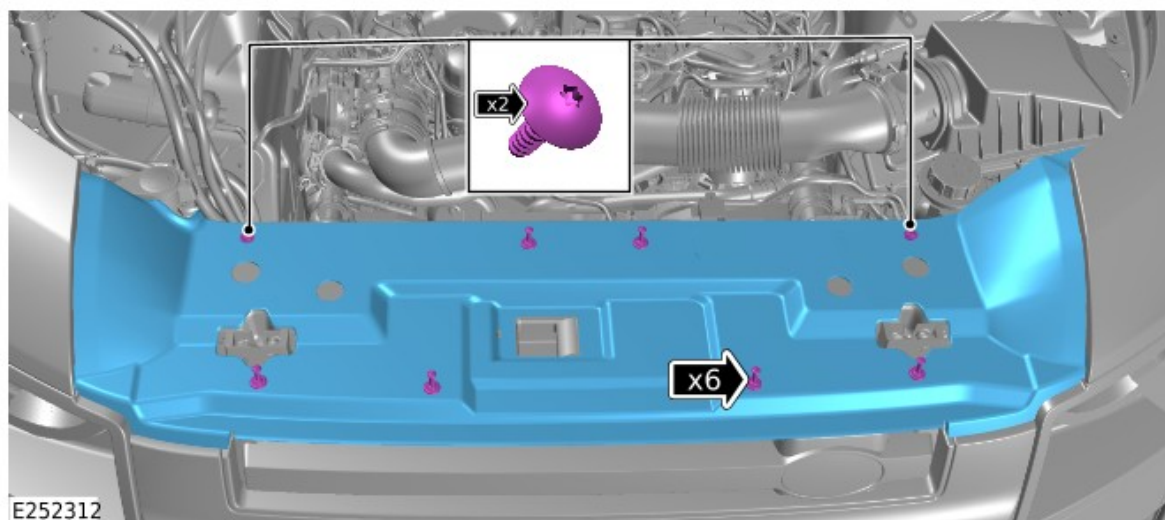

- Install the upper radiator grille panel.
- Install the 6 clips.
- Install the 2 bolts.

Torque: 3Nm