


2022 CHEVROLET CORVETTE SERVICE MANUAL

- [SEARCH](#)


1. [Body Hardware and Trim](#)
2. [Instrument Panel and Console Trim](#)
3. [Repair Instructions](#)
- 4.

Instrument Panel Compartment Replacement


Removal Procedure

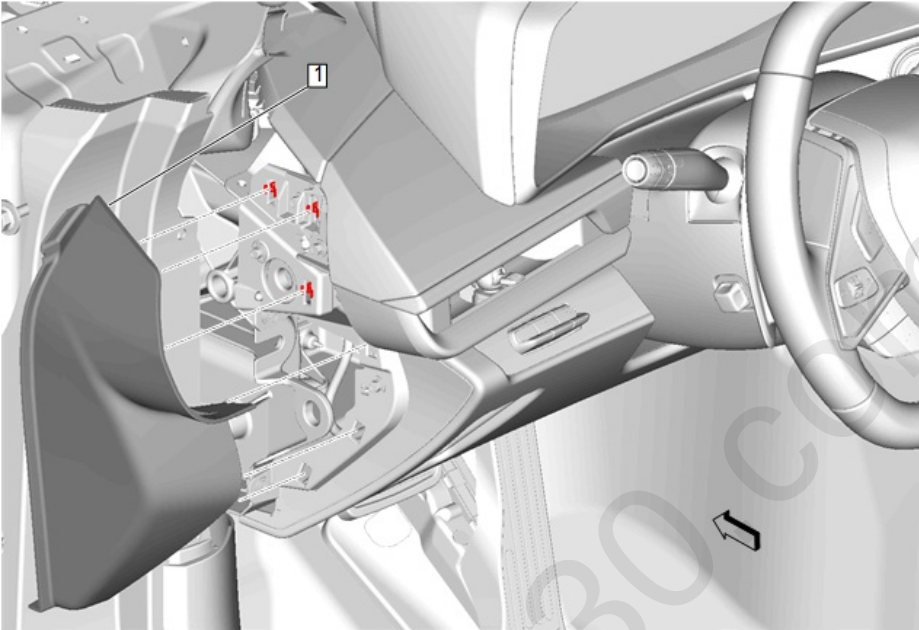


1. [Click here for full size](#)
2. Remove the right instrument panel outer trim cover (1).Instrument Panel Outer Trim Cover Replacement

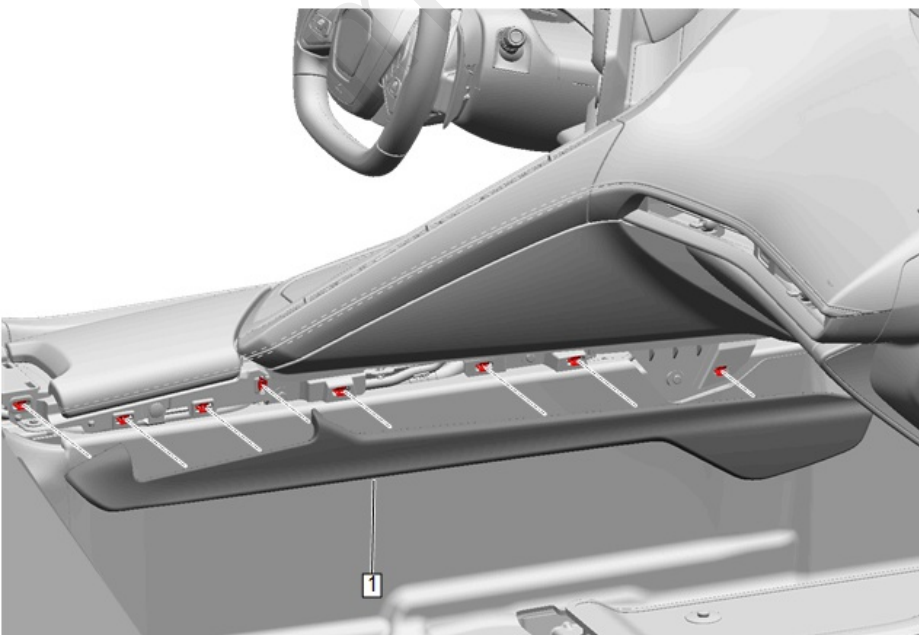


3. [Click here for full size](#)
4. Front Floor Rear Console Side Trim Panel - Right Side (1) >> Remove - Front Floor Rear Console Side Trim Panel Replacement - Right

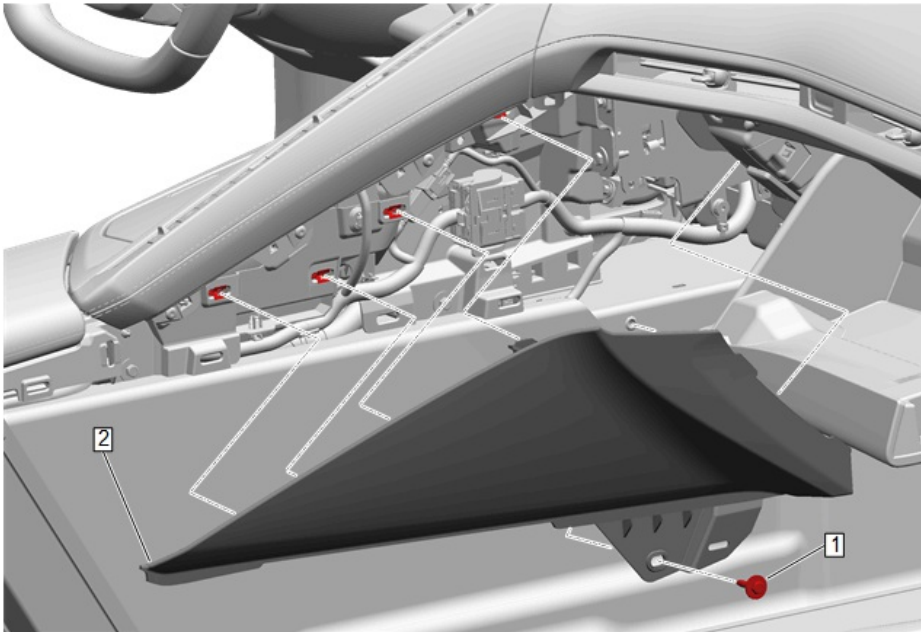

5. [Click here for full size](#)
6. Front Floor Console Extension Panel (2) >> Remove - Front Floor Console Extension Panel Replacement
7. In the event that the door is inoperable, manually release the latch. Refer to Opening the Instrument Panel Compartment Door without Electrical Power.

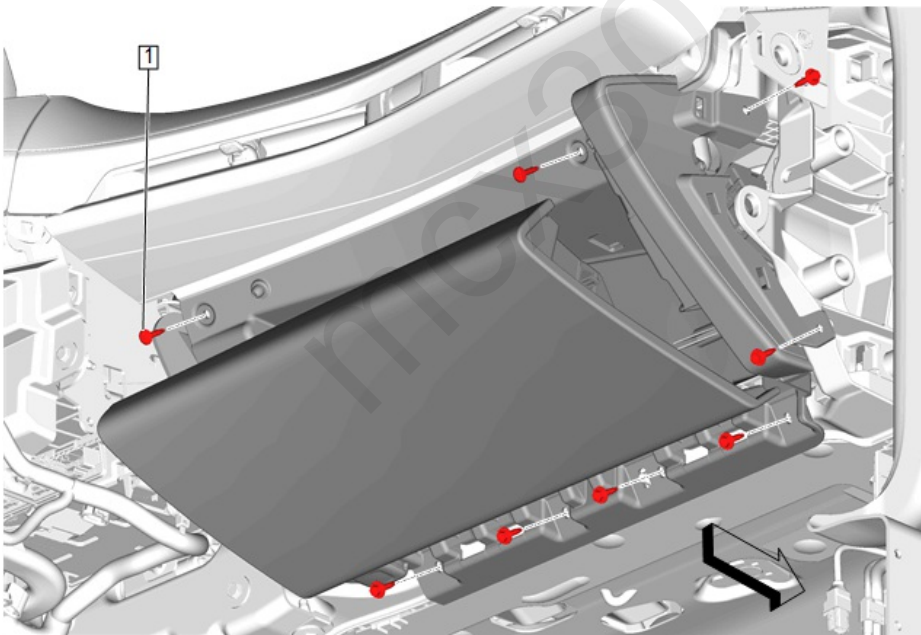


8. [Click here for full size](#)
9. Instrument Panel Compartment Bolt (1) >> Remove [8x]

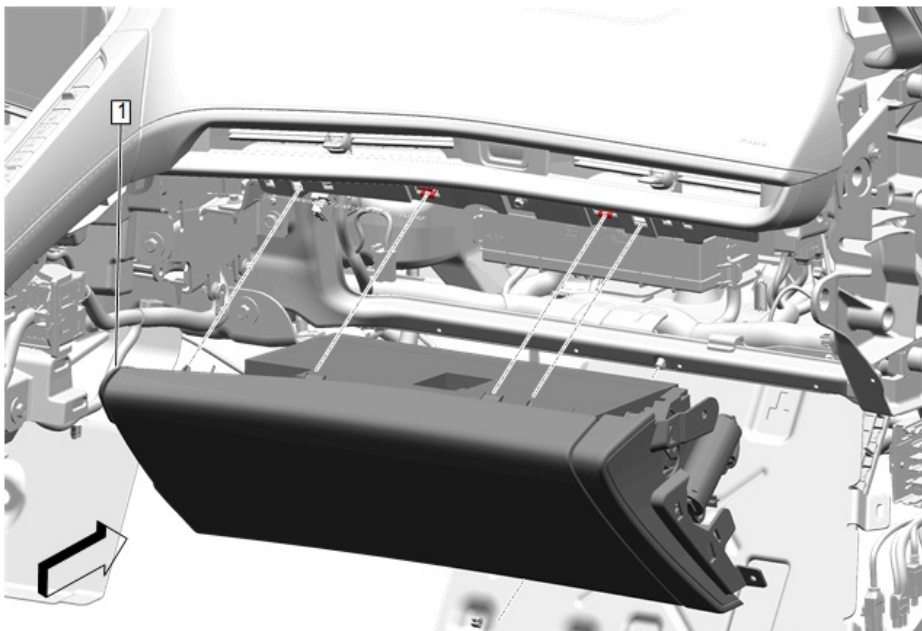


10. [Click here for full size](#)
11. Note:
Use a plastic trim tool if necessary.
12. Instrument Panel Compartment (1) >> Remove
13. Disconnect the electrical connectors.
14. Transfer components as necessary.

Installation Procedure


1. Connect the electrical connectors.

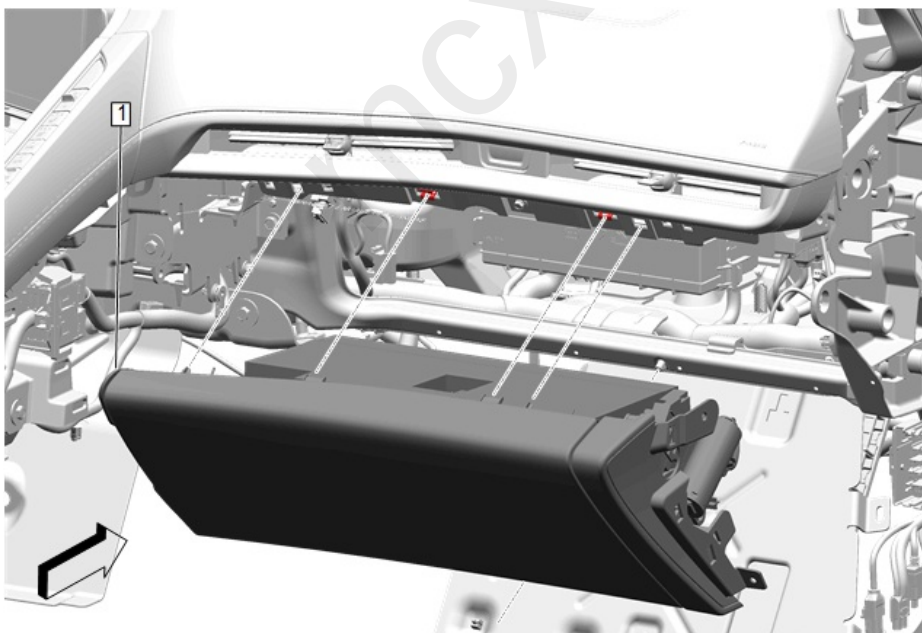


2. [Click here for full size](#)
3. Instrument Panel Compartment (1) >> Install

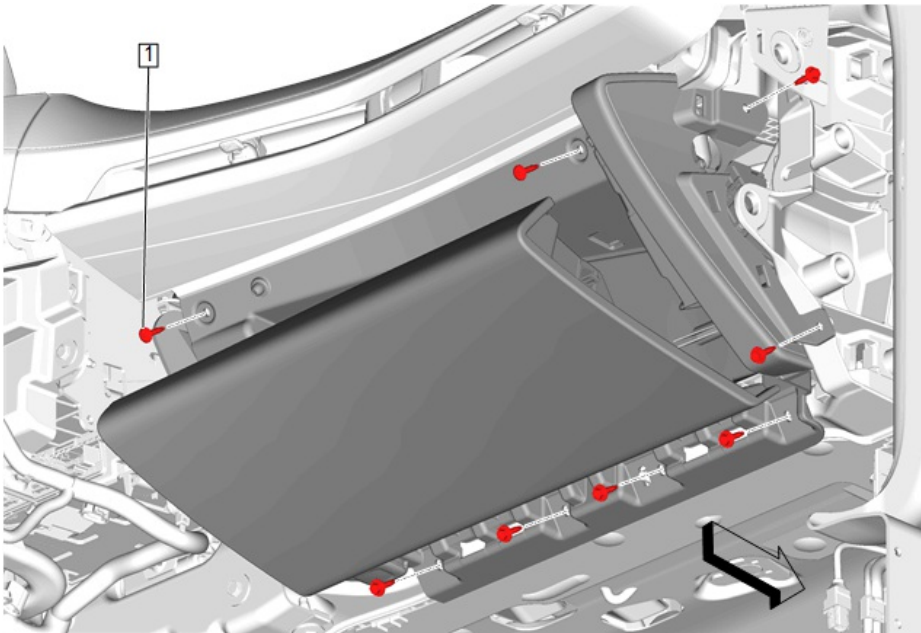

4. [Click here for full size](#)
5. Caution:
Refer to Fastener Caution.
6. Instrument Panel Compartment Bolt (1) >> Install and tighten [8x]2.5N-m (22 lb in)

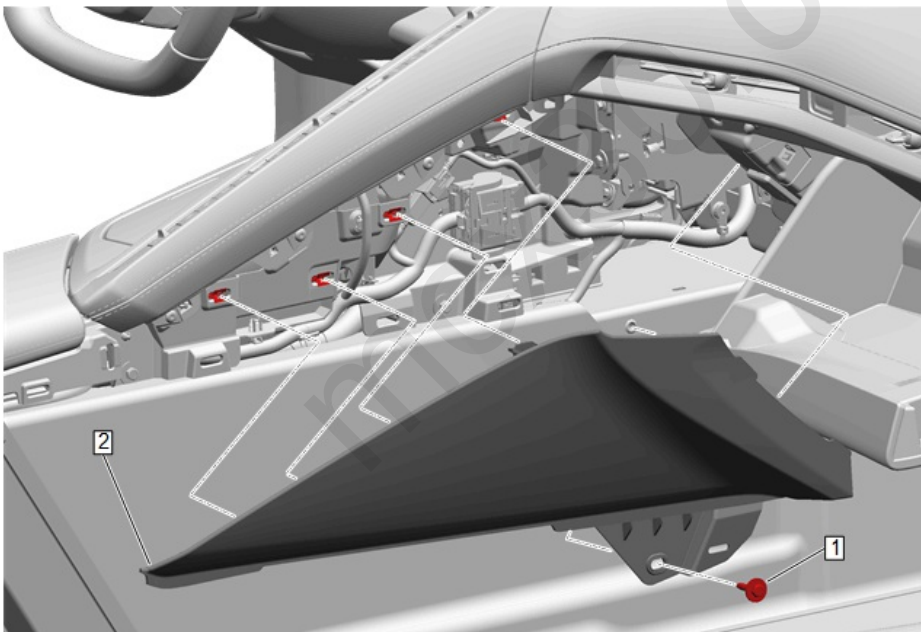


7. [Click here for full size](#)
8. Front Floor Console Extension Panel (2) >> Install - Front Floor Console Extension Panel Replacement

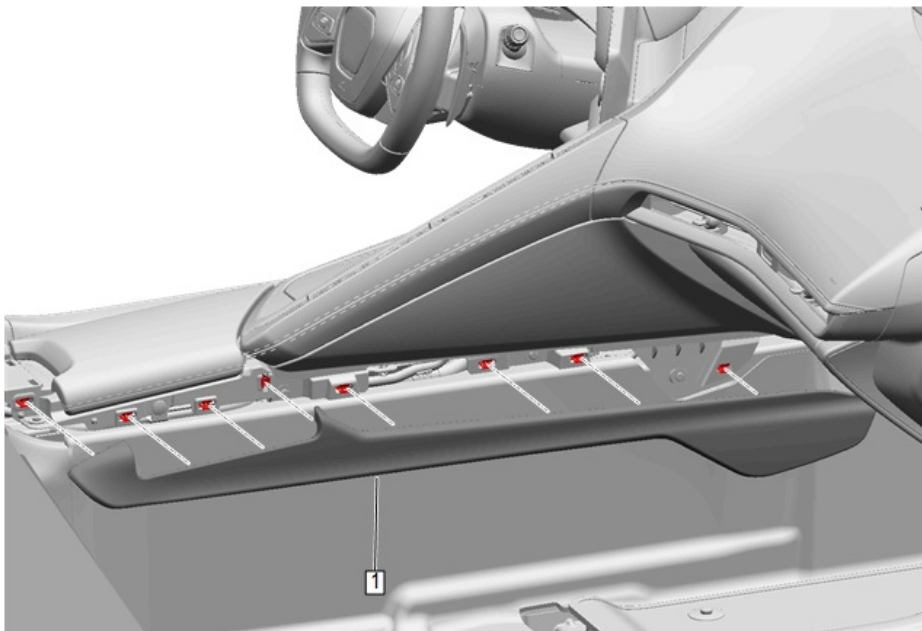

9.
[Click here for full size](#)

10. Front Floor Rear Console Side Trim Panel - Right Side (1) >> Install - Front Floor Rear Console Side Trim Panel Replacement - Right Side

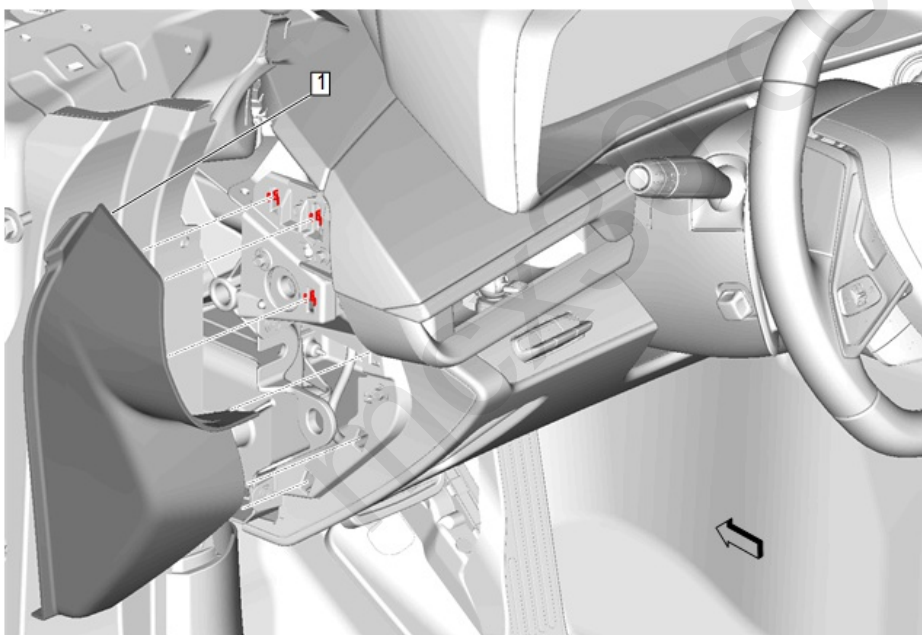

11.
[Click here for full size](#)

12. Install the right instrument panel outer trim cover (1).Instrument Panel Outer Trim Cover Replacement