

2022 CHEVROLET CORVETTE SERVICE MANUAL

- **SEARCH**

1. [Engine/Propulsion](#)
2. **Exhaust**
3. [Repair Instructions](#)
- 4.

Exhaust Control Valve Actuator Replacement (Tailpipe without Actuator Linkage)


Warning:

In order to avoid being burned, do not service the exhaust system while it is still hot. Service the system when it is cool.

Warning:

Avoid contact with HOT components. Wear safety glasses and protective gloves to avoid personal injury.

Removal Procedure

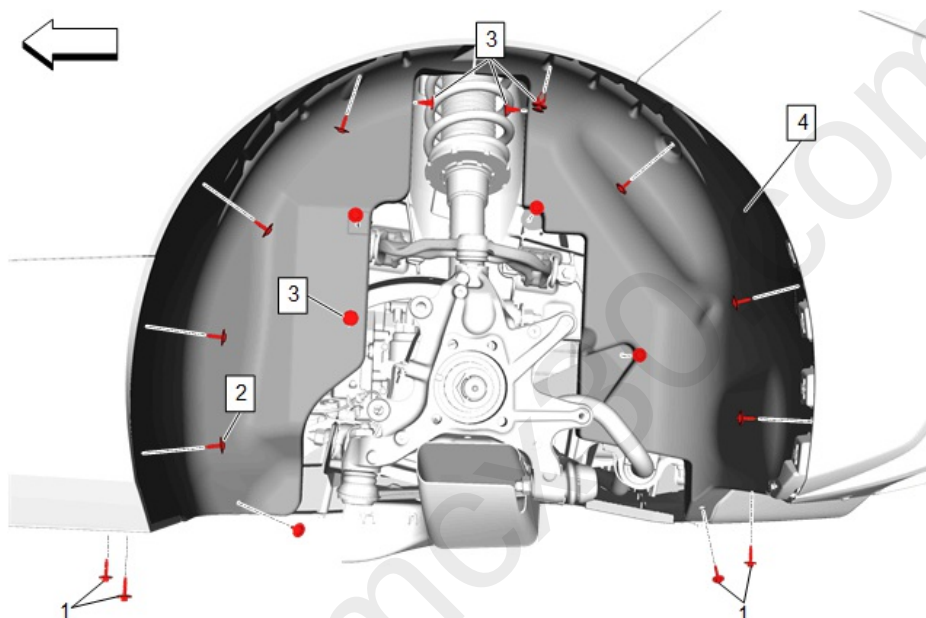


1. [Click here for full size](#)
2. Note:
Left side shown, right side similar.
3. Remove both rear wheelhouse liners:
4.
 - [Rear Wheelhouse Liner Replacement - Right Side](#)
 - [Rear Wheelhouse Liner Replacement - Left Side](#)
5. [Click here for full size](#)
6. Electrical Connector (1) @ Exhaust Control Valve Actuator >> [Disconnect](#)
7. [Click here for full size](#)
8. Exhaust Control Valve Actuator Bolt (1) >> [Remove \[3x\]](#)
9. [Click here for full size](#)
10. Exhaust Control Valve Actuator (1) >> [Remove](#)

Installation Procedure

1. [Click here for full size](#)
2. Exhaust Control Valve Actuator (1) >>> Install
3. [Click here for full size](#)
4. Caution:

Refer to Fastener Caution.
5. Exhaust Control Valve Actuator Bolt (1) >>> Install and tighten [3x]10 N-m (89 lb in)
6. [Click here for full size](#)
7. Electrical Connector (1) @ Exhaust Control Valve Actuator >> Connect

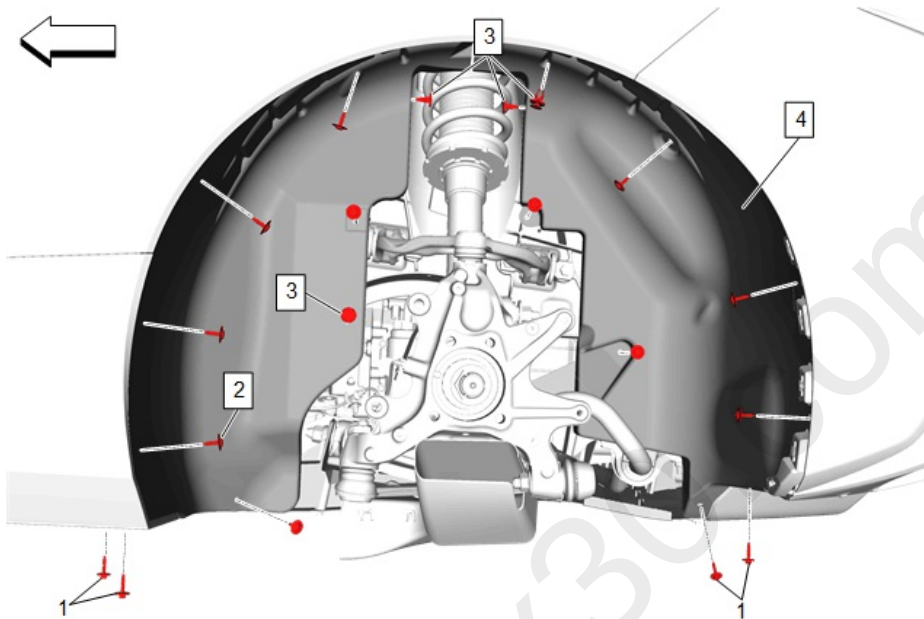

8. [Click here for full size](#)
9. Note:

Left side shown, right side similar.
10. Install both rear wheelhouse liners:
11.
 - Rear Wheelhouse Liner Replacement - Right Side
 - Rear Wheelhouse Liner Replacement - Left Side
12. Perform the Exhaust Flow Control Valve Learn. Exhaust Flow Control Valve Learn