

2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

1. HVAC

2. Heating, Ventilation, and Air Conditioning

3. Repair Instructions

- 4.


Air Conditioning Refrigerant High Pressure Service Valve Replacement

Special Tools

GE-46246, Valve Core Tool

Equivalent regional tools: Special Tools

Removal Procedure

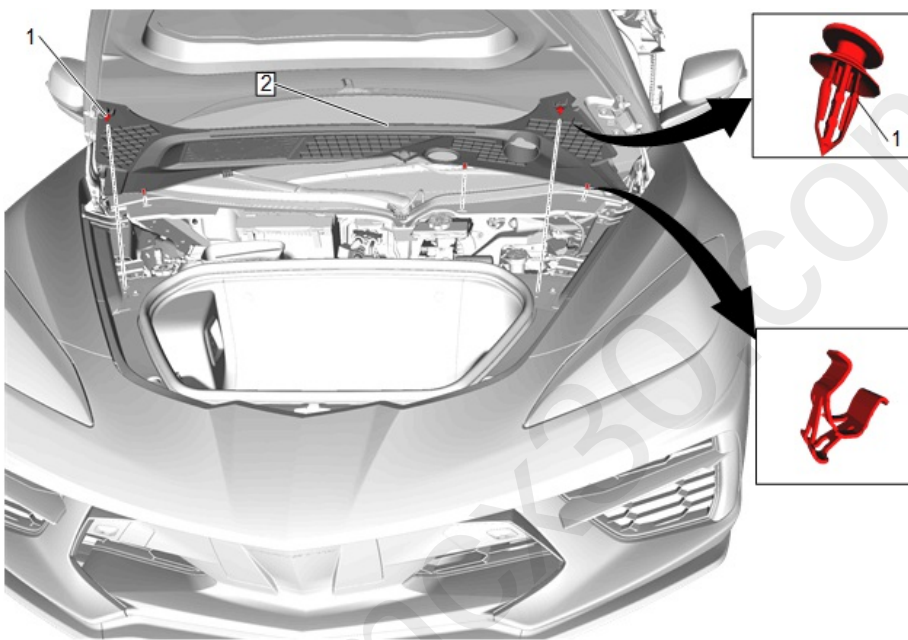


1.

[Click here for full size](#)


2. Front Compartment Rear Access Cover (2) >>> Remove - Front Compartment Rear Access Cover Replacement

3. Recover the refrigerant. Refrigerant Recovery and Recharging

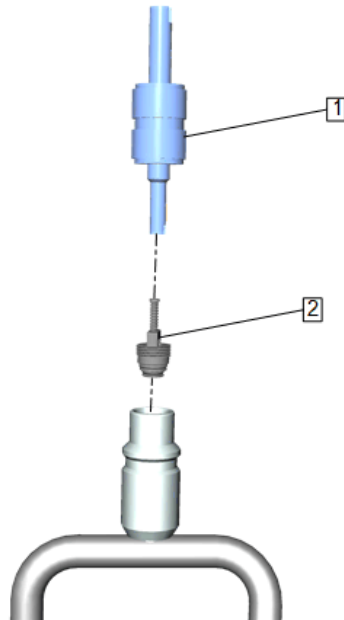


4. [Click here for full size](#)
5. Use *GE-46246* valve core tool (1) or equivalent to remove the valve core (2).

Installation Procedure

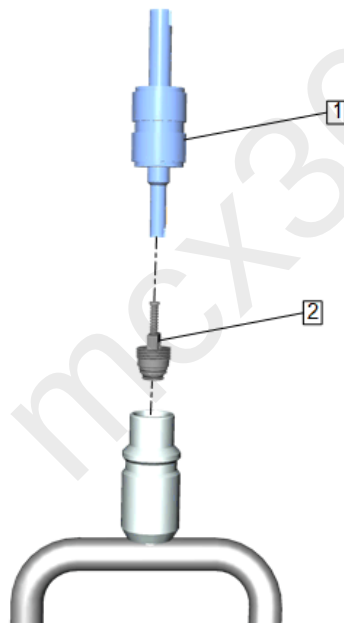

1. [Click here for full size](#)
2. Caution:
Refer to Component Fastener Tightening Caution.
3. Use *GE-46246* valve core tool (1) or equivalent to install and tighten the valve core (2) to 2 N-m (18 lb in).
4. Recharge the refrigerant. Refrigerant Recovery and Recharging
5. Inspect for refrigerant leaks. Leak Testing

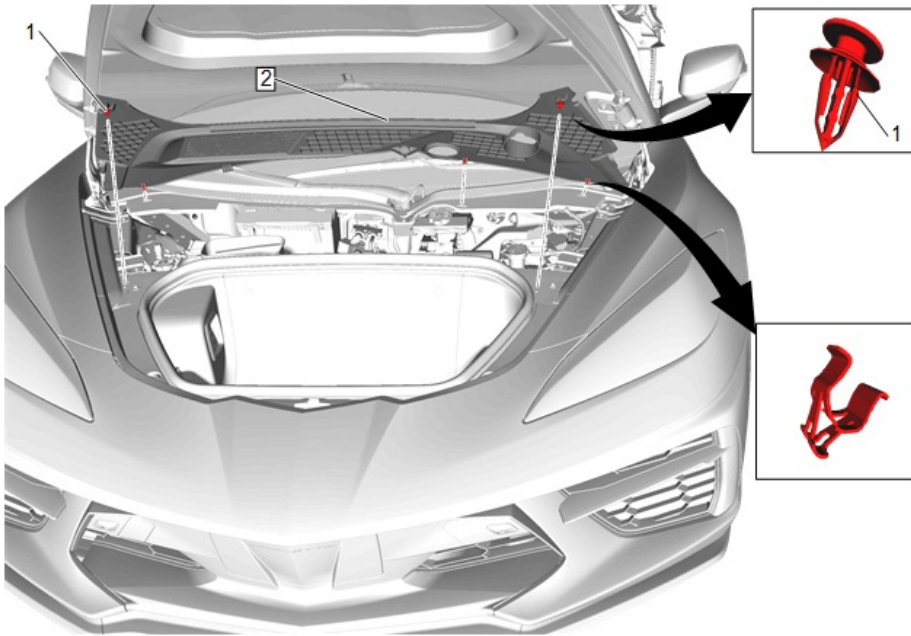

6.
[Click here for full size](#)

7. Front Compartment Rear Access Cover (2) >>> Install - Front Compartment Rear Access Cover Replacement

mcx30.com