

2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

1. HVAC

2. Heating, Ventilation, and Air Conditioning

3. Repair Instructions

- 4.


Air Conditioning Refrigerant Service Valve Core Replacement

Tools Required


- GE-46246, Valve Core Tool

Equivalent regional tools: Special Tools.

Removal Procedure

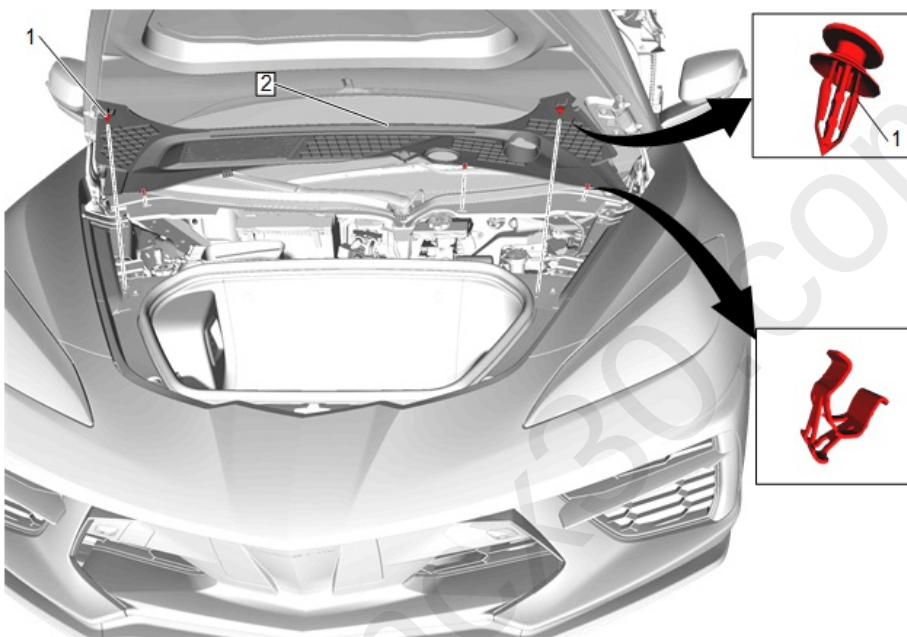


1. [Click here for full size](#)
2. Front Compartment Rear Access Cover (2) >>> Remove - Front Compartment Rear Access Cover Replacement
3. Recover the refrigerant. Refrigerant Recovery and Recharging

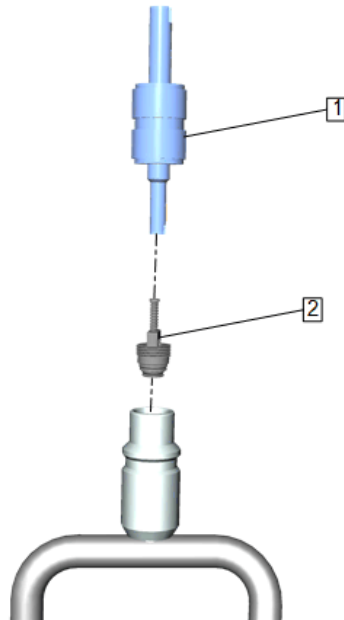


4. [Click here for full size](#)
5. Use *GE-46246* valve core tool (1) or equivalent to remove the valve core (2).

Installation Procedure

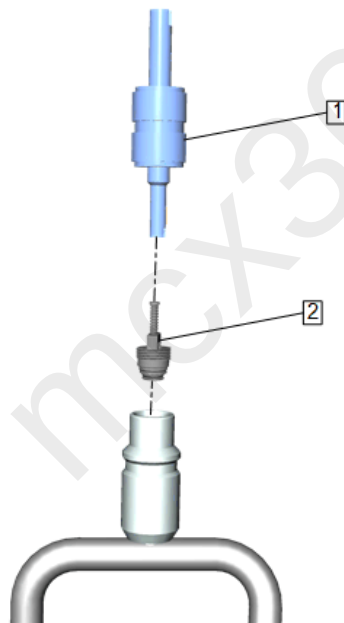

1. [Click here for full size](#)
2. Caution:
Refer to Component Fastener Tightening Caution.
3. Use *GE-46246* valve core tool (1) or equivalent to install and tighten the valve core (2) to .9 N-m (8 lb in).
4. Recharge the refrigerant. Refrigerant Recovery and Recharging
5. Inspect for refrigerant leaks. Leak Testing

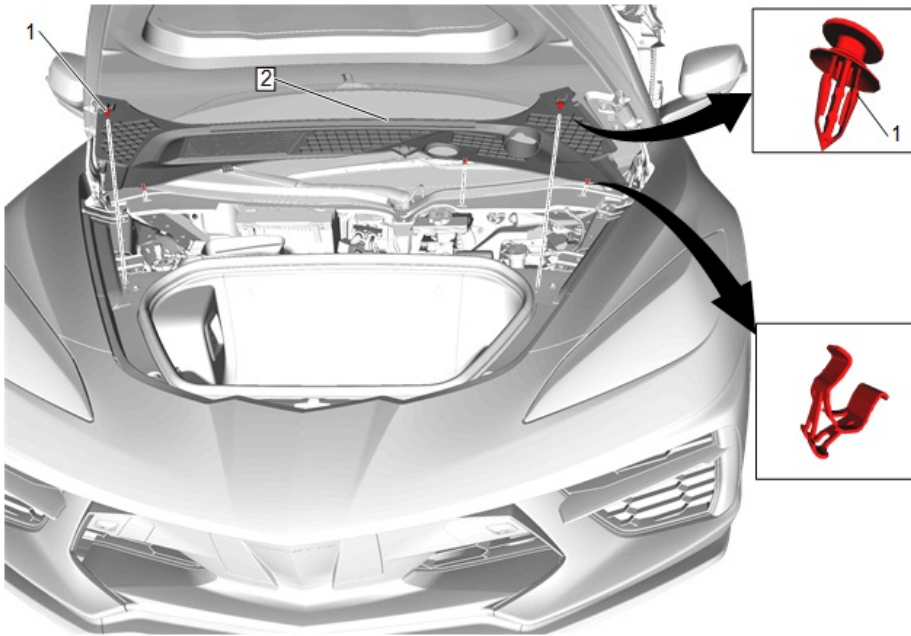

6.
[Click here for full size](#)

7. Front Compartment Rear Access Cover (2) >>> Install - Front Compartment Rear Access Cover Replacement

mcx30.com