


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH


1. HVAC
2. **HVAC - Automatic**
3. **Repair Instructions**
- 4.

Mode Valve Actuator Replacement

Removal Procedure

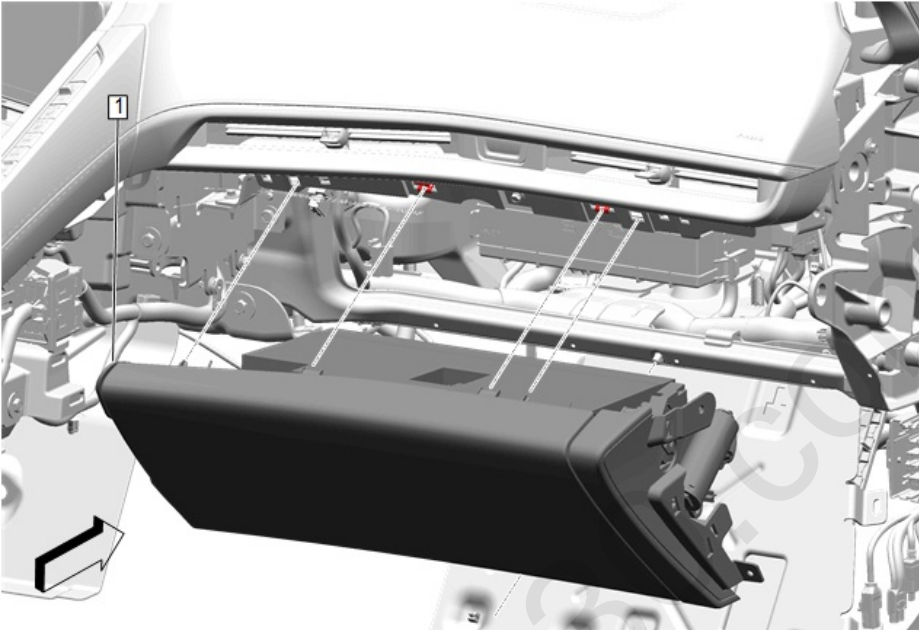

1. [Click here for full size](#)
2. Instrument Panel Compartment (1) >> Remove - Instrument Panel Compartment Replacement
3. [Click here for full size](#)
4. Instrument Panel Wiring Harness Fuse Block (1) >> Reposition - Instrument Panel Wiring Harness Fuse Block Replacement

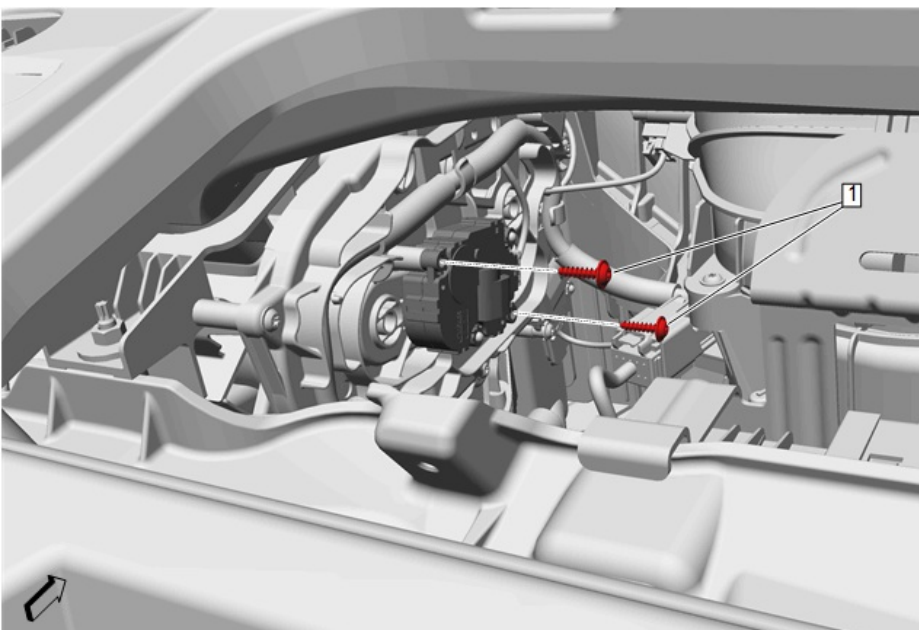


- 5.

[Click here for full size](#)

6. Note:

Some components not shown for graphic clarity.

7. Mode Valve Actuator Bolt (1) >>> Remove [2x]

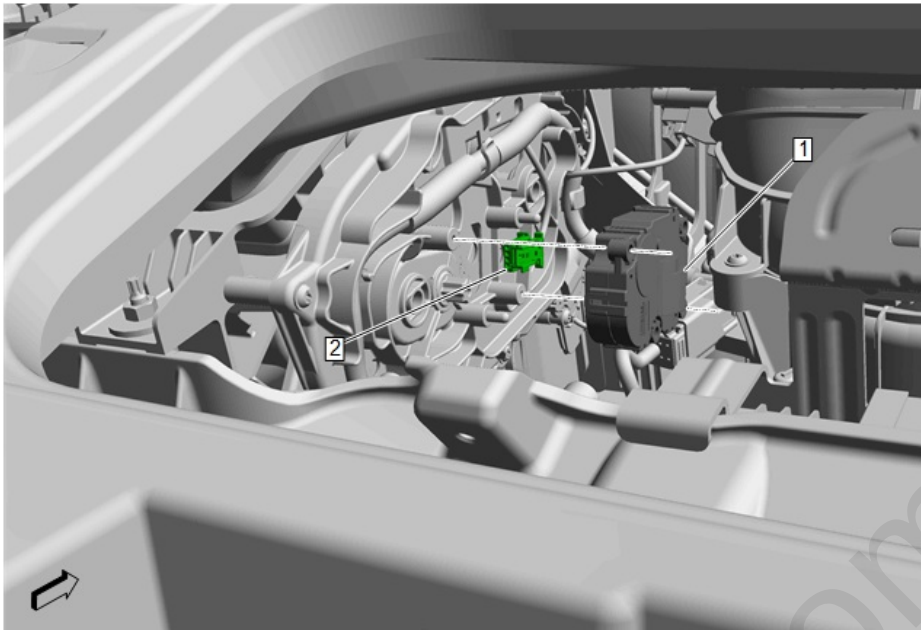

8.

[Click here for full size](#)


9. Note:

Some components not shown for graphic clarity.

10. Mode Valve Actuator (1) >>> Remove

11. Disconnect the electrical connector. (2)

Installation Procedure

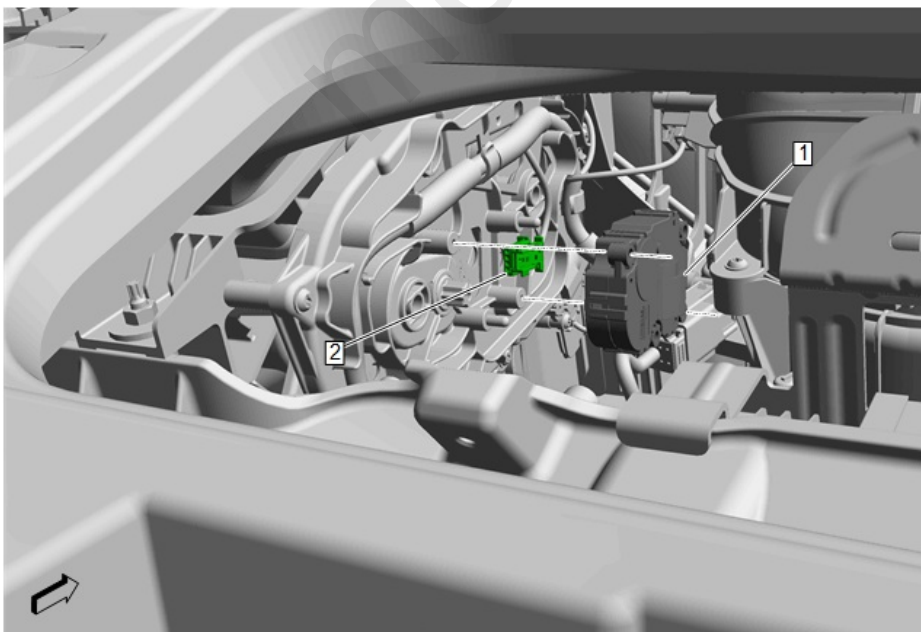


1.

[Click here for full size](#)

2. Note:

Some components not shown for graphic clarity.

3. Connect the electrical connector. (2)
4. Mode Valve Actuator (1) >>> Install

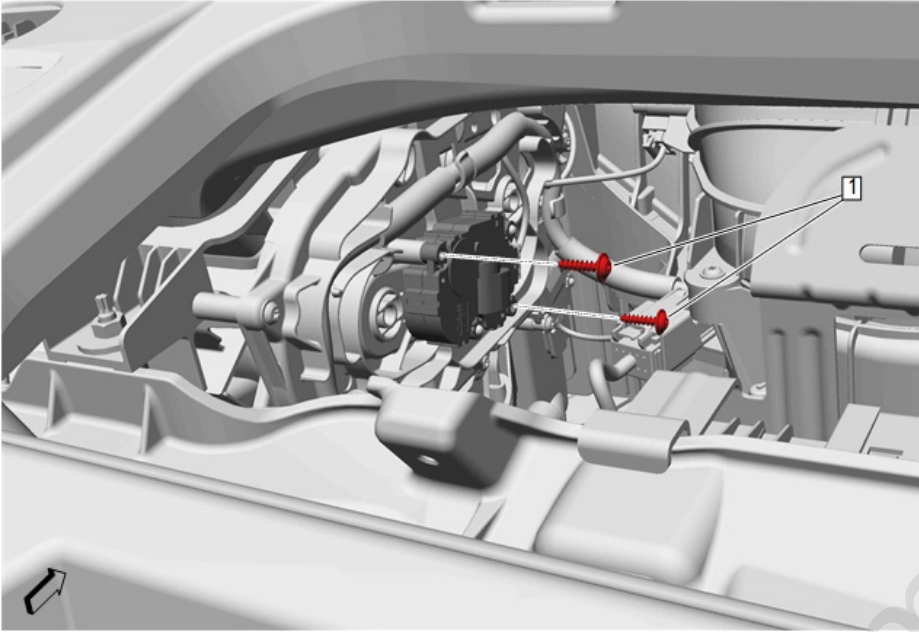

5.
[Click here for full size](#)

6. Note:

Some components not shown for graphic clarity.


7. Caution:

Refer to Fastener Caution.

8. Mode Valve Actuator Bolt (1) >>> Install and tighten [2x]1.5 N-m (13 lb in)

9. [Click here for full size](#)

10. Instrument Panel Wiring Harness Fuse Block (1) >>> Install - Instrument Panel Wiring Harness Fuse Block Replacement

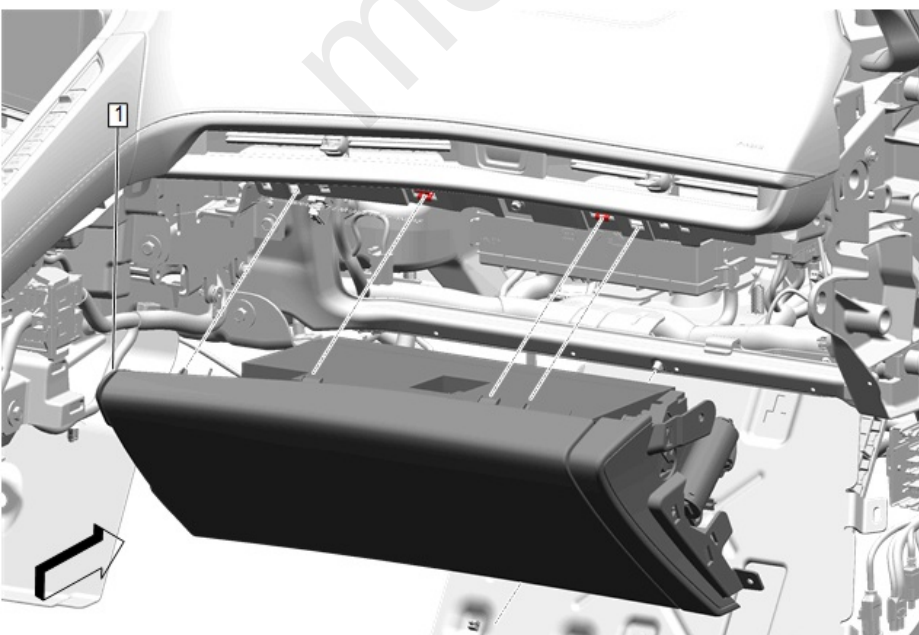

11.
[Click here for full size](#)

12. Instrument Panel Compartment (1) >>> Install - Instrument Panel Compartment Replacement

13. Perform the actuator calibration procedure. Actuator Recalibration

mcx30.com