


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Safety and Security
- 2. Supplemental Restraints
- 3. Repair Instructions
- 4.

Front Seat Outboard Seat Back Airbag Replacement

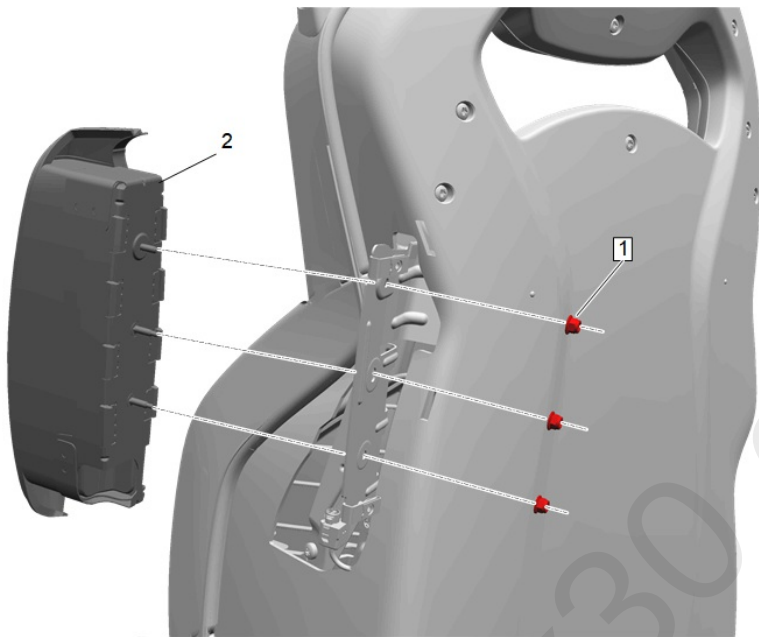

Click here for full size
SIR Disabling and Enabling

- Apply two layers of masking tape around the front seat back cushion finish panel to prevent surface damage.
-

Front Seat Back Airbag Opening Bezel Replacement

Fastener Caution.

Tighten

4.5 N-m (40 lb in)

SIR Disabling and Enabling

-

Inflatable Restraint Module Handling and Scrapping

Callout	Component Name

Callout	Component Name
Warning: Following the deployment of a side impact air bag, inspect the following parts for damage. Replace these parts if necessary: • The seat cushion frame • The seat recliner, if equipped • The seat adjuster • The seat back frame Failure to do so may cause future personal injury. Preliminary Procedures 1. Disable the SIR system.	
1	Front Seat Outboard Seat Back Airbag Nut [3X] Caution: Refer to
2	Front Seat Outboard Seat Back Airbag Procedure 1. Release the connector position assurance (CPA) from the electrical connector. 2. Disconnect the electrical connector. 3. Enable the SIR System.