


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Body Repair
- 2. Bolted Exterior Body Panels and Closures
- 3. Repair Instructions
- 4.

Hood Adjustment

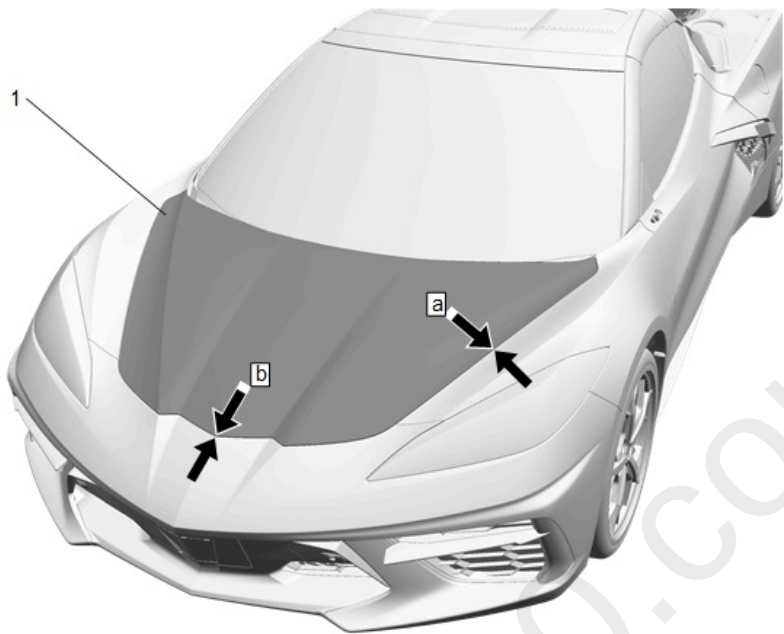

[Click here for full size Hood Replacement](#)

- Loosen and adjust the hood primary and secondary latch and the hood bumpers as necessary to obtain the adjustment.

Hood Primary and Secondary Latch Replacement

Adjustment Procedure

- Hood to front fender (a) 3.0 mm $\tilde{\wedge}\pm$ 1 mm (0.12 in $\tilde{\wedge}\pm$ 0.04 in)
- Hood to front bumper fascia (b) 3.0 mm $\tilde{\wedge}\pm$ 1.5 mm (0.12 in $\tilde{\wedge}\pm$ 0.06 in)

Callout	Component Name
1	Hood Procedure 1. Loosen the 4 hood hinge bolts. 2. Adjust the hood in order to obtain an even gap on both sides between the hood and the fenders, and the front bumper fascia. 3. Tighten the 4 hood hinge nuts.