


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Body Repair
- 2. Bolted Exterior Body Panels and Closures
- 3. Repair Instructions
- 4.

Hood Primary and Secondary Latch Replacement

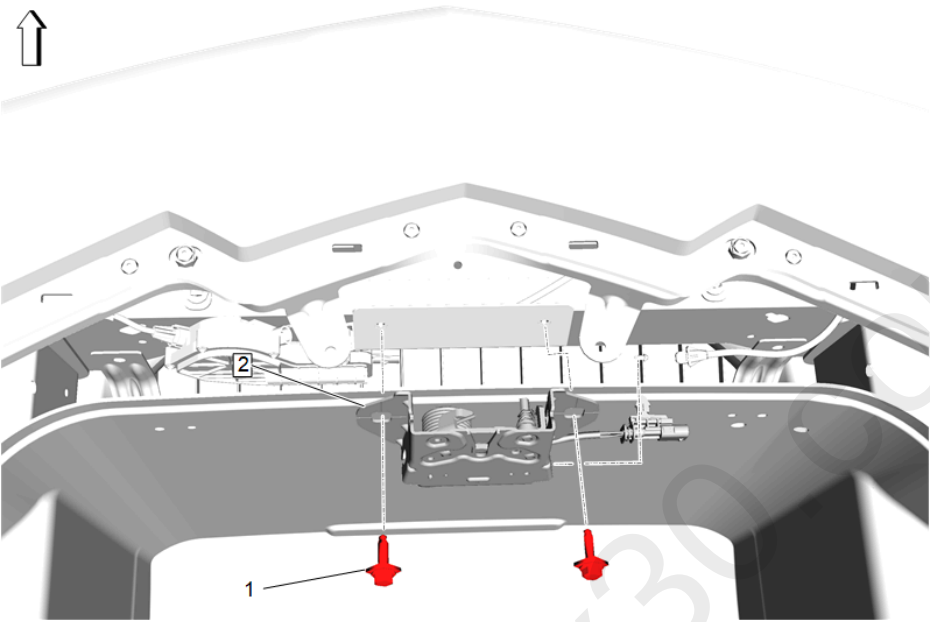

[Click here for full size](#)
Front Compartment Front Sight Shield Replacement

- Mark the location of the hood primary and secondary latch before removing the bolts with a grease pencil.

Fastener Caution.

Tighten

9>N-m (80 lb in)

Callout	Component Name
Preliminary Procedures	
1.	
1	Hood Primary and Secondary Latch Bolt [2>x]
	Caution:
	Refer to

Callout	Component Name
2	Hood Primary and Secondary Latch Procedure 1. Disconnect the hood secondary latch cable from the hood primary and secondary latch. 2. Disconnect the electrical connector. 3. Align the hood primary and secondary latch if necessary.

mcx30.com