


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Body Systems
- 2. **Lighting**
- 3. **Repair Instructions**
- 4.

Front Suspension Automatic Forward Lighting Position Sensor Replacement

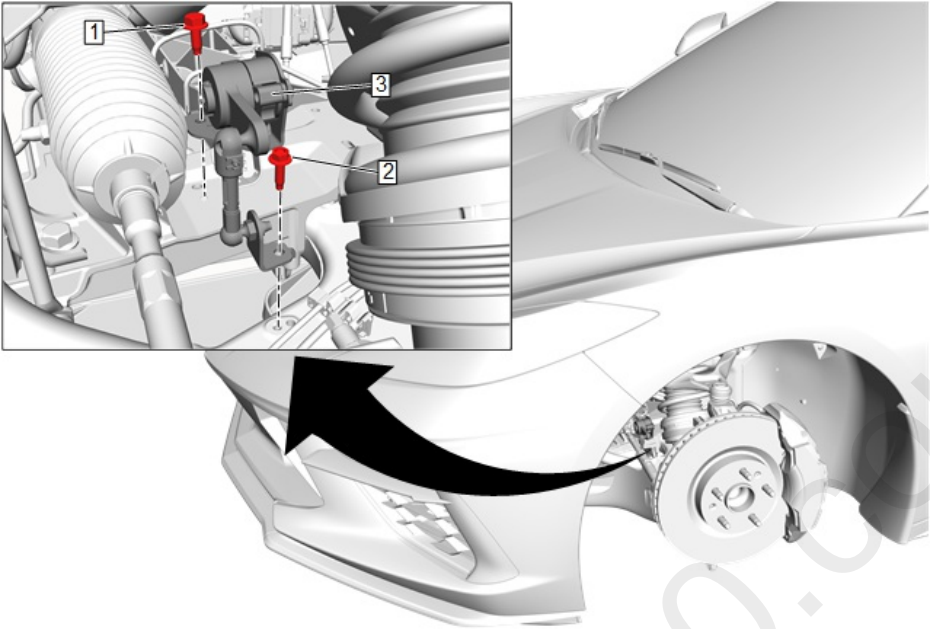

[Click here for full size](#)
Tire and Wheel Removal and Installation

Fastener Caution.

Tighten

9>N-m (80 lb in)

Control Module References

Callout	Component Name
Preliminary Procedure	
Remove the left front tire and wheel.	
1	Headlamp Leveling Front Suspension Height Sensor Bolt @ Drivetrain and Front Suspension Cradle Caution: Refer to
2	Headlamp Leveling Front Suspension Height Sensor Bolt @ Front Lower Control Arm Tighten 4.7N-m (42 lb in)

Callout	Component Name
3	Front Suspension Automatic Forward Lighting Position Sensor Note: Anytime the sensor is disconnected or replaced, the calibration procedure must be done. Procedure 1. Disconnect the electrical connector. 2. Calibrate the front suspension 4 corner leveling system position sensor.

mcx30.com