

2022 CHEVROLET CORVETTE SERVICE MANUAL

- **SEARCH**


1. **Brakes**

2. **Disc Brakes**

3. **Repair Instructions**

- 4.

Front Brake Caliper Bleeder Valve Replacement (JL9)

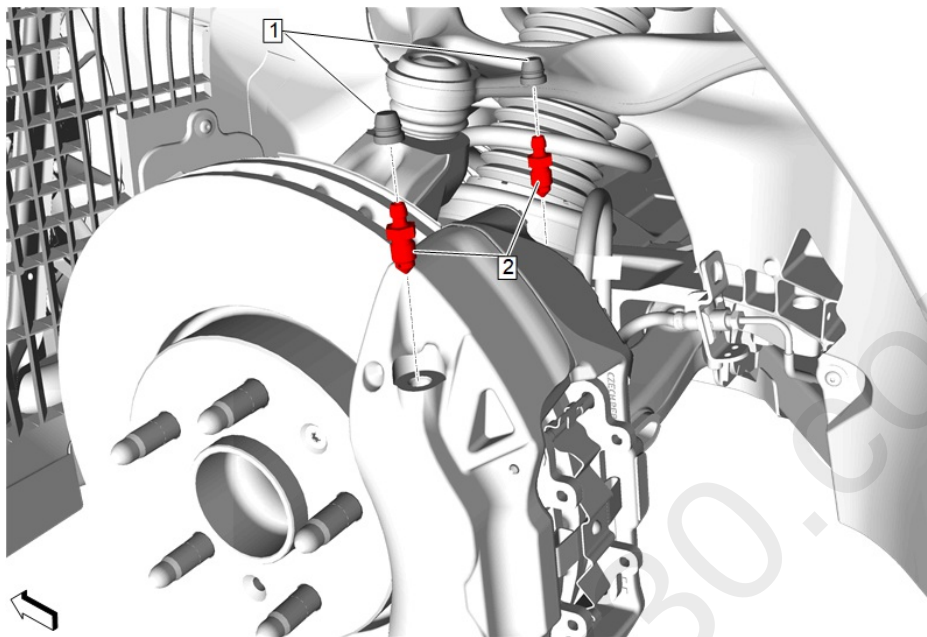

[Click here for full size
Brake Dust Warning](#)

Warning:

Brake Fluid Irritant Warning

Caution:

Brake Fluid Effects on Paint and Electrical Components Caution

Preliminary Procedures

1. Disconnect the battery negative cable.

Battery Negative Cable Disconnection and Connection

- Remove the front tire and wheel assembly.

Tire and Wheel Removal and Installation

Component Fastener Tightening Caution

Note:

If directed here from the brake bleed procedure in reference to torque specification, it is not necessary to bleed the brake system again.

Tighten

17 Nm (13 lb ft)

Procedure

1. Install the front tire and wheel assembly.

Tire and Wheel Removal and Installation

- Connect the battery negative cable.

Battery Negative Cable Disconnection and Connection

- Bleed the brake system.

Hydraulic Brake System Bleeding

Callout	Component Name
Warning: The battery must be disconnected to prevent the brake master cylinder from pressurizing the hydraulic system during its automated self diagnostic tests that can possibly occur when a door is opened or the key transmitter is activated. Failure to follow this precaution may cause personal injury.	
Warning:	
1	Front Brake Caliper Bleeder Valve Cap [2x]
2	Front Brake Caliper Bleeder Valve [2x] Caution: