


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. [Engine/Propulsion](#)
- 2. [Engine Controls and Fuel - 6.2L \(LT2\)](#)
- 3. [Repair Instructions](#)
- 4.

Accelerator Pedal Replacement

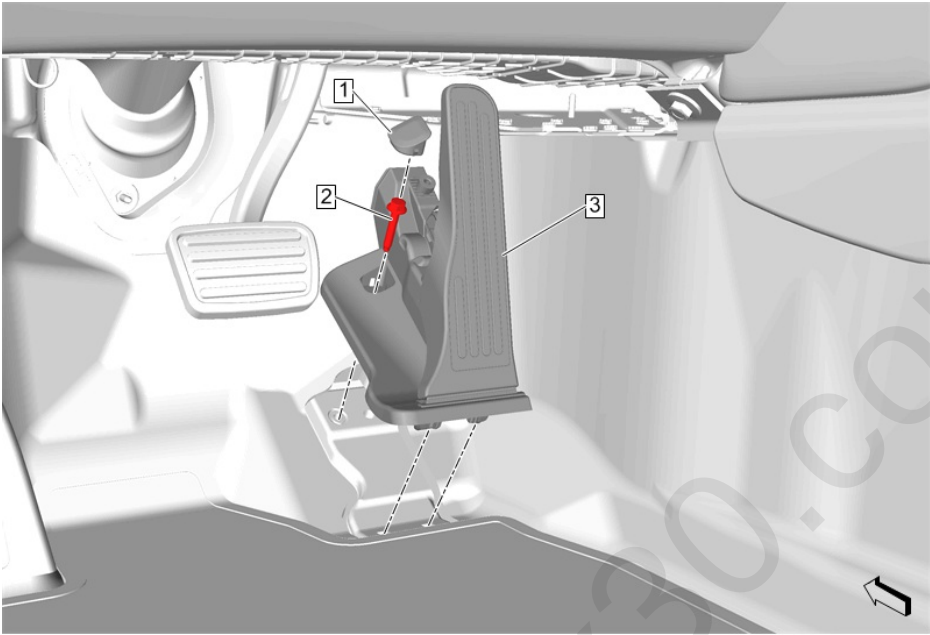

Click here for full size
Fastener Caution.

Tighten

9>N-m (80 lb in)

Callout	Component Name
1	Accelerator Pedal Cover
2	Accelerator Pedal Bracket Bolt
	Caution: Refer to

Callout	Component Name
3	Accelerator Pedal Caution: When installing the Accelerator Pedal do NOT use a mallet or excessive force on the pedal assembly or damage to the pedal assembly could occur, requiring replacement of the pedal assembly. Procedure 1. Disconnect the connector from the accelerator pedal. 2. Tilt the top of the accelerator pedal rearward. 3. Slide the accelerator pedal back to disengage its lower retaining tabs.

mcx30.com