


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Engine/Propulsion
- 2. Engine Controls and Fuel - 6.2L (LT2)
- 3. Repair Instructions
- 4.

Fuel Tank Filler Pipe Replacement

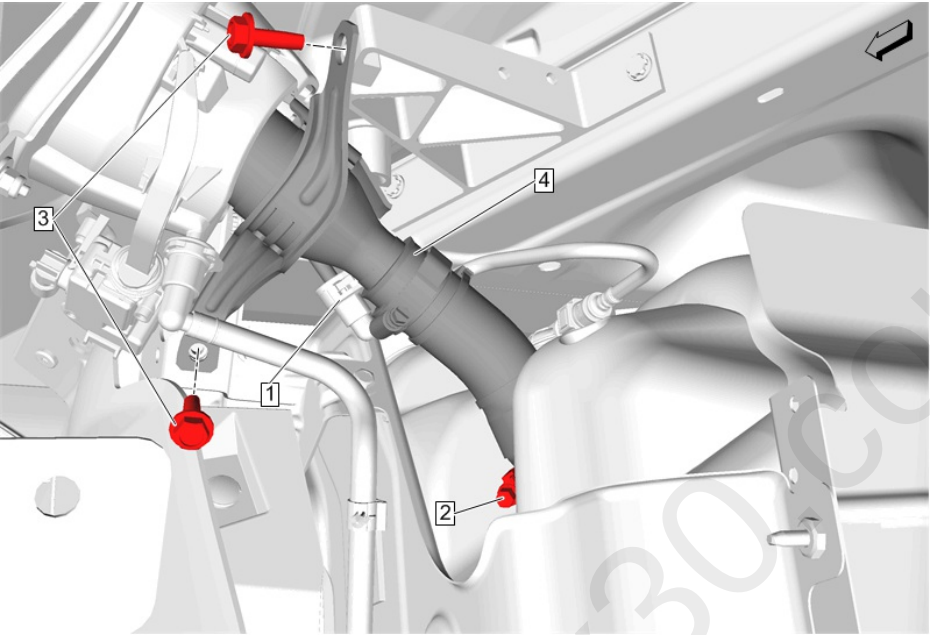

Click here for full size
Diesel/Gasoline Vapors Warning.

Warning:

Refer to

Safety Glasses Warning.

Preliminary Procedures

- 1. Drain the fuel tank just below the fuel tank filler hose.

Fuel Tank Draining

-

Engine Cooling Fan Bracket Replacement - Left Side

Plastic Collar Quick Connect Fitting Service

Fastener Caution.

Tighten

4.5N-m (40 lb in)

Callout	Component Name
---------	----------------

Callout	Component Name
Warning:	
Refer to	
1	Fuel Tank Filler Evaporative Emission Pipe Procedure Disconnect the quick connect fitting.
2	Fuel Tank Filler Hose Clamp Caution: Refer to
3	Fuel Tank Filler Pipe Ground Bolt [2>x] Tighten 22N-m (16 lb ft)
4	Fuel Tank Filler Pipe

mcx30.com