


2022 CHEVROLET CORVETTE SERVICE MANUAL

- SEARCH

- 1. Engine/Propulsion
- 2. Engine Controls and Fuel - 6.2L (LT2)
- 3. Repair Instructions
- 4.

Gas Engine Ignition Spark Plug Replacement - Left Side

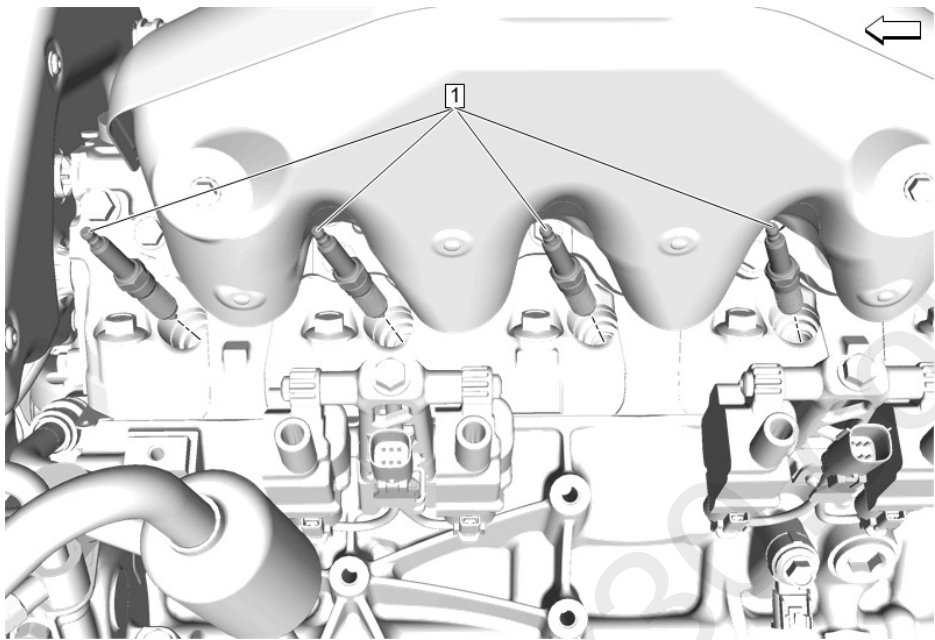

Click here for full size
Spark Plug Wire Replacement - Left Side

Component Fastener Tightening Caution.

Procedure

- 1. Loosen each spark plug 1 or 2 turns.
- 2. Use a brush, or compressed air in order to remove any dirt from the spark plugs.
- 3. Remove the spark plugs (1) one at a time and place each plug in a tray marked with the corresponding cylinder numbers.

Tighten

20N-m (15 lb ft)

Callout	Component Name
Preliminary Procedure	
1	Spark Plug [4>x]
	Caution:
	Refer to