

2022 CHEVROLET CORVETTE SERVICE MANUAL


- SEARCH

1. [Engine/Propulsion](#)
2. [Engine Heating and Cooling](#)
3. [Repair Instructions](#)
- 4.


Auxiliary Engine Coolant Fan Replacement - Right Side (Coupe without V08, V09)

Removal Procedure


1. Rear Wheelhouse Liner >> Reposition - Rear Wheelhouse Liner Replacement - Right Side

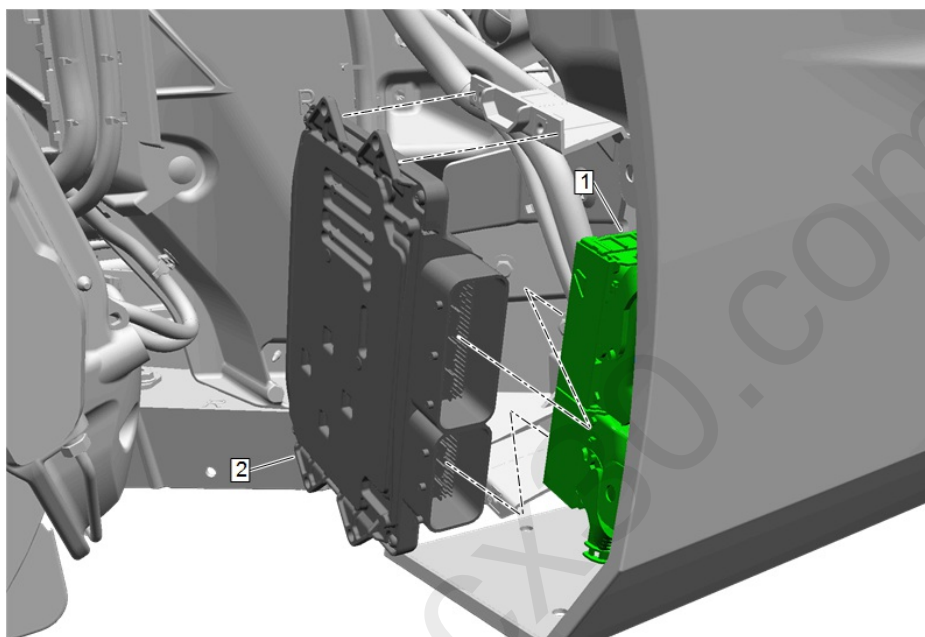


2. [Click here for full size](#)
3. Transmission Control Module (2) >> Remove - Transmission Control Module Replacement

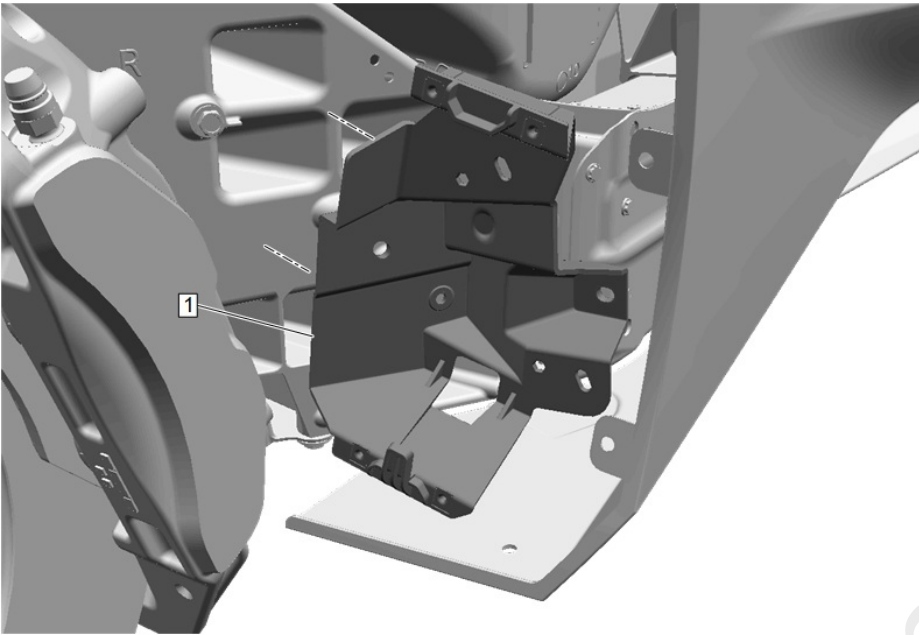

4. [Click here for full size](#)
5. Transmission Control Module Bracket (1) >> Remove - Transmission Control Module Bracket Bracket Replacement

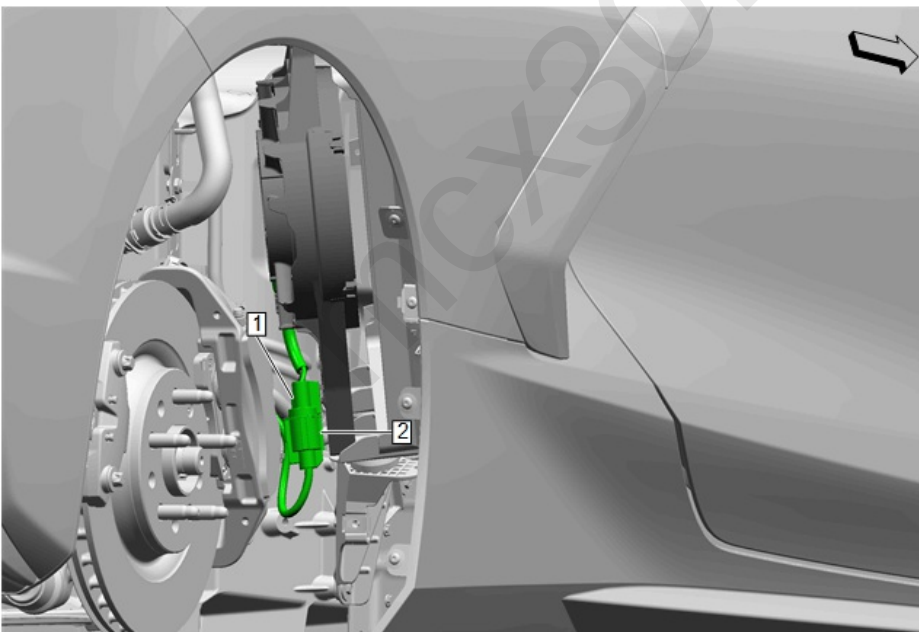


6. [Click here for full size](#)
7. Disconnect the electrical connector (2) from the auxiliary engine cooler fan electrical connector (1).

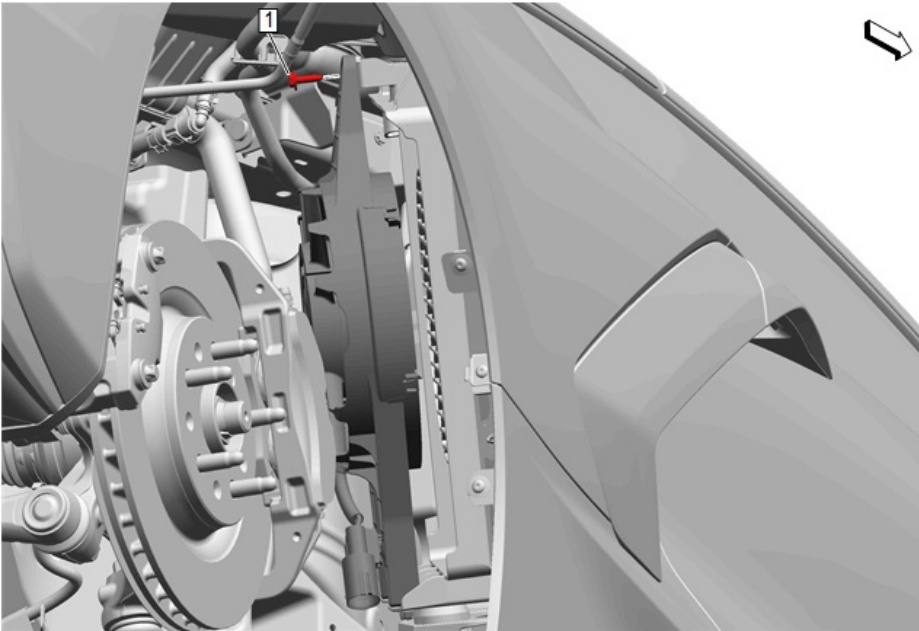

8.
[Click here for full size](#)


9. Engine Coolant Fan Shroud Bolt (1) >> Remove

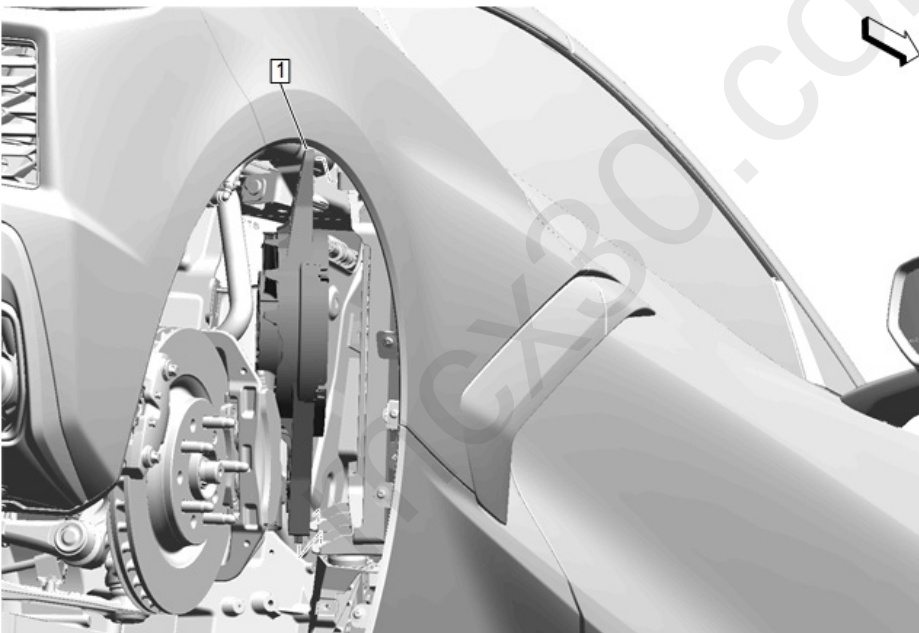


10.
[Click here for full size](#)

11. Auxiliary Engine Coolant Fan (1) >> Remove


Installation Procedure

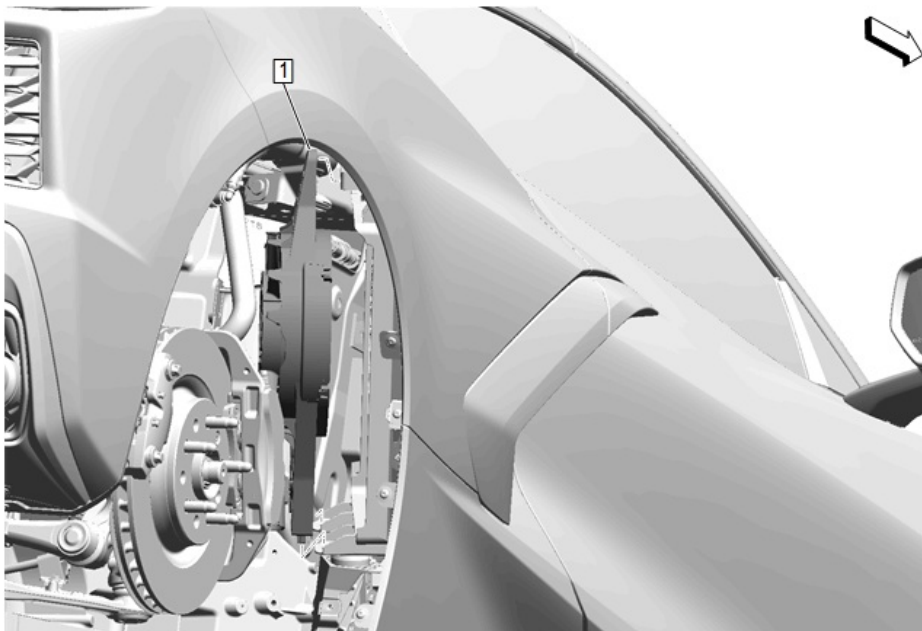


1.
Click here for full size
2. Auxiliary Engine Coolant Fan (1) >> Install

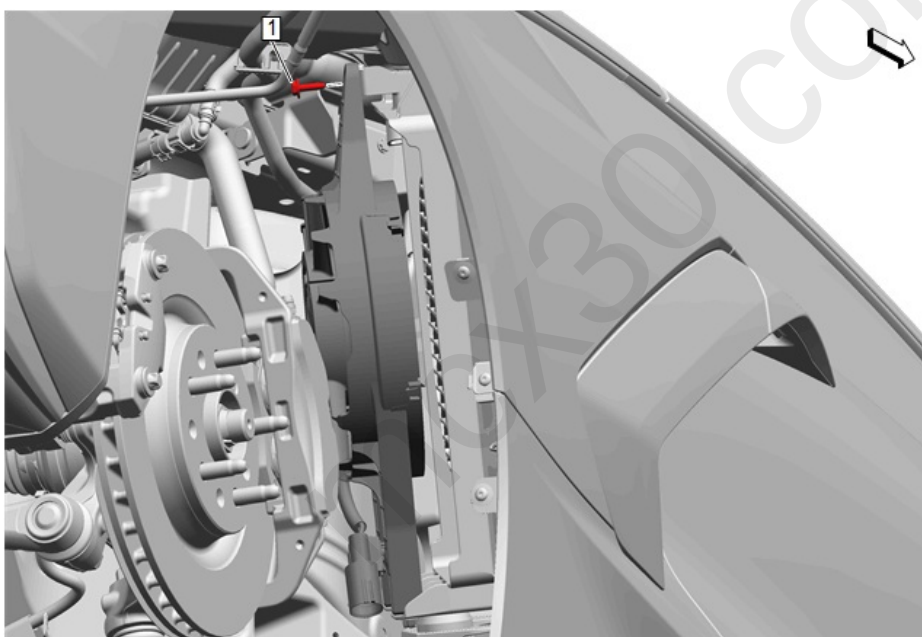


3.
Click here for full size
4. Caution:
Refer to Fastener Caution
5. Engine Coolant Fan Shroud Bolt (1) >> Install and tighten 7 N-m (62 lb in)

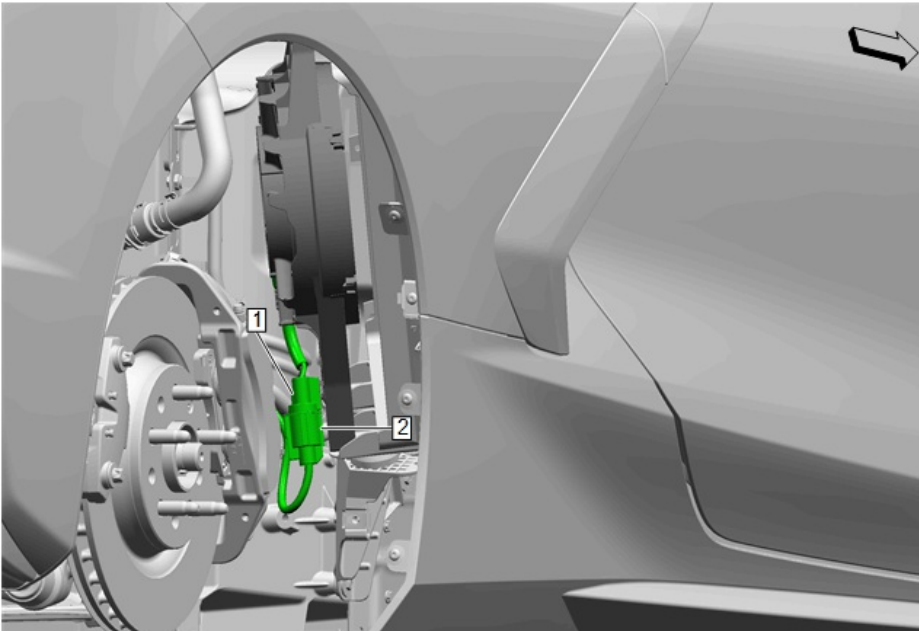

6.
[Click here for full size](#)
7. Connect the electrical connector (2) to the auxiliary engine cooler fan electrical connector (1).

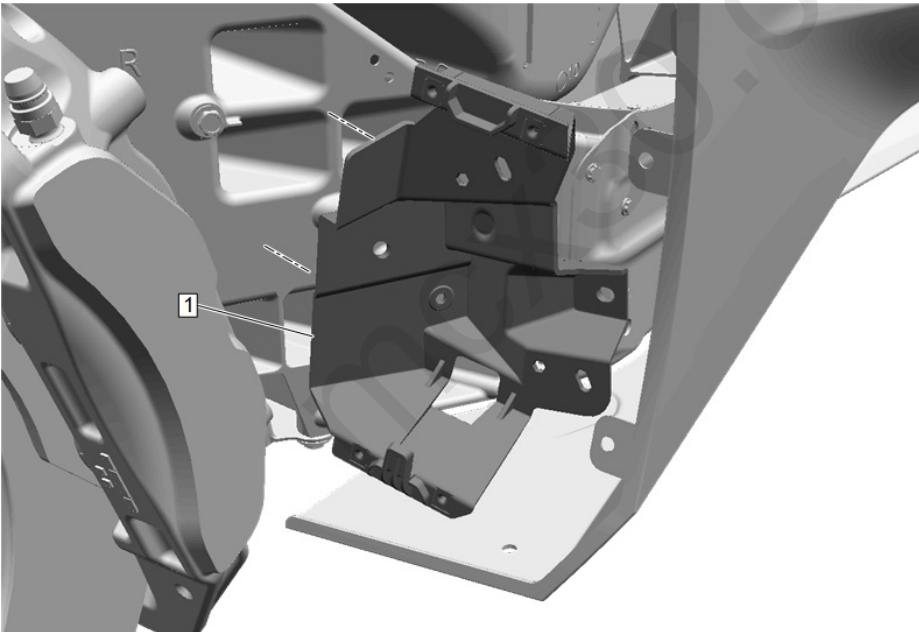

8.
[Click here for full size](#)
9. Transmission Control Module Bracket (1) >> Install - Transmission Control Module Bracket Bracket Replacement

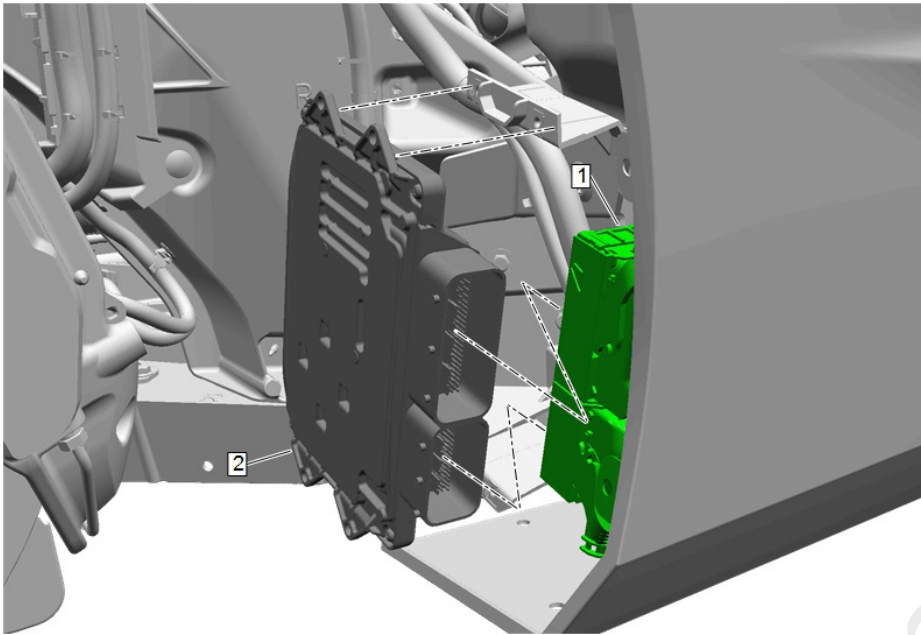

10.

[Click here for full size](#)

11. Transmission Control Module (2) >> Install - Transmission Control Module Replacement

12. Rear Wheelhouse Liner - Right Side >> Install - Rear Wheelhouse Liner Replacement - Right Side