


Electronic Power Steering Motor Control Module Replacement

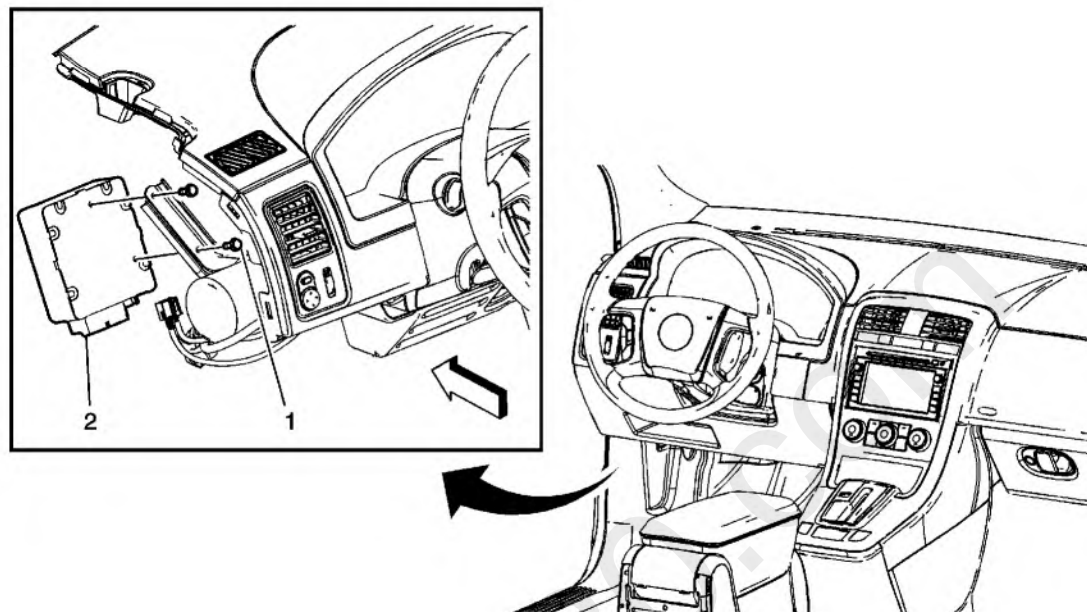

Callout	Component Name
Preliminary Procedure	
Remove the knee bolster. Refer to Knee Bolster Replacement .	
1	Electronic Power Steering Motor Control Module Bolt (Qty: 2) Caution: Refer to Fastener Caution in the Preface section. Tighten 11.5 N·m (102 lb in)
2	Electronic Power Steering Motor Control Module Procedure 1. Disconnect any electrical connectors as needed. 2. After repairs, perform the proper programming and calibration procedures. Refer to Power Steering Control Module Programming and Setup.