


K4M, and TL4

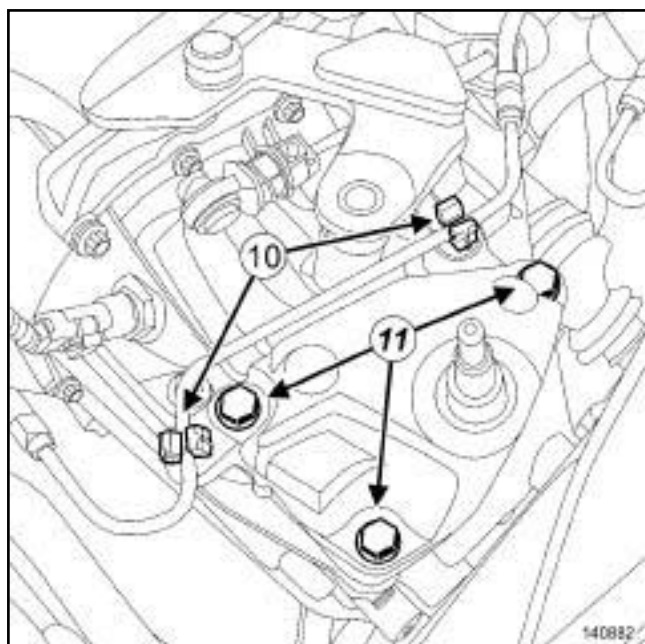

140882

- ☐ Unclip the clutch pipe (10) .
- ☐ Remove:
 - the left-hand suspended engine mounting support bolts (11) on the gearbox,
 - the left-hand suspended engine mounting support on the gearbox.

REFITTING

I - REFITTING OPERATION FOR PART CONCERNED

- ☐ Refit the left-hand suspended engine mounting support on the gearbox.
- ☐ Torque tighten the **bolts of the left-hand suspended engine mounting support on the gearbox (62 N.m)**.
- ☐ Attach the clutch pipe.
- ☐ Refit the left-hand suspended engine mounting support on the body.
- ☐ Torque tighten the **bolts of the left-hand suspended engine mounting support on the body (62 N.m)**.
- ☐ Refit the left-hand suspended engine mounting shaft nut.
- ☐ Torque tighten the **left-hand suspended engine mounting shaft nut (62 N.m)**.

II - FINAL OPERATION

- ☐ Remove the tool (**Mot. 1453**).
- ☐ Fit the wiring channel on the left-hand suspended engine mounting.
- ☐ Refit:
 - the wiring channel on the body,
 - the Protection and Switching Unit,
 - the petrol injection computer,
 - the earth on the body.
- ☐ Torque tighten the **earth nut on the body (8 N.m)**.
- ☐ Connect the connectors of the petrol injection computer.
- ☐ Refit:
 - the air filter unit (see **12A, Fuel mixture, Air filter unit: Removal - Refitting**, page 12A-17) ,
 - the battery tray (see **Battery tray: Removal - Refitting**) (80A, Battery),
 - the battery (see **Battery: Removal - Refitting**) (80A, Battery),
 - the air filter unit air inlet pipe,
 - the front bumper (see **Front bumper: Removal - Refitting**) (55A, Exterior protection),
 - the front wheel arch liners (see **Front wheel arch liner: Removal - Refitting**) (55A, Exterior protection),
 - the front wheels (see **Wheel: Removal - Refitting**) (35A, Wheels and tyres).
 - the scoop under the scuttle panel grille (see **Scoop under the scuttle panel grille: Removal - Refitting**) (56A, Exterior equipment),
 - the scuttle panel grille (see **Scuttle panel grille: Removal - Refitting**) (56A, Exterior equipment),
 - the windscreen wiper arms (see **Windscreen wiper arm: Removal - Refitting**) (85A, Wiping - Washing),
 - the engine undertray.

RENAULT

Technical Note6006A

KXX, and K9K

K9K engine

Engine workshop repair manual

mcx30.com

77 11 328 422

Edition Anglaise

"The repair methods given by the manufacturer in this document are based on the technical specifications current when it was prepared.

The methods may be modified as a result of changes introduced by the manufacturer in the production of the various component units and accessories from which his vehicles are constructed."

All copyrights reserved by Renault.

The reproduction or translation in part of whole of the present document, as well as the use of the spare parts reference numbering system, are prohibited without the prior written consent of Renault.
