


Audio Unit Antenna


Removal

NOTE: Removal steps in this procedure may contain installation details.


1. Remove the antenna mast.

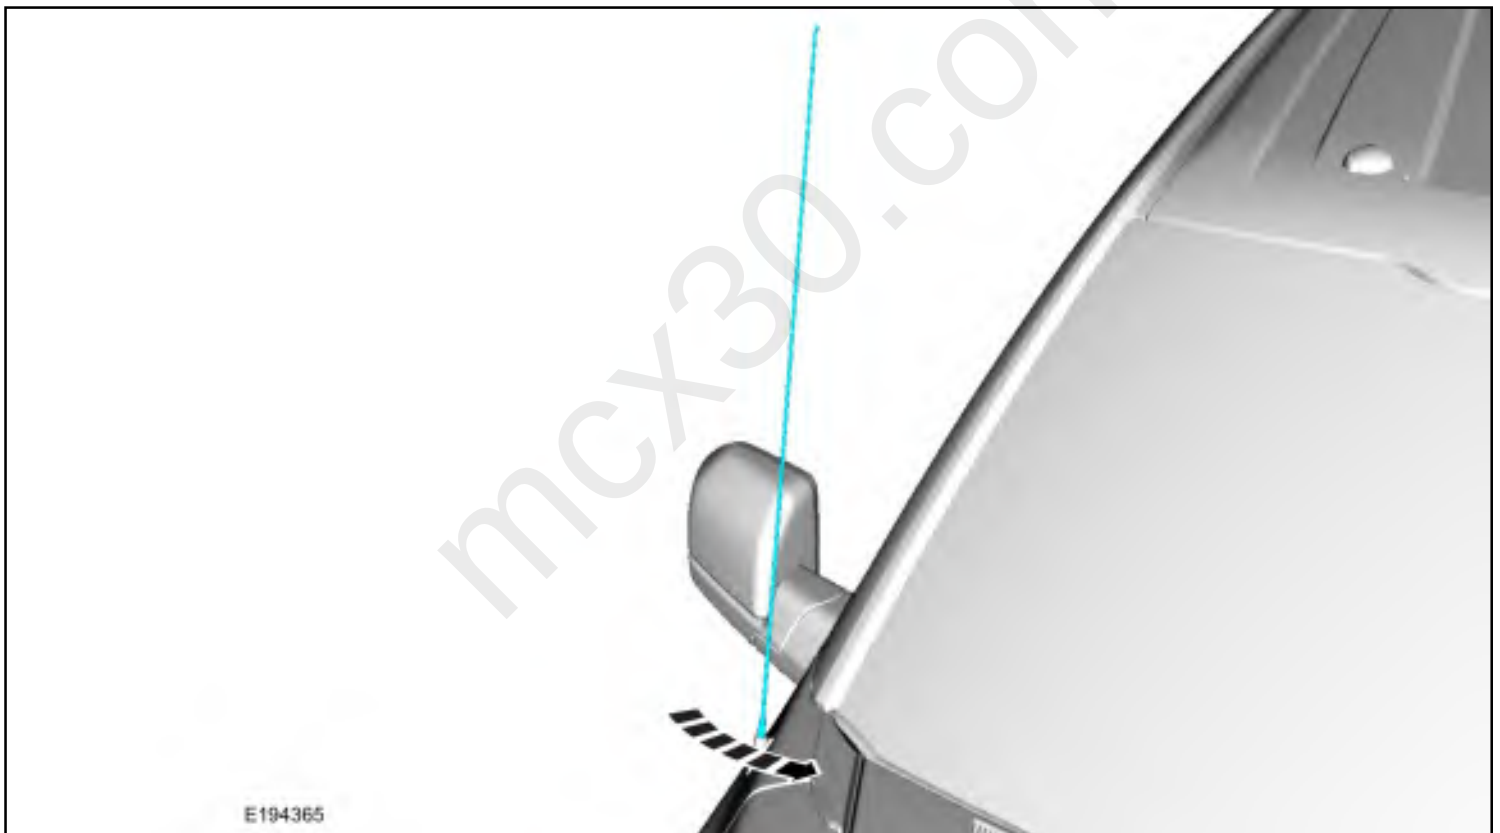

2. Fully lower the glove compartment.

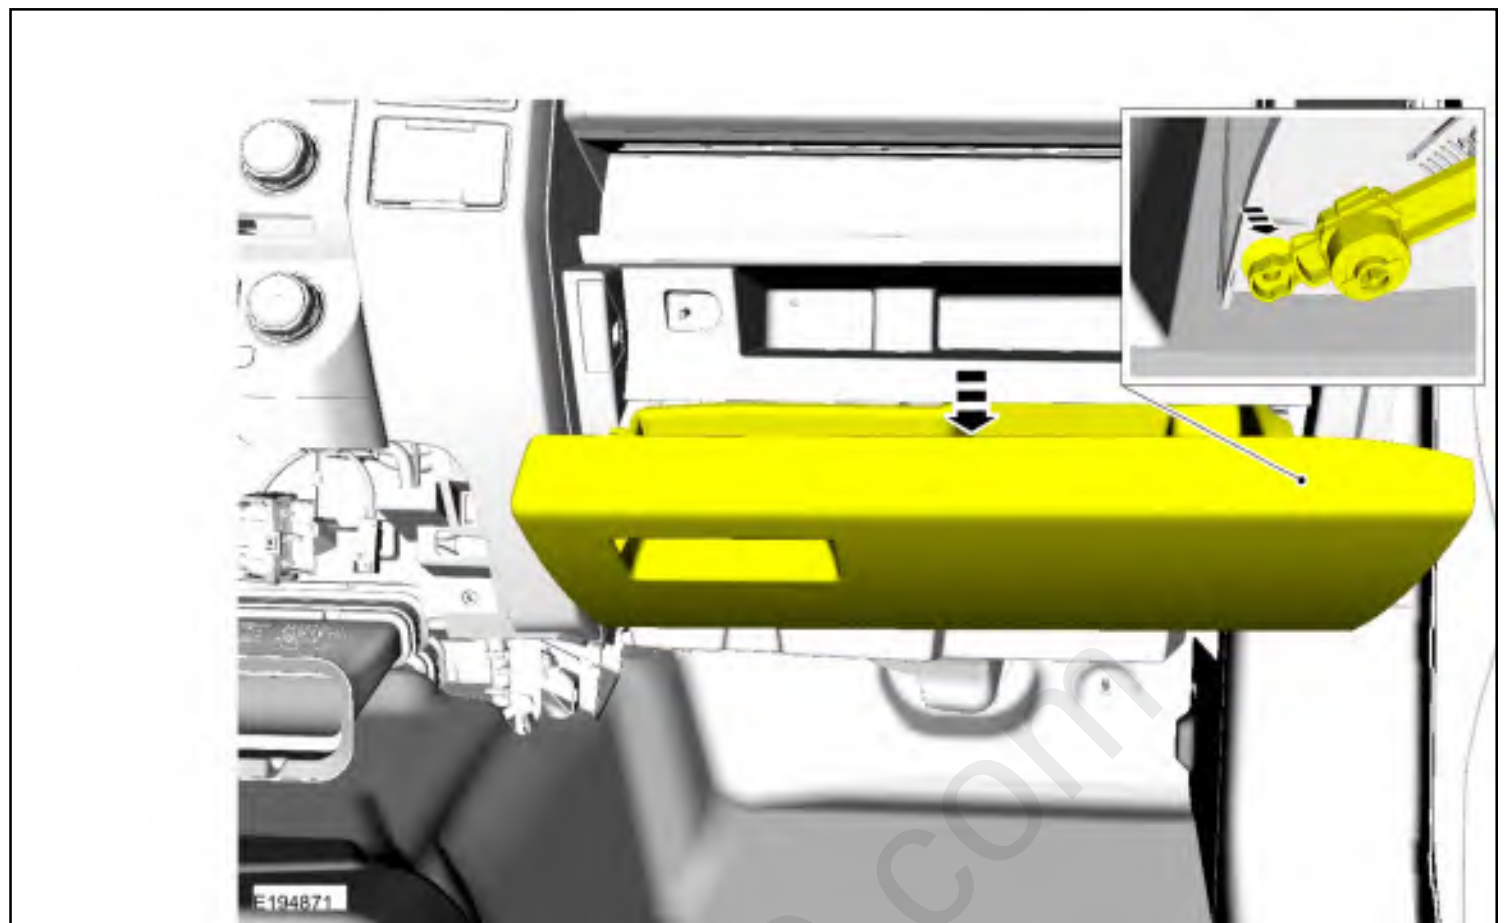

3. Disconnect the audio unit antenna cable and unclip from the HVAC case.

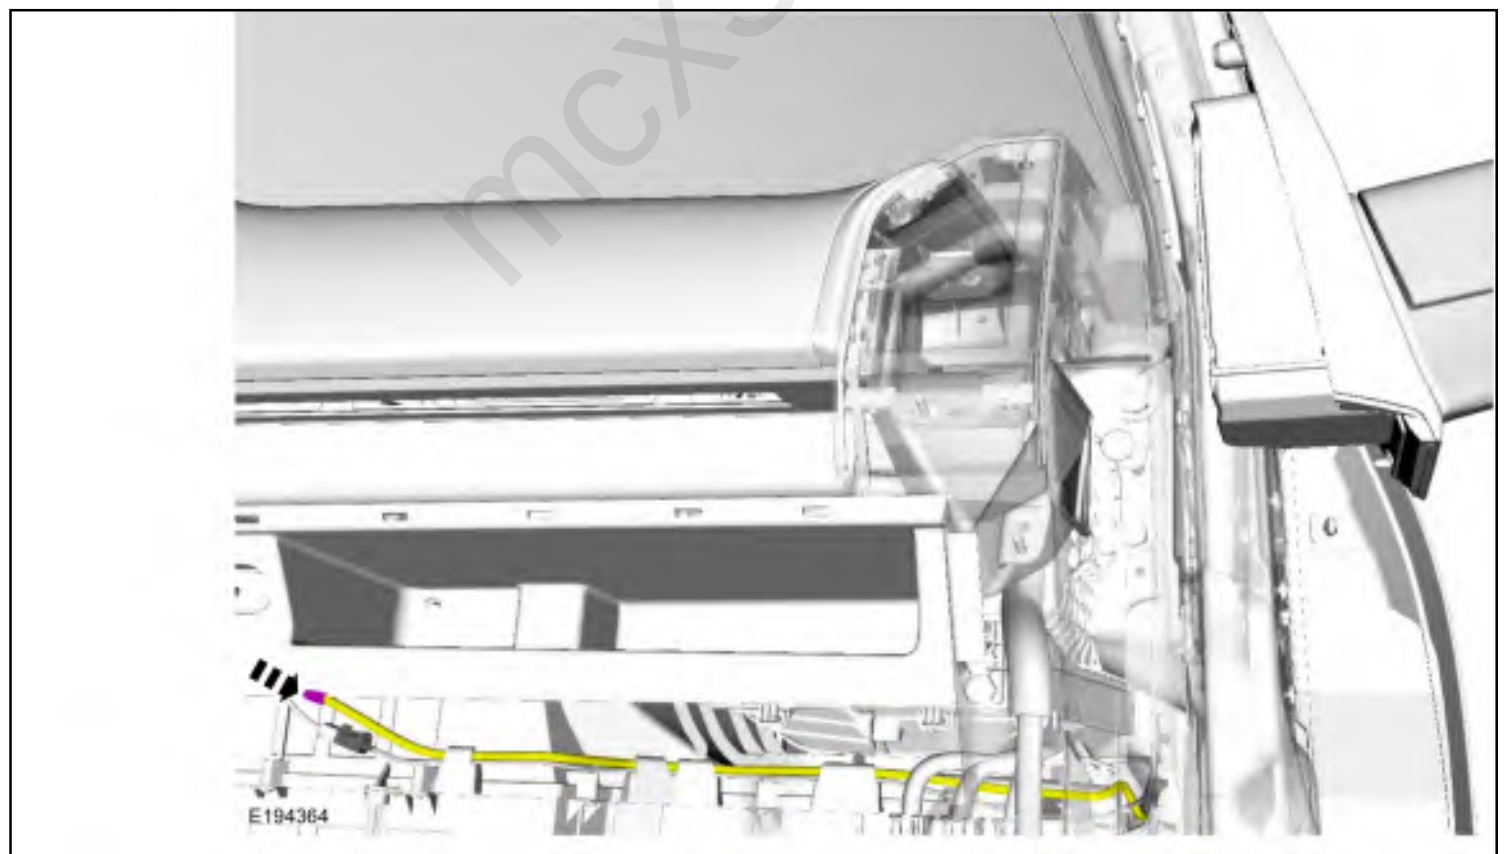

4. Remove the RH fender splash shield.

Refer to: [Fender Splash Shield](#) (501-02 Front End Body Panels, Removal and Installation).


5. **NOTE:** Use repair fastener W717626-S439 if the audio unit antenna bolt threads have stripped. Do not over torque fastener.

1. Remove the audio unit antenna bolt.

Torque: 155 lb.in (17.5 Nm)

2. Lower the audio unit antenna assembly from the fender.

3. Pull the audio unit antenna cable lead through the lower cowl opening, and remove the audio unit antenna assembly.

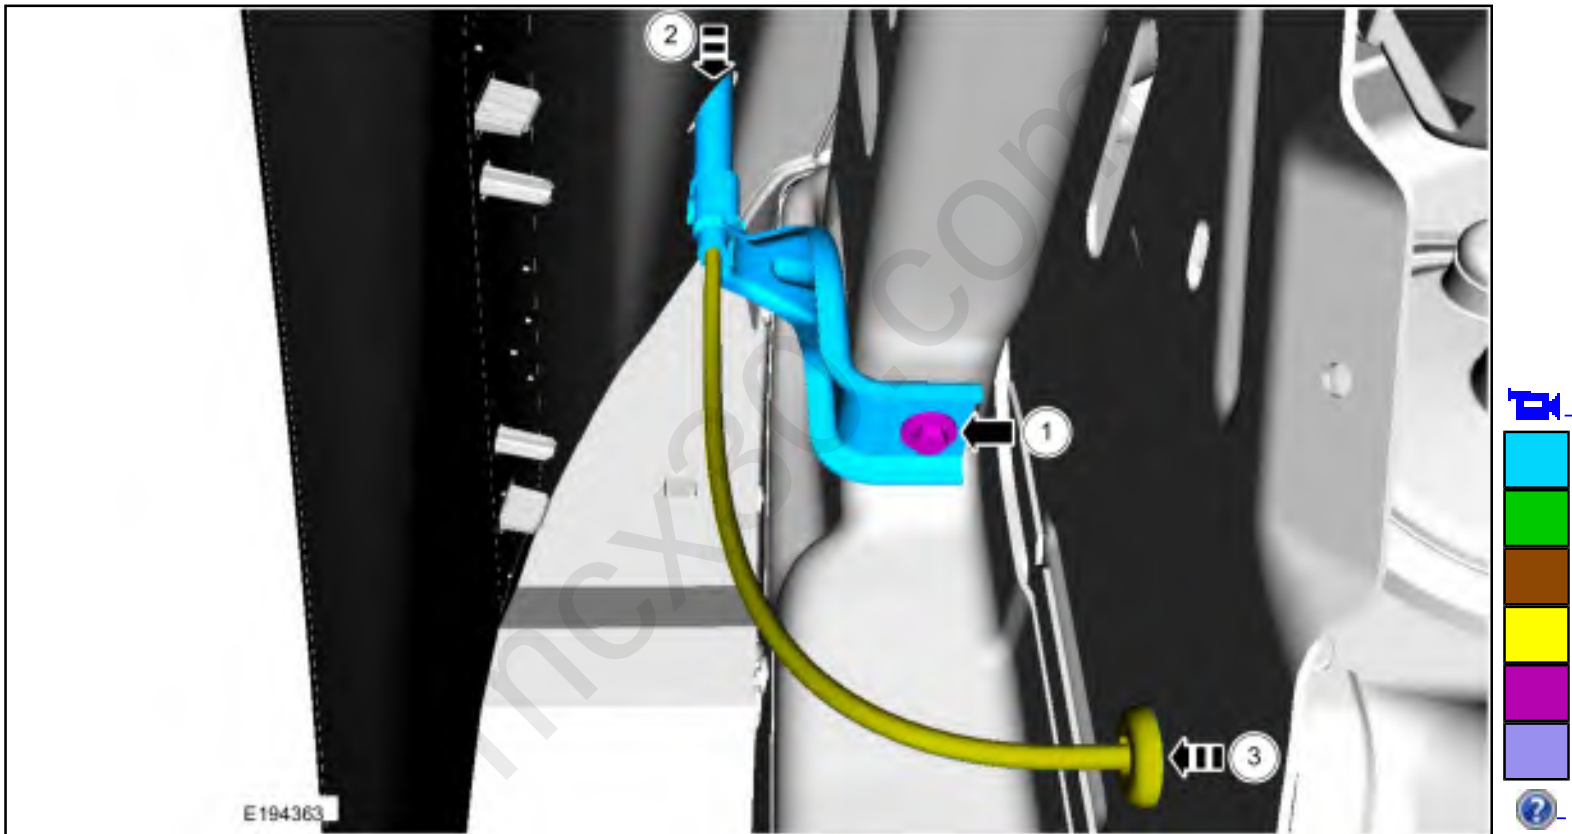

Installation

1. To install, reverse the removal procedure.