



Repair-80x02x02x01-01x67-1-43-1.xml



XSL version : 3.02 du 22/07/11

mcx30.com

HEADLINING:REMOVAL-REFITTING



Note, one or more warnings are present in this procedure



WARNING



■ To avoid all risk of damage to the systems, apply the safety and cleanliness instructions and operation recommendations before carrying out any repair:

- [Airbag and pretensioners: Precautions for the repair](#) ,
- [Vehicle: Precautions for the repair](#) .

Locations and specifications (tightening torques, parts to always be replaced, etc.)([see 71A, Body internal trim, Roof trim assembly: Exploded view](#)) .

REMOVAL

1. REMOVAL PREPARATION OPERATION



Disconnect the battery[Battery: Removal - Refitting](#) .



Move:



the front door seals,



the rear door seals,

the luggage compartment seal.



Unclip the B-pillar lower trims([see 71A, Body internal trim, Interior body side trim assembly: Exploded view](#))



Remove the front seat belts[Front seat assembly: Exploded view](#) .



Unclip the B-pillar upper trims([see 71A, Body internal trim, Interior body side trim assembly: Exploded view](#)) .

Remove [Rear bench seat assembly: Exploded view](#) :

-
- the rear bench seat base,
- the rear seat belts,
- the rear bench seatback.

Remove:

-
- the luggage compartment carpet,
- the rear end panel lining.

Remove [\(see 71A, Body internal trim, Interior body side trim assembly: Exploded view\)](#) :

-
- the rear inner sill upper trim,
- the rear door sill lining,
- the rear parcel shelf side trims,
- the rear wheel arch interior trims,
- the rear quarter panel trims,
- the windscreen pillar trims.

Remove [\(see 71A, Body internal trim, Roof trim assembly: Exploded view\)](#) :

-
- the sun visors,
-

the grab handles.

Remove:



the interior rear-view mirror,



the interior light [Interior lighting: List and location of components](#) ,



the windscreen wiper arms(see **Wipers/washing assembly : Exploded view**) ,



the scuttle panel grille [Scuttle panel grille: Removal - Refitting](#) ,



the scoop under the scuttle panel grille,



the windscreen [Windscreen: Removal - Refitting](#) .

Remove:




the cover of the centre seat belt return mechanism bolt,



the centre seat belt return mechanism mounting.

2. REMOVAL OPERATION

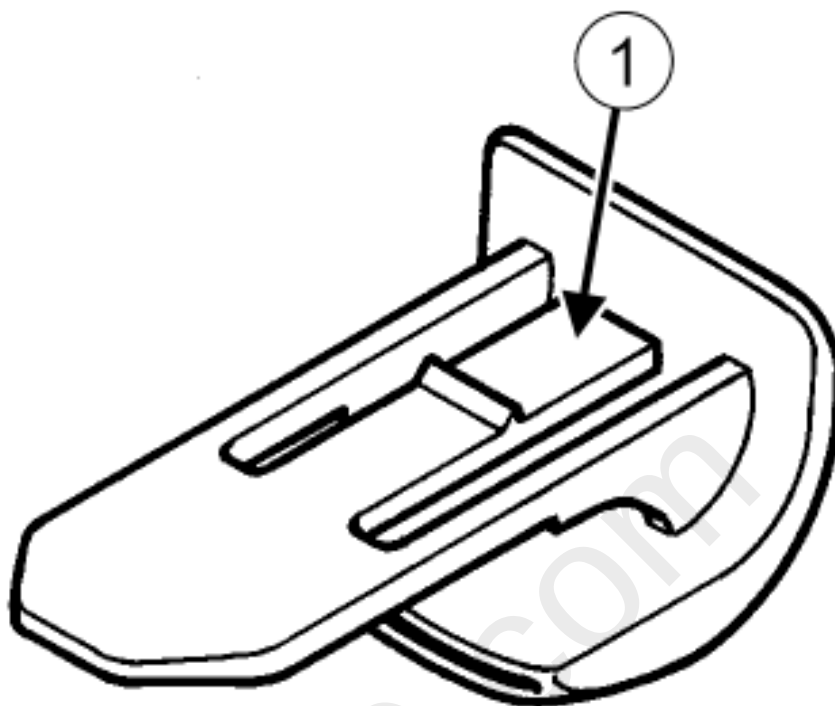

97193

Remove [\(see 71A, Body internal trim, Roof trim assembly: Exploded view\)](#) :

-
- the rear clips by pressing on the clip(1) using a small flat-blade screwdriver,
- the headlining by removing from the front (this operation requires two people).